



1711




1711 Bridge plate weld poor

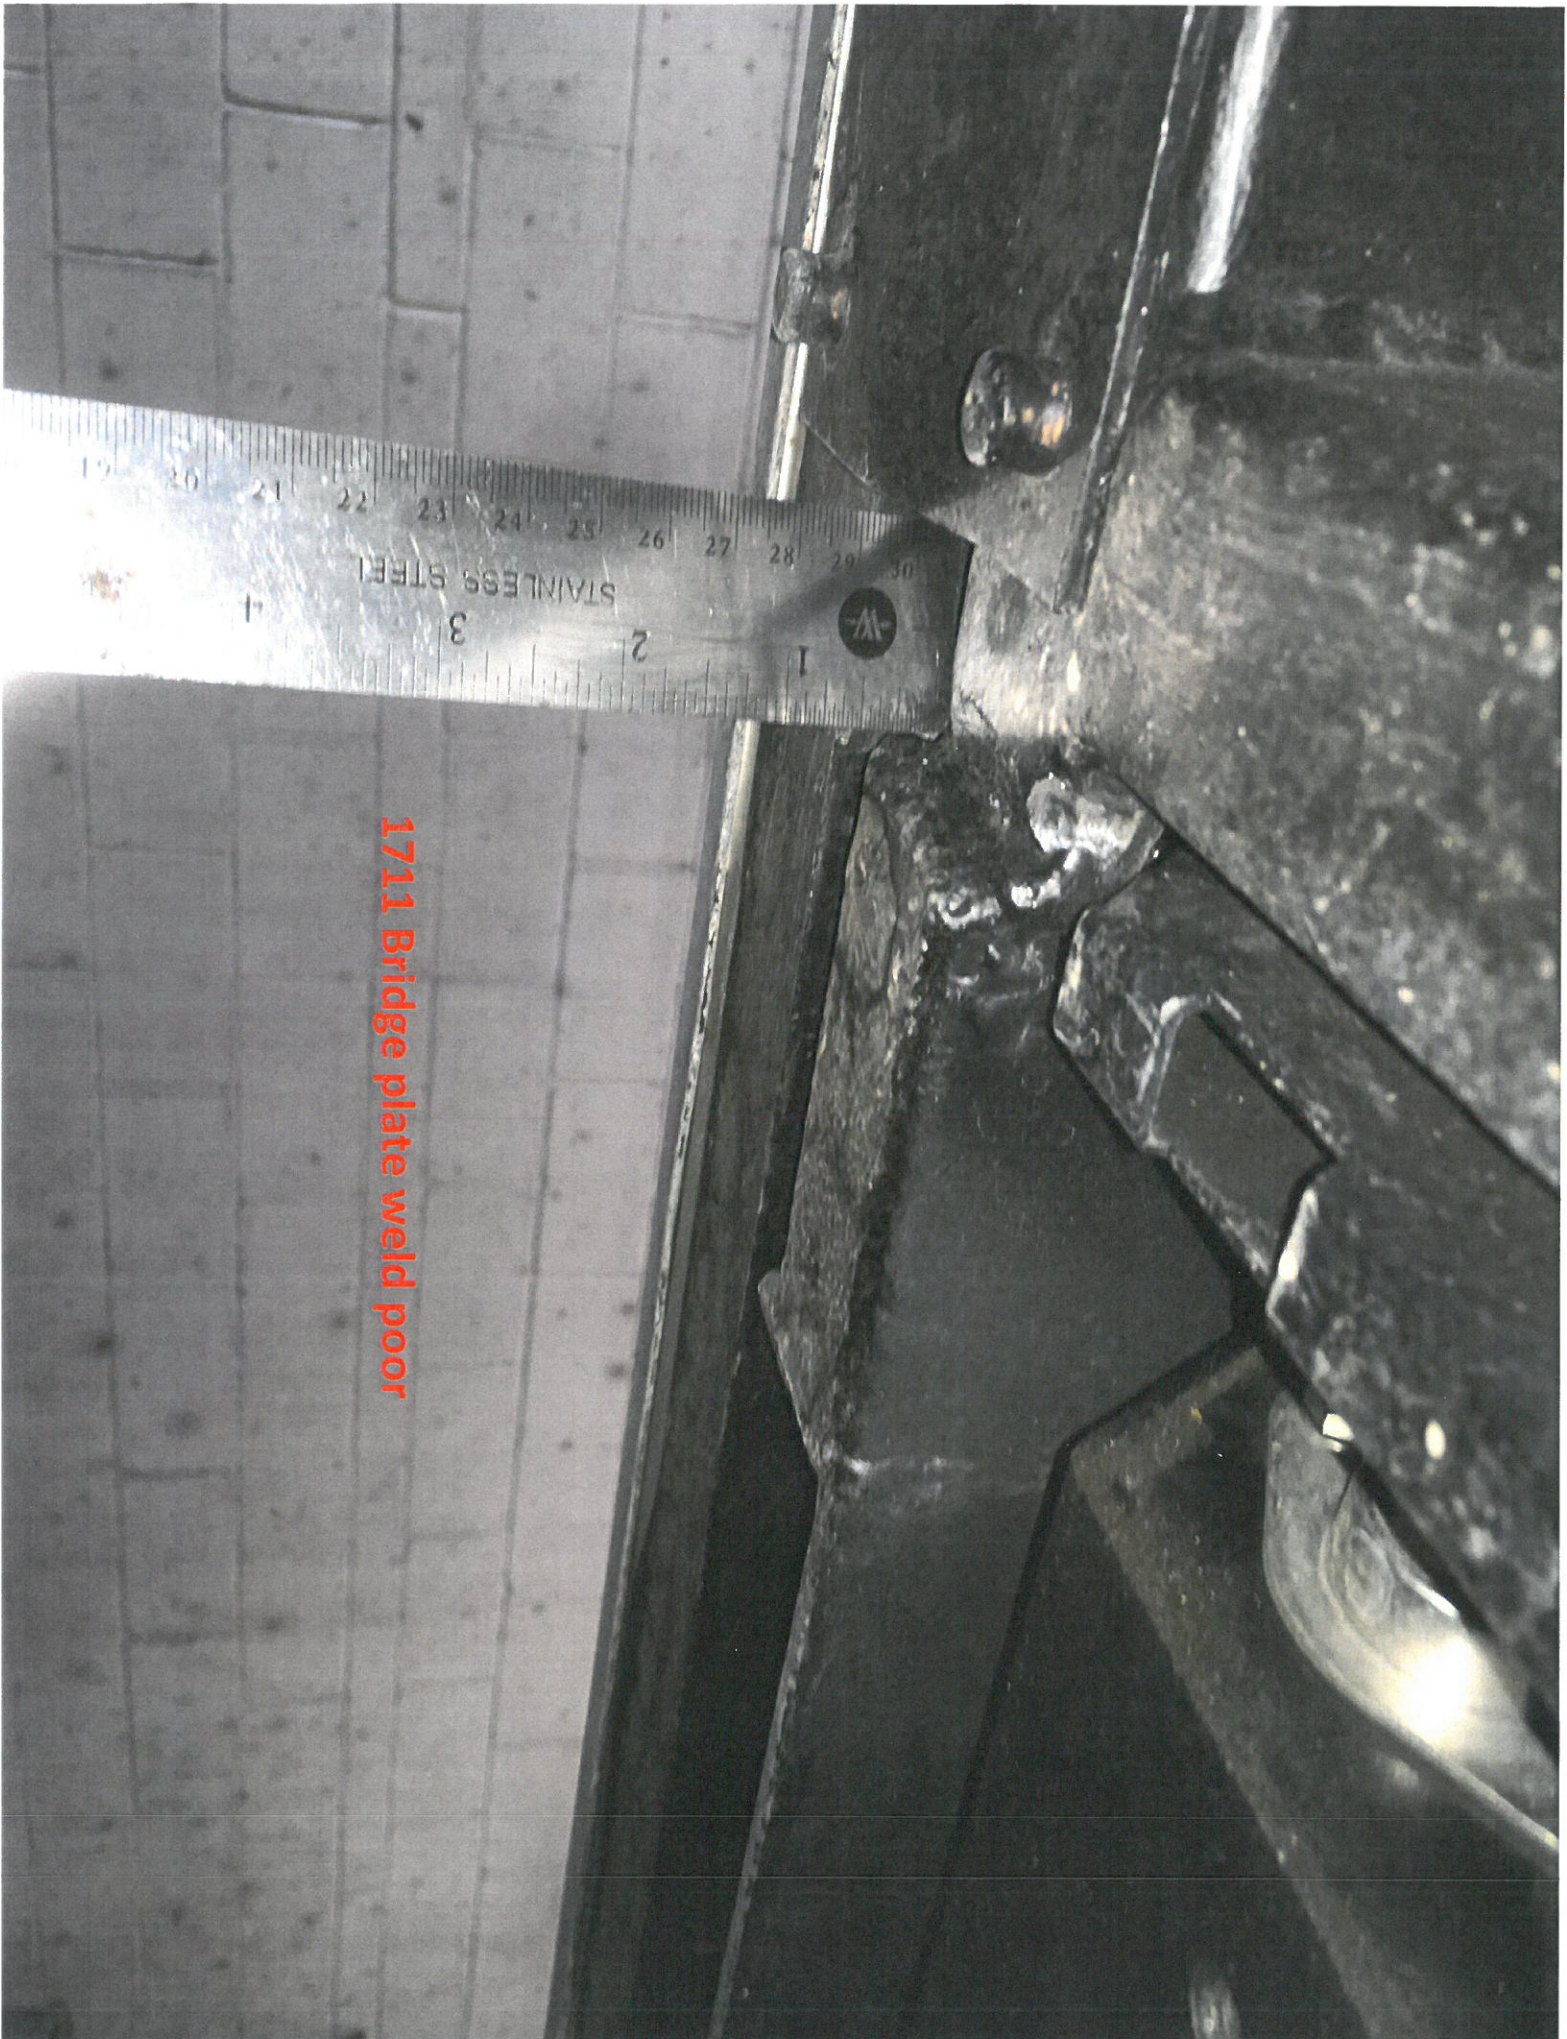


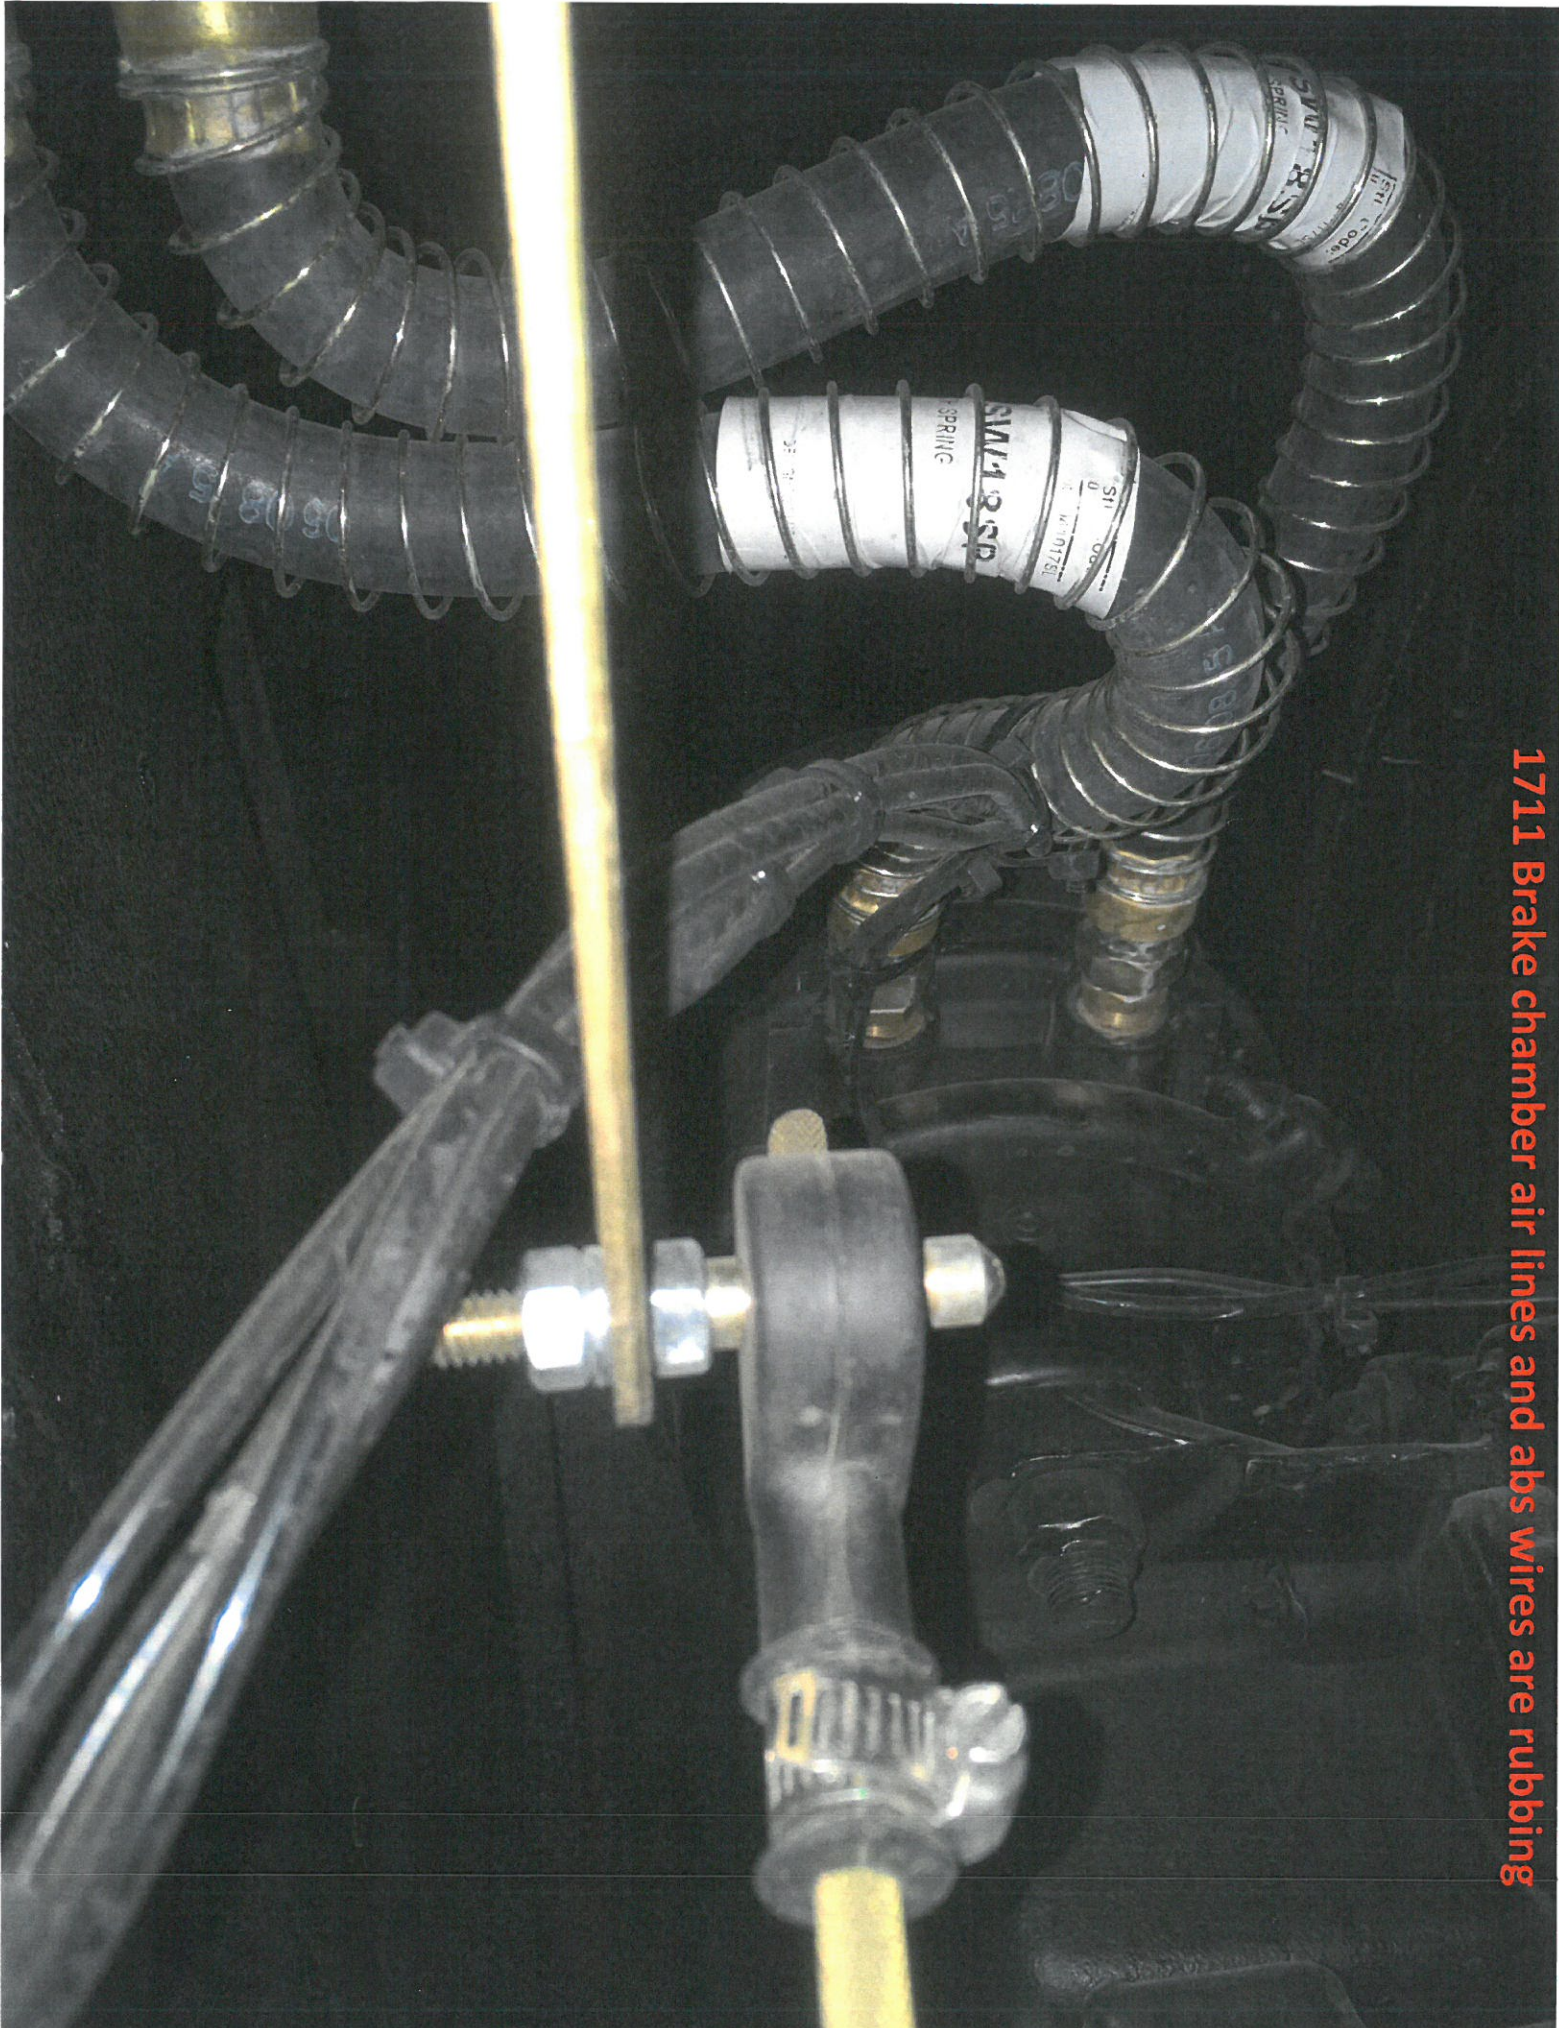

1711 Brake chamber air lines and abs wires are rubbing


1711 Lines are rubbing

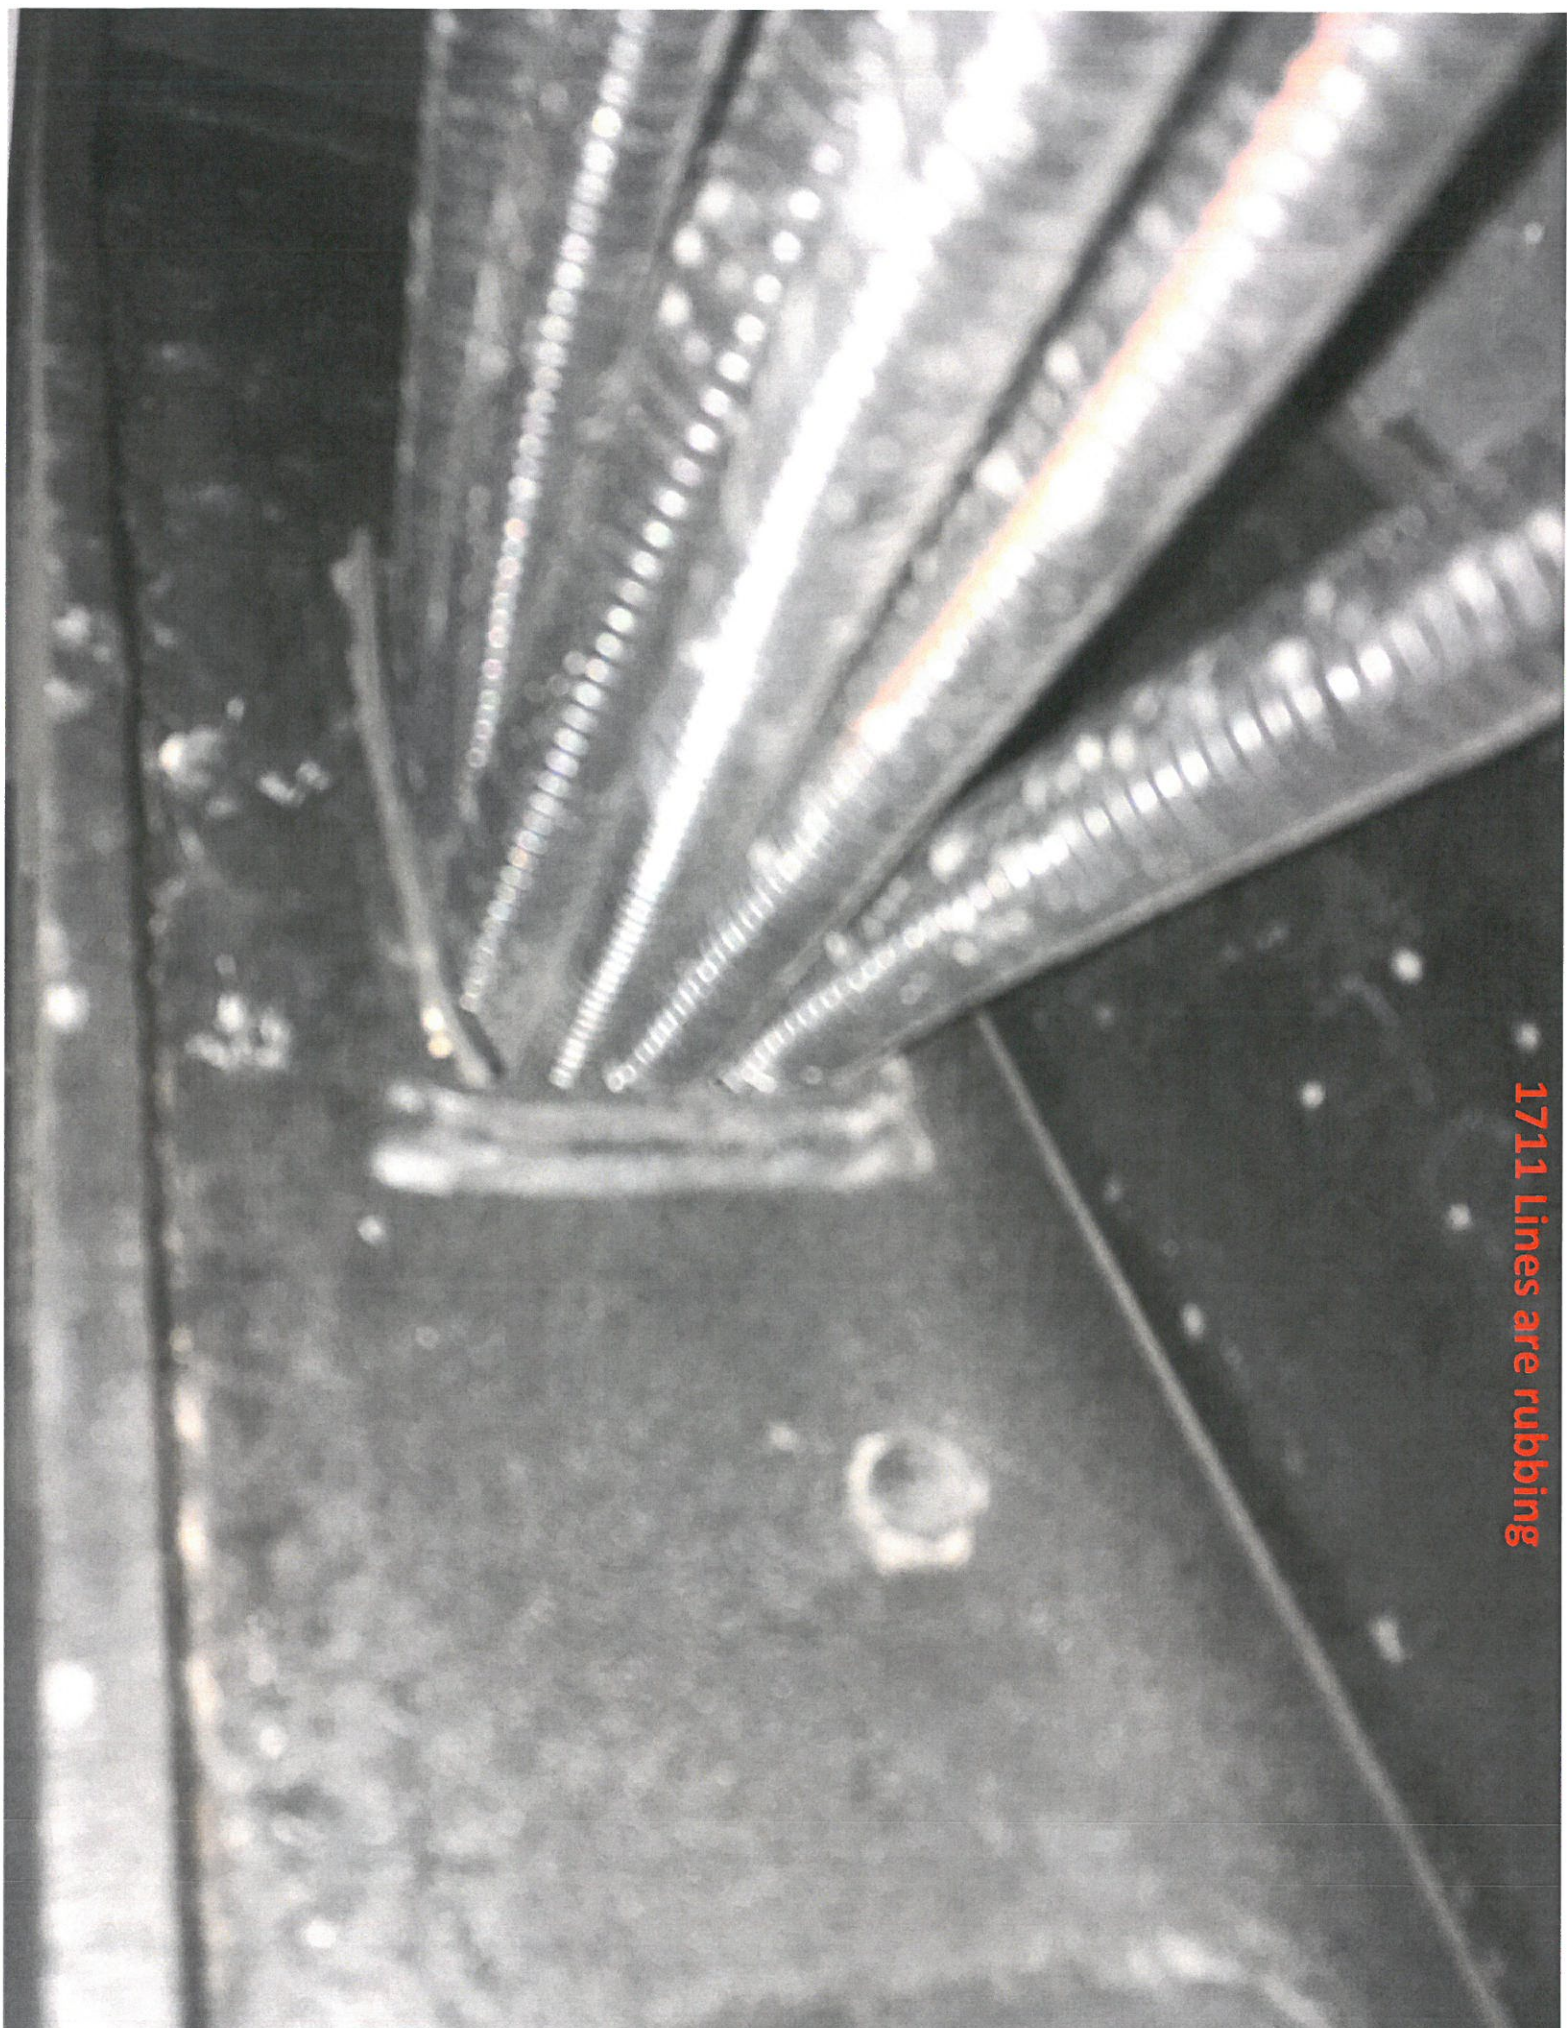

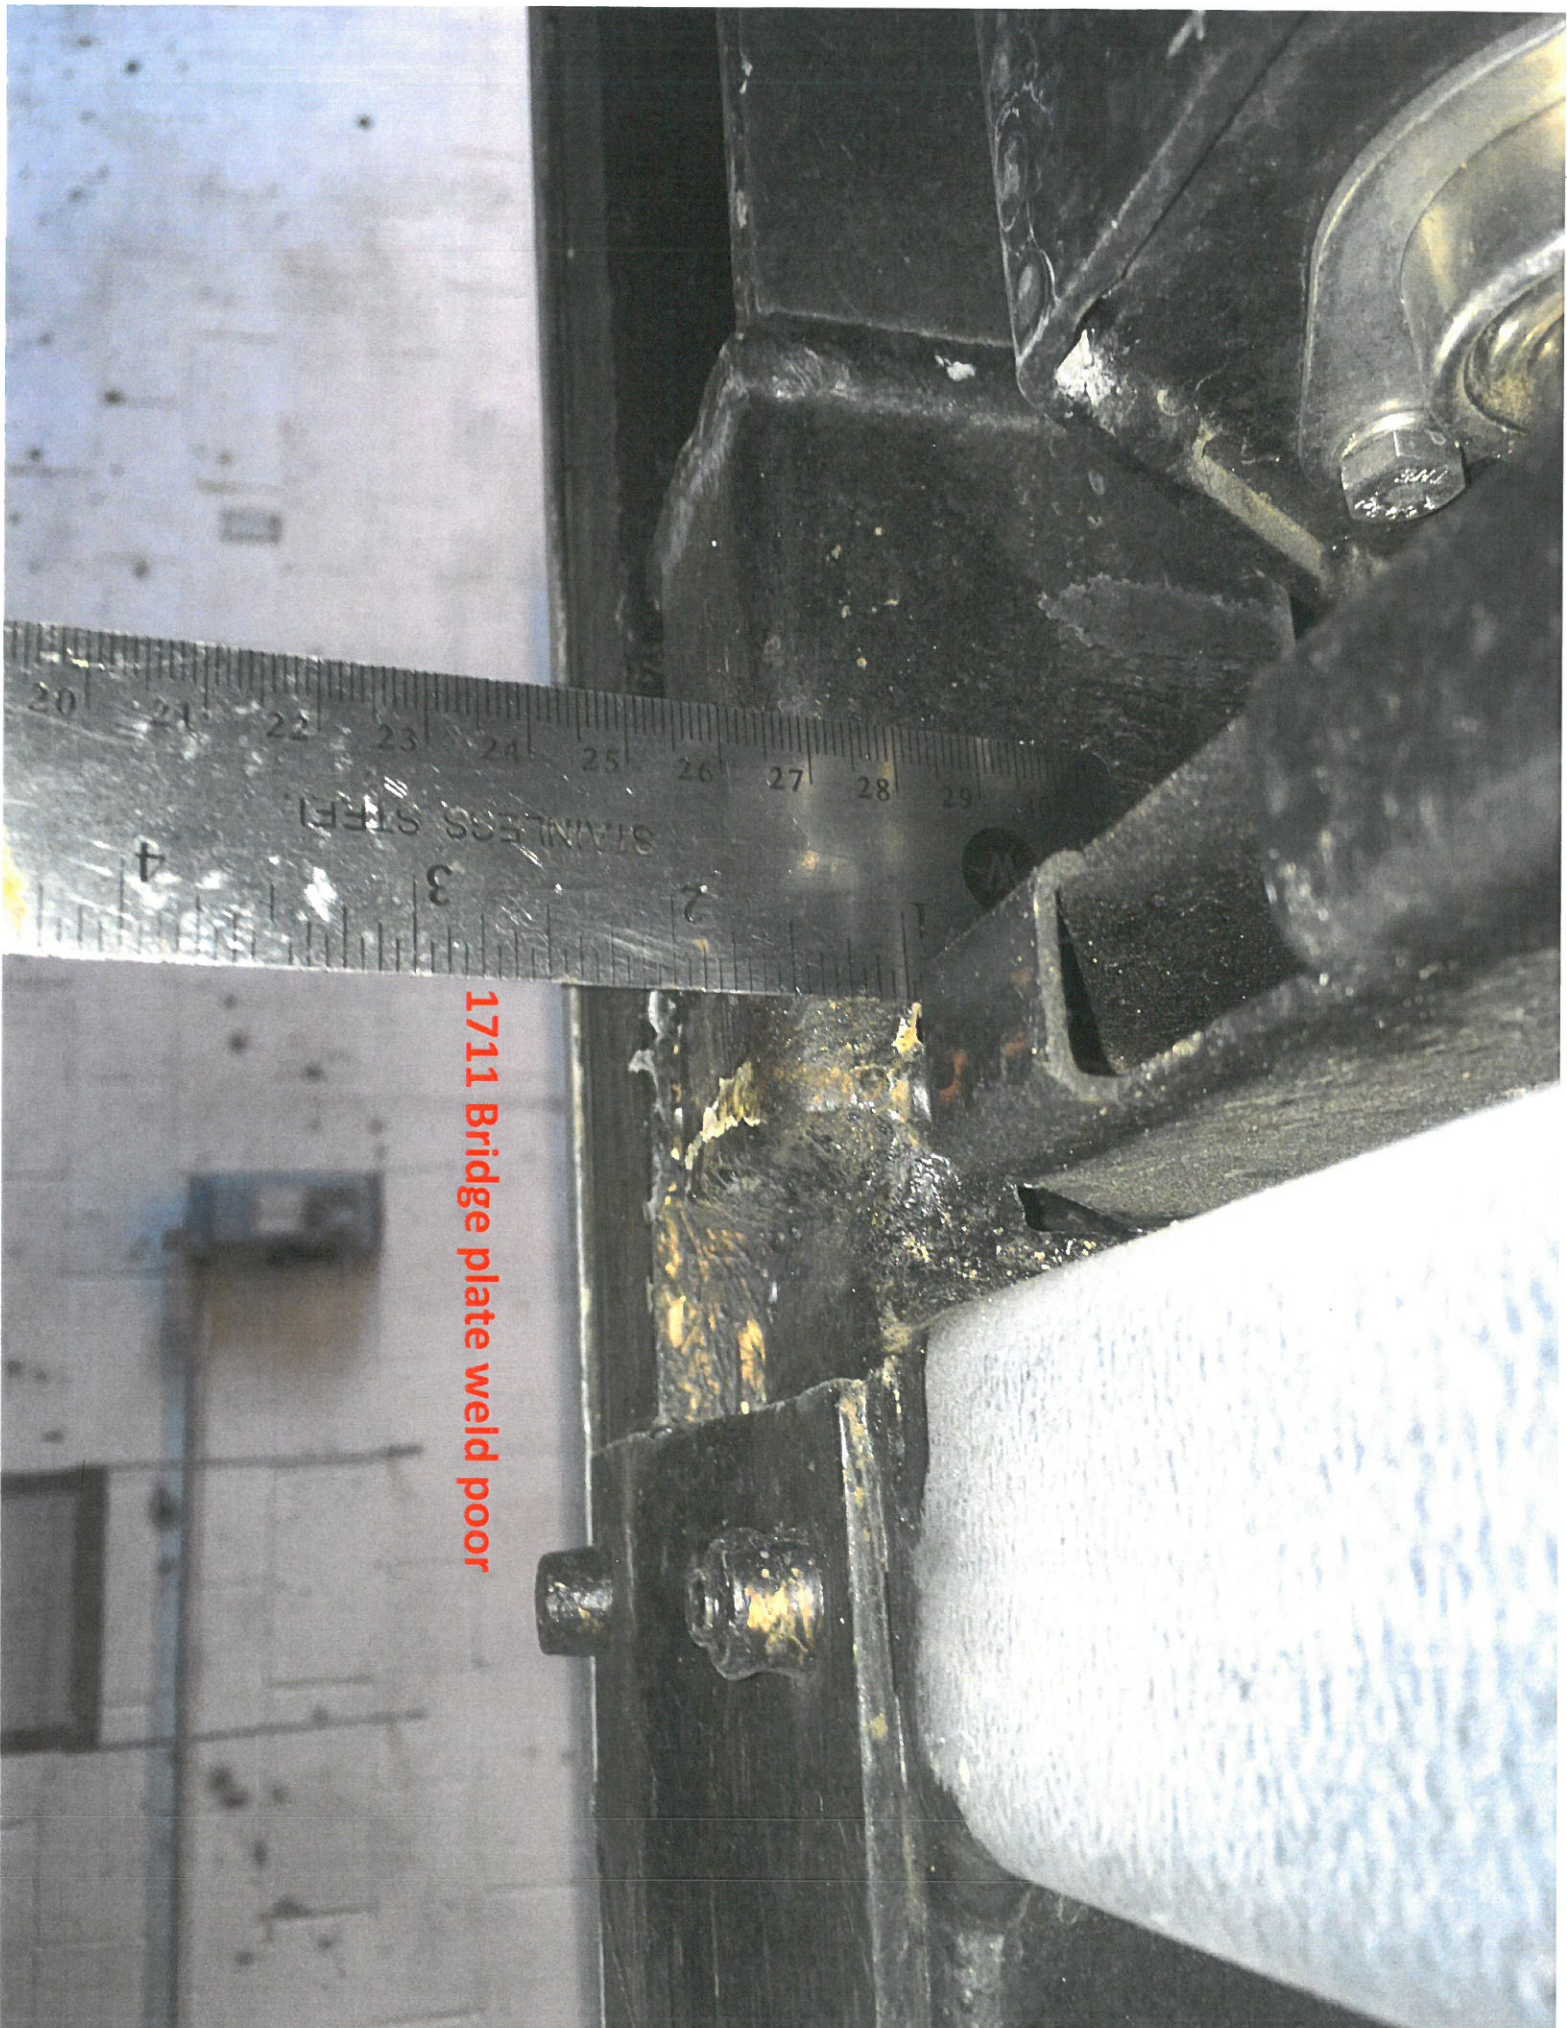

1711 Bridge plate weld poor


1711 Lines are rubbing

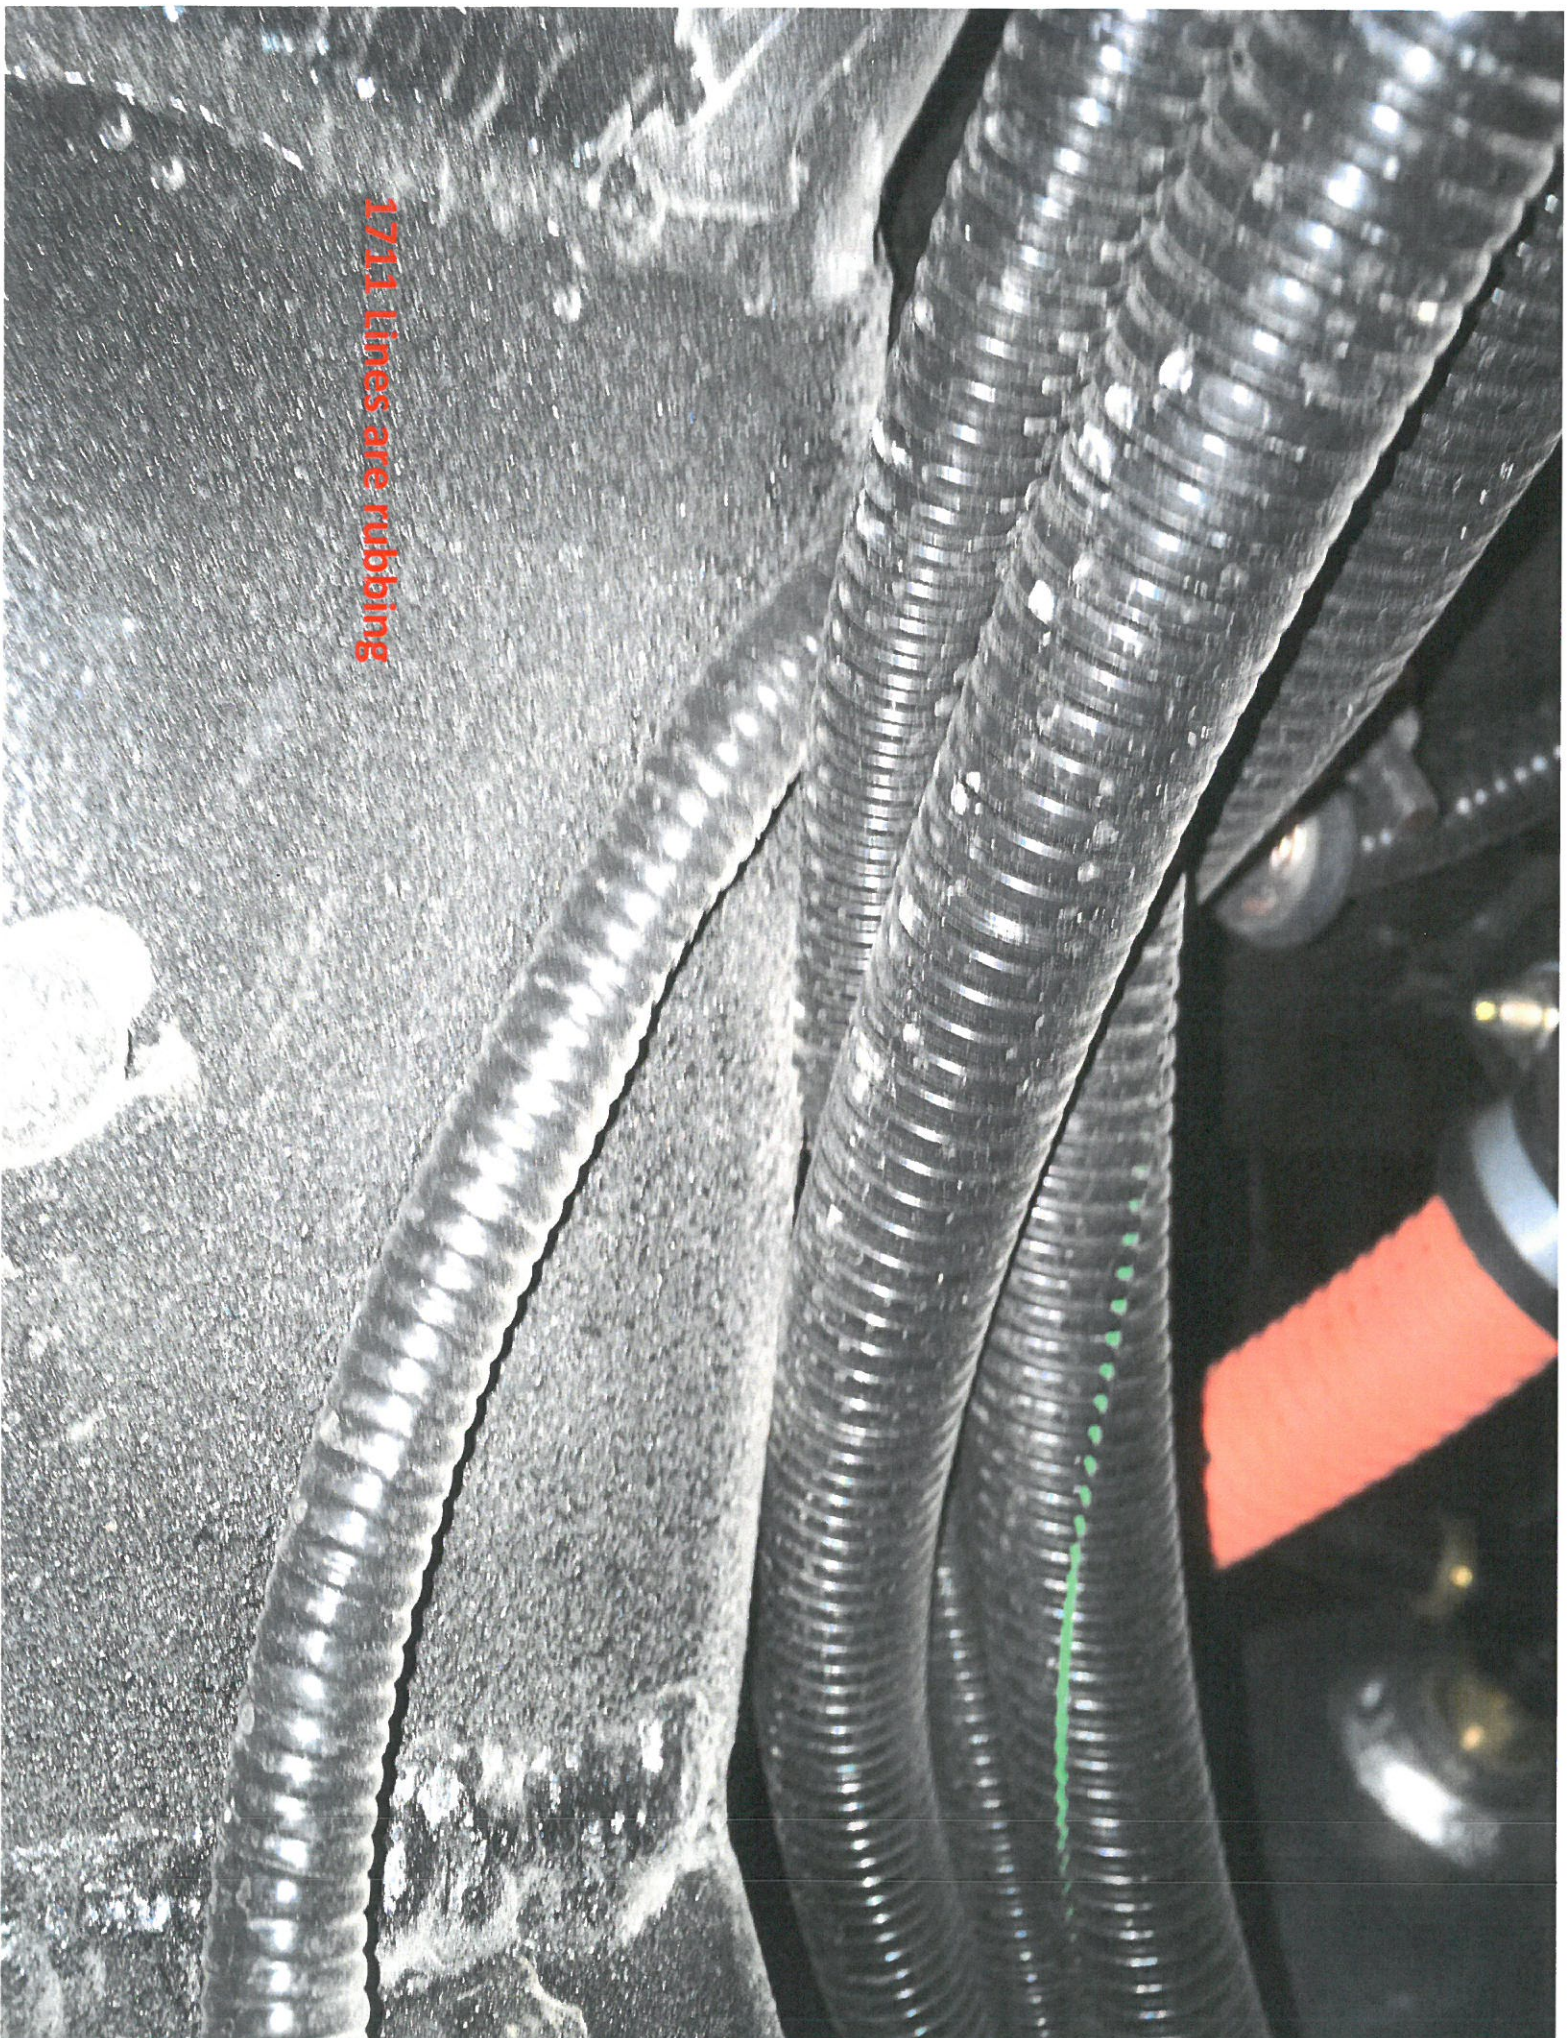

1711 Lines are rubbing



1711 High voltage line terminal is only insulated with electrical tape

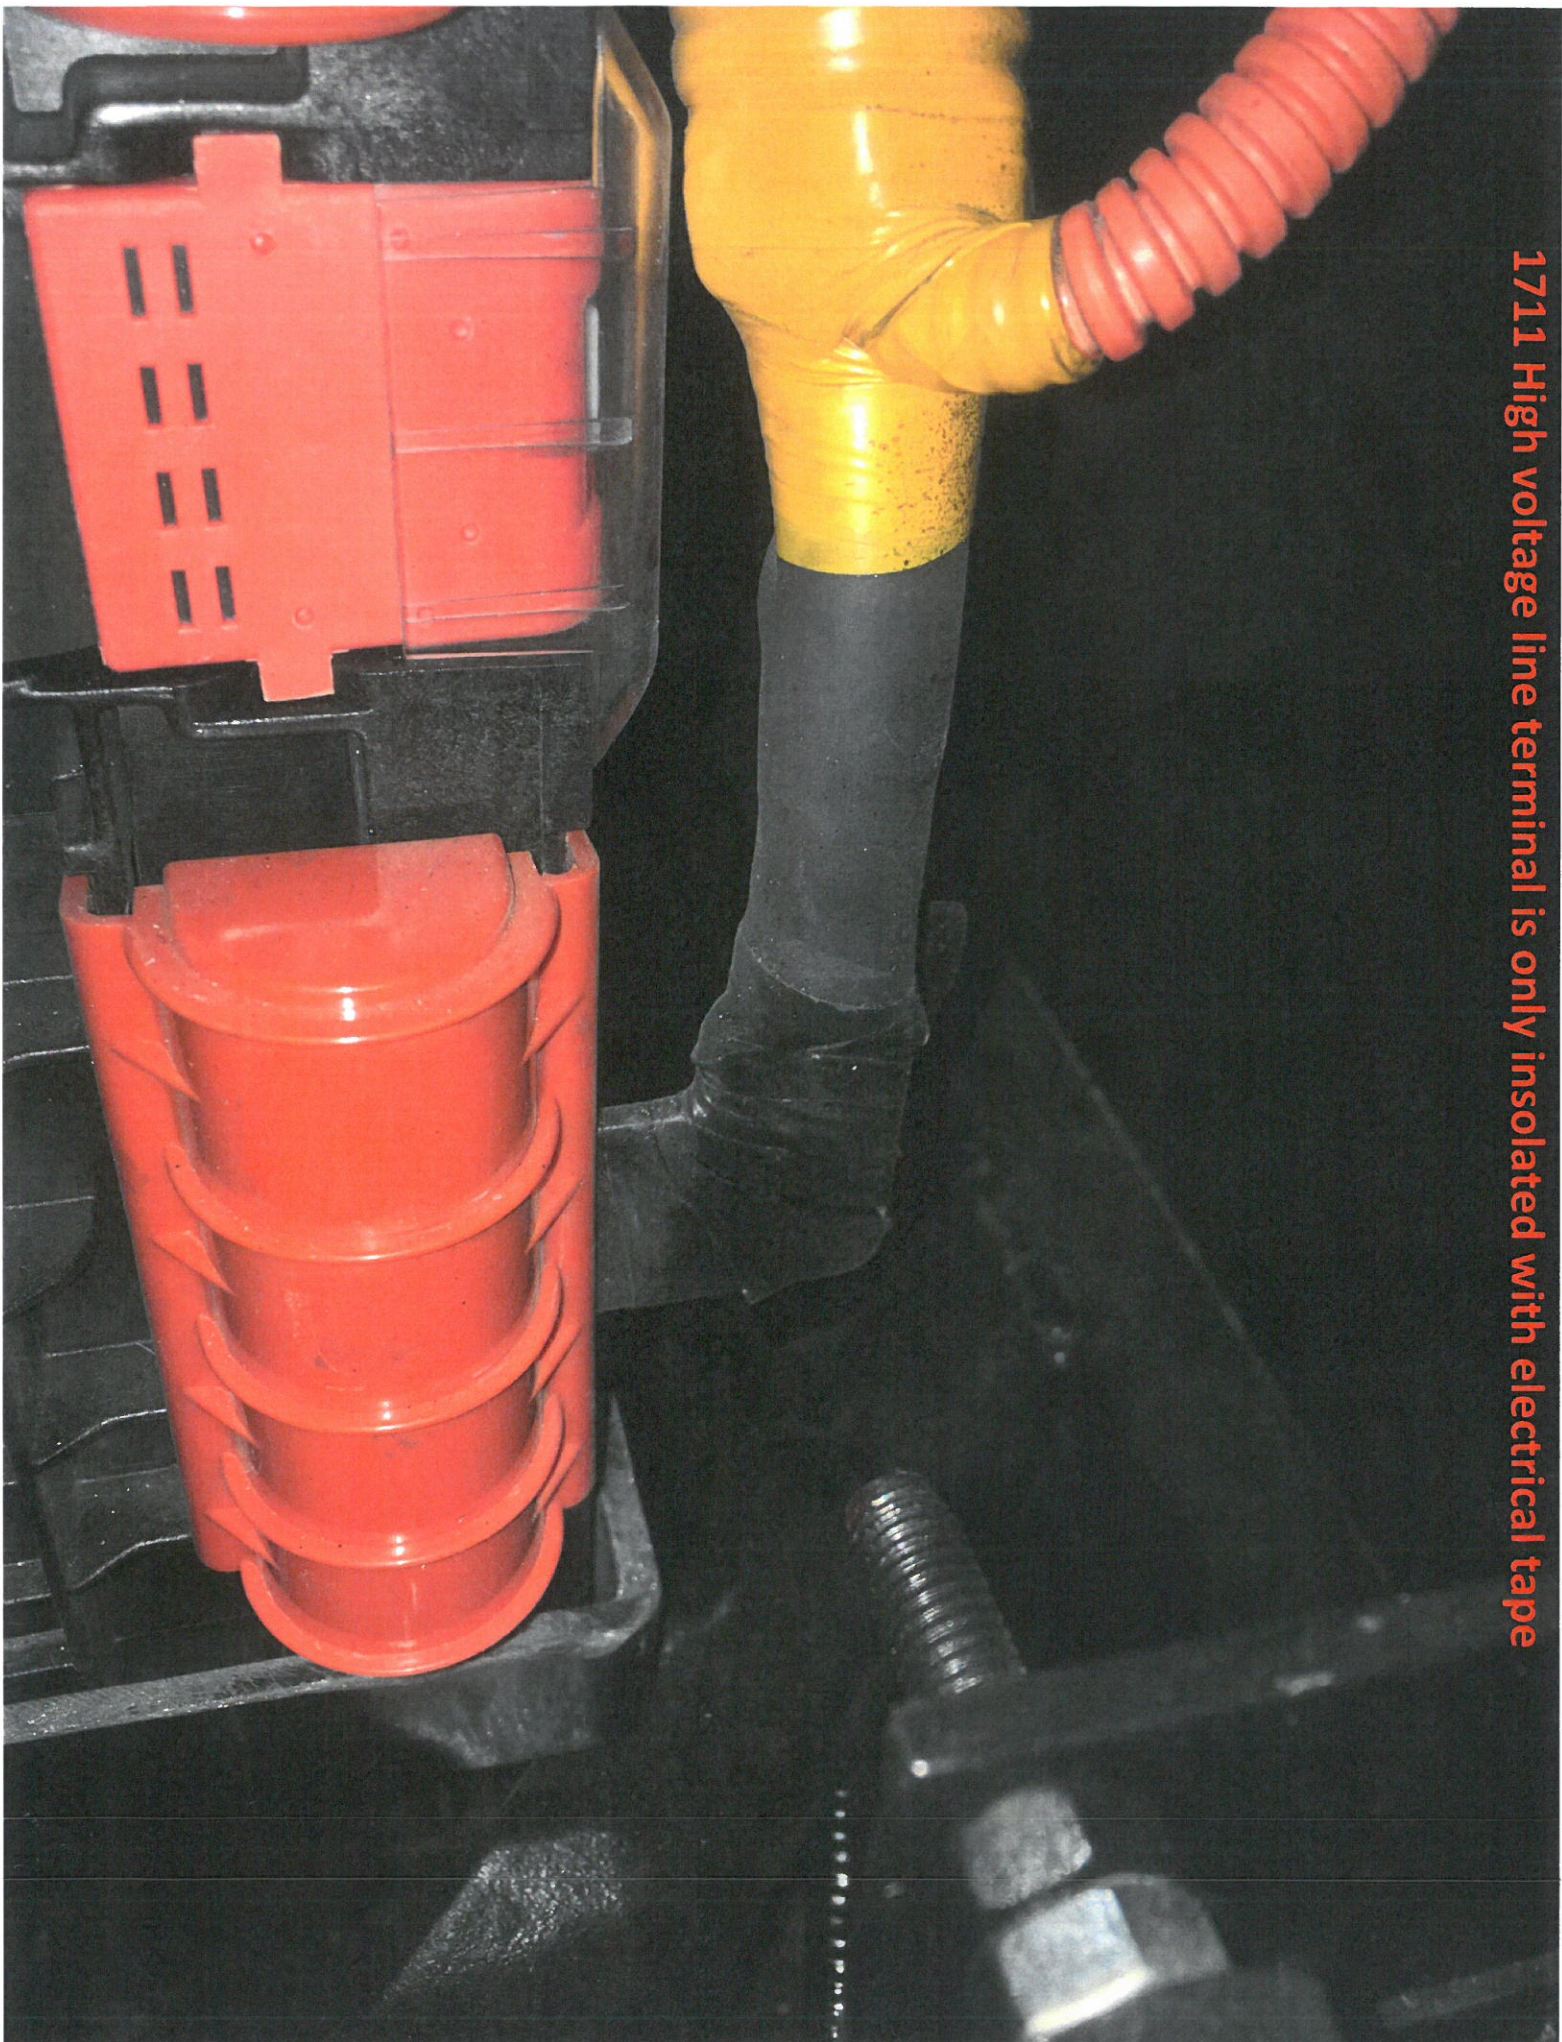


A close-up photograph of high-voltage electrical equipment. The image shows several thick, ribbed cables with orange insulation. One cable has a yellow section. A metal fitting is visible on the left side, partially obscuring the cables. The background is dark and textured.

1711 High voltage cable rubbing




1711 Fire suppression and high voltage lines are rubbing

1711 High voltage cable
rubbing

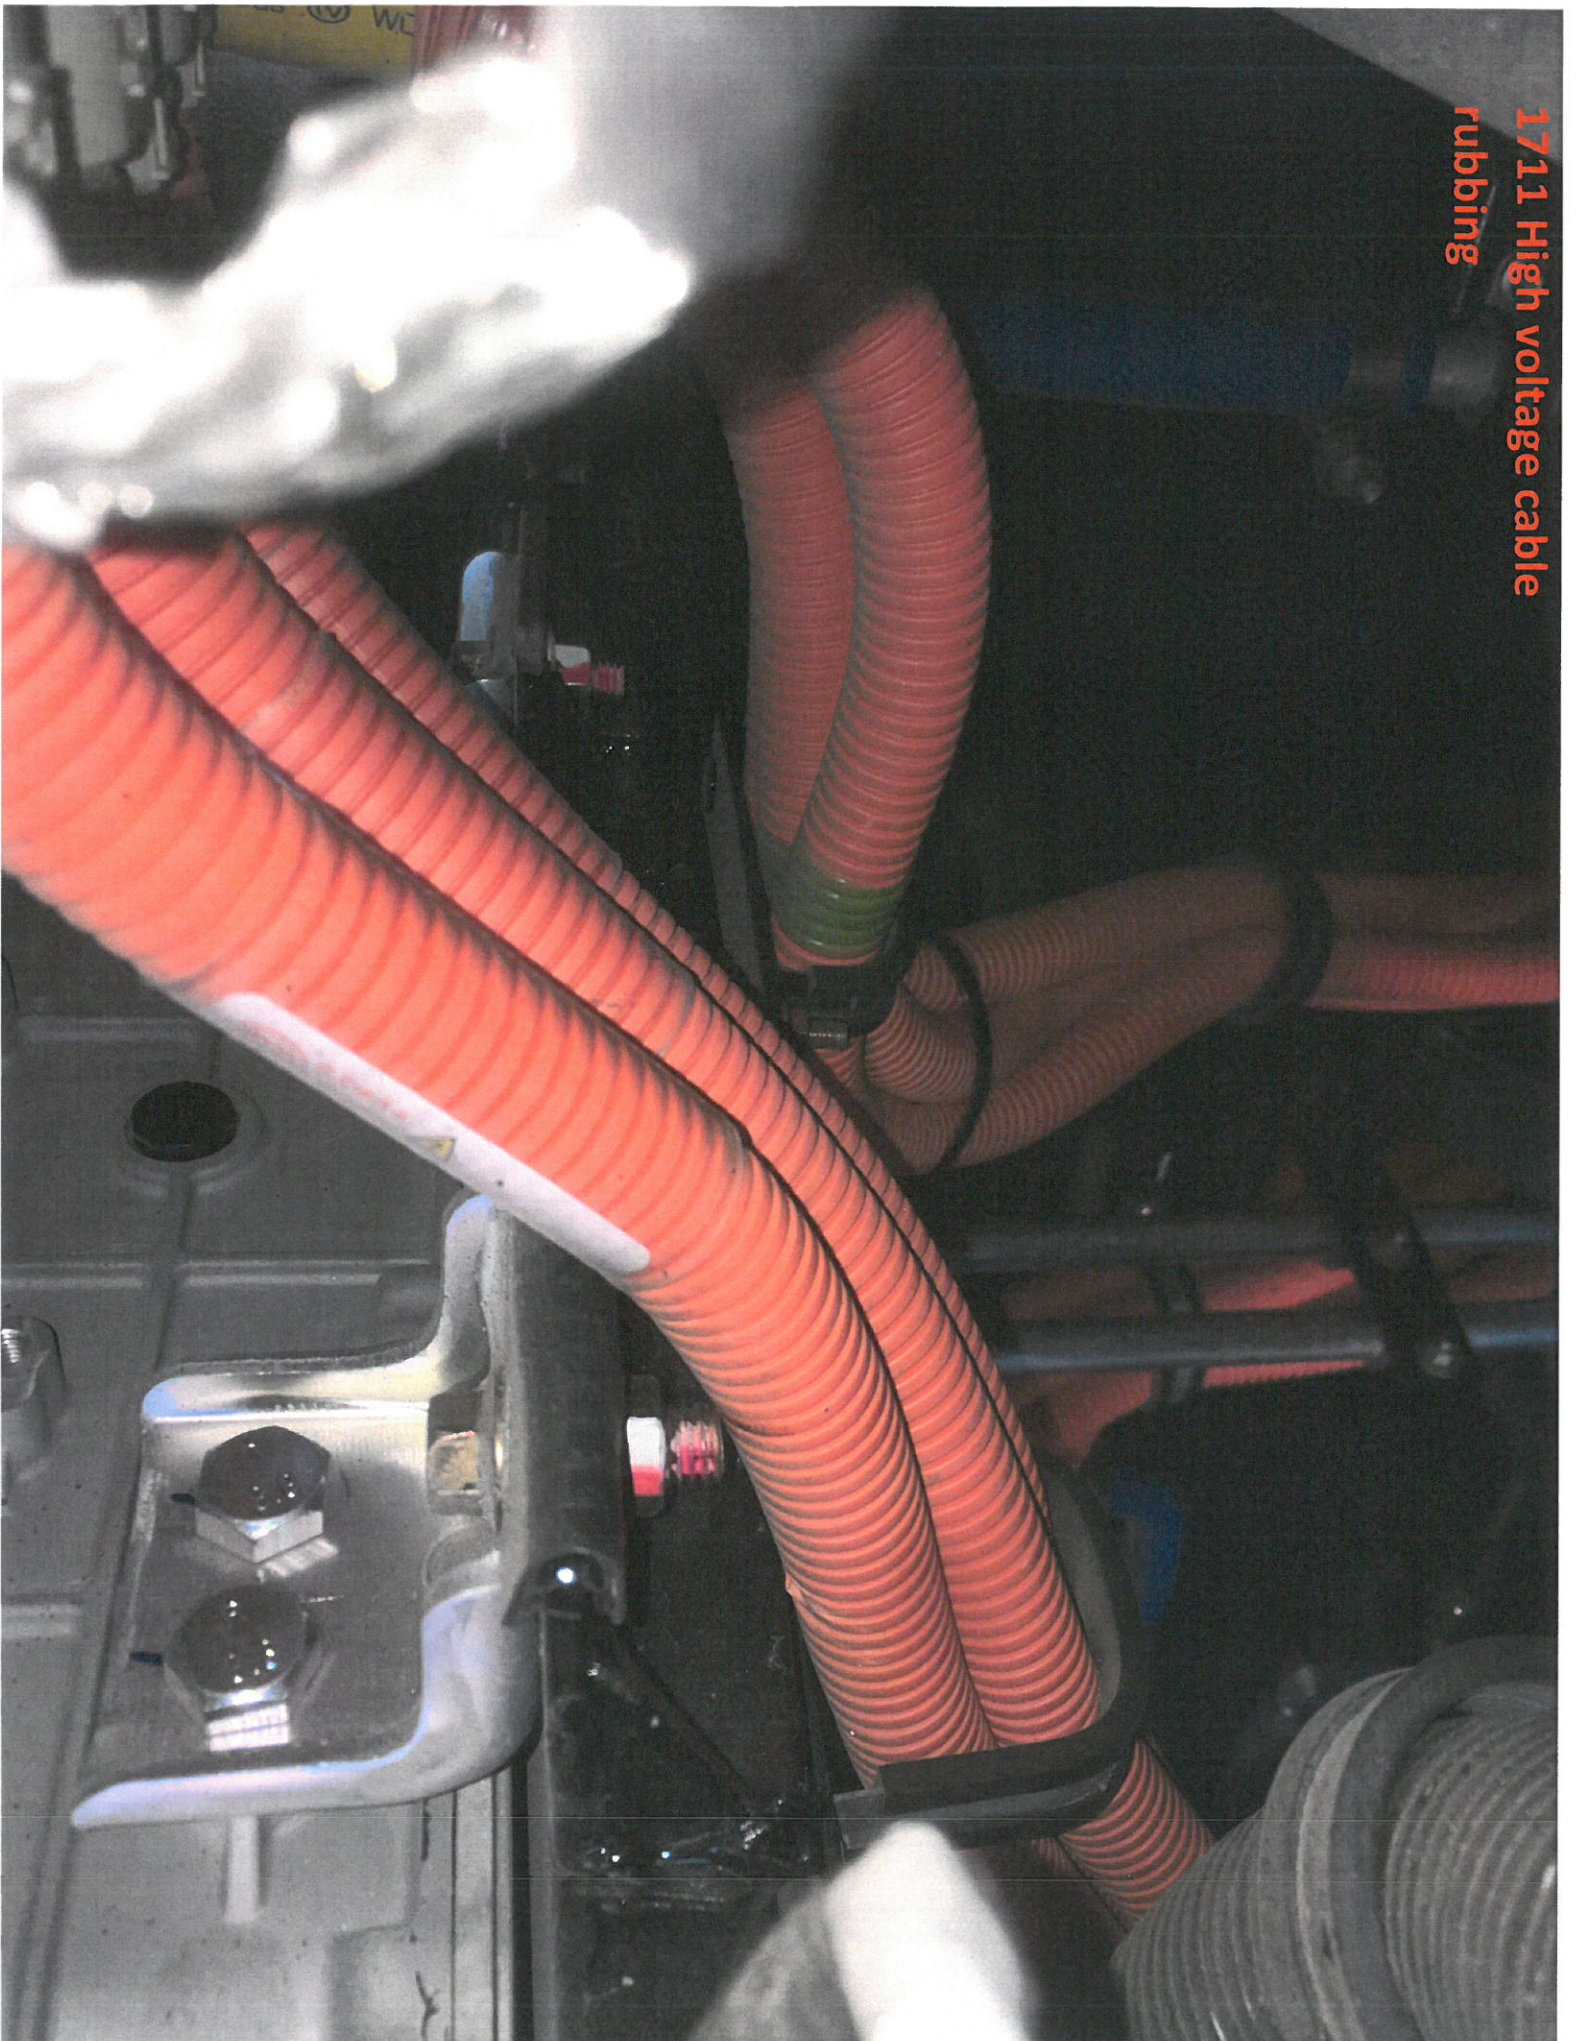

1711 High voltage cable rubbing

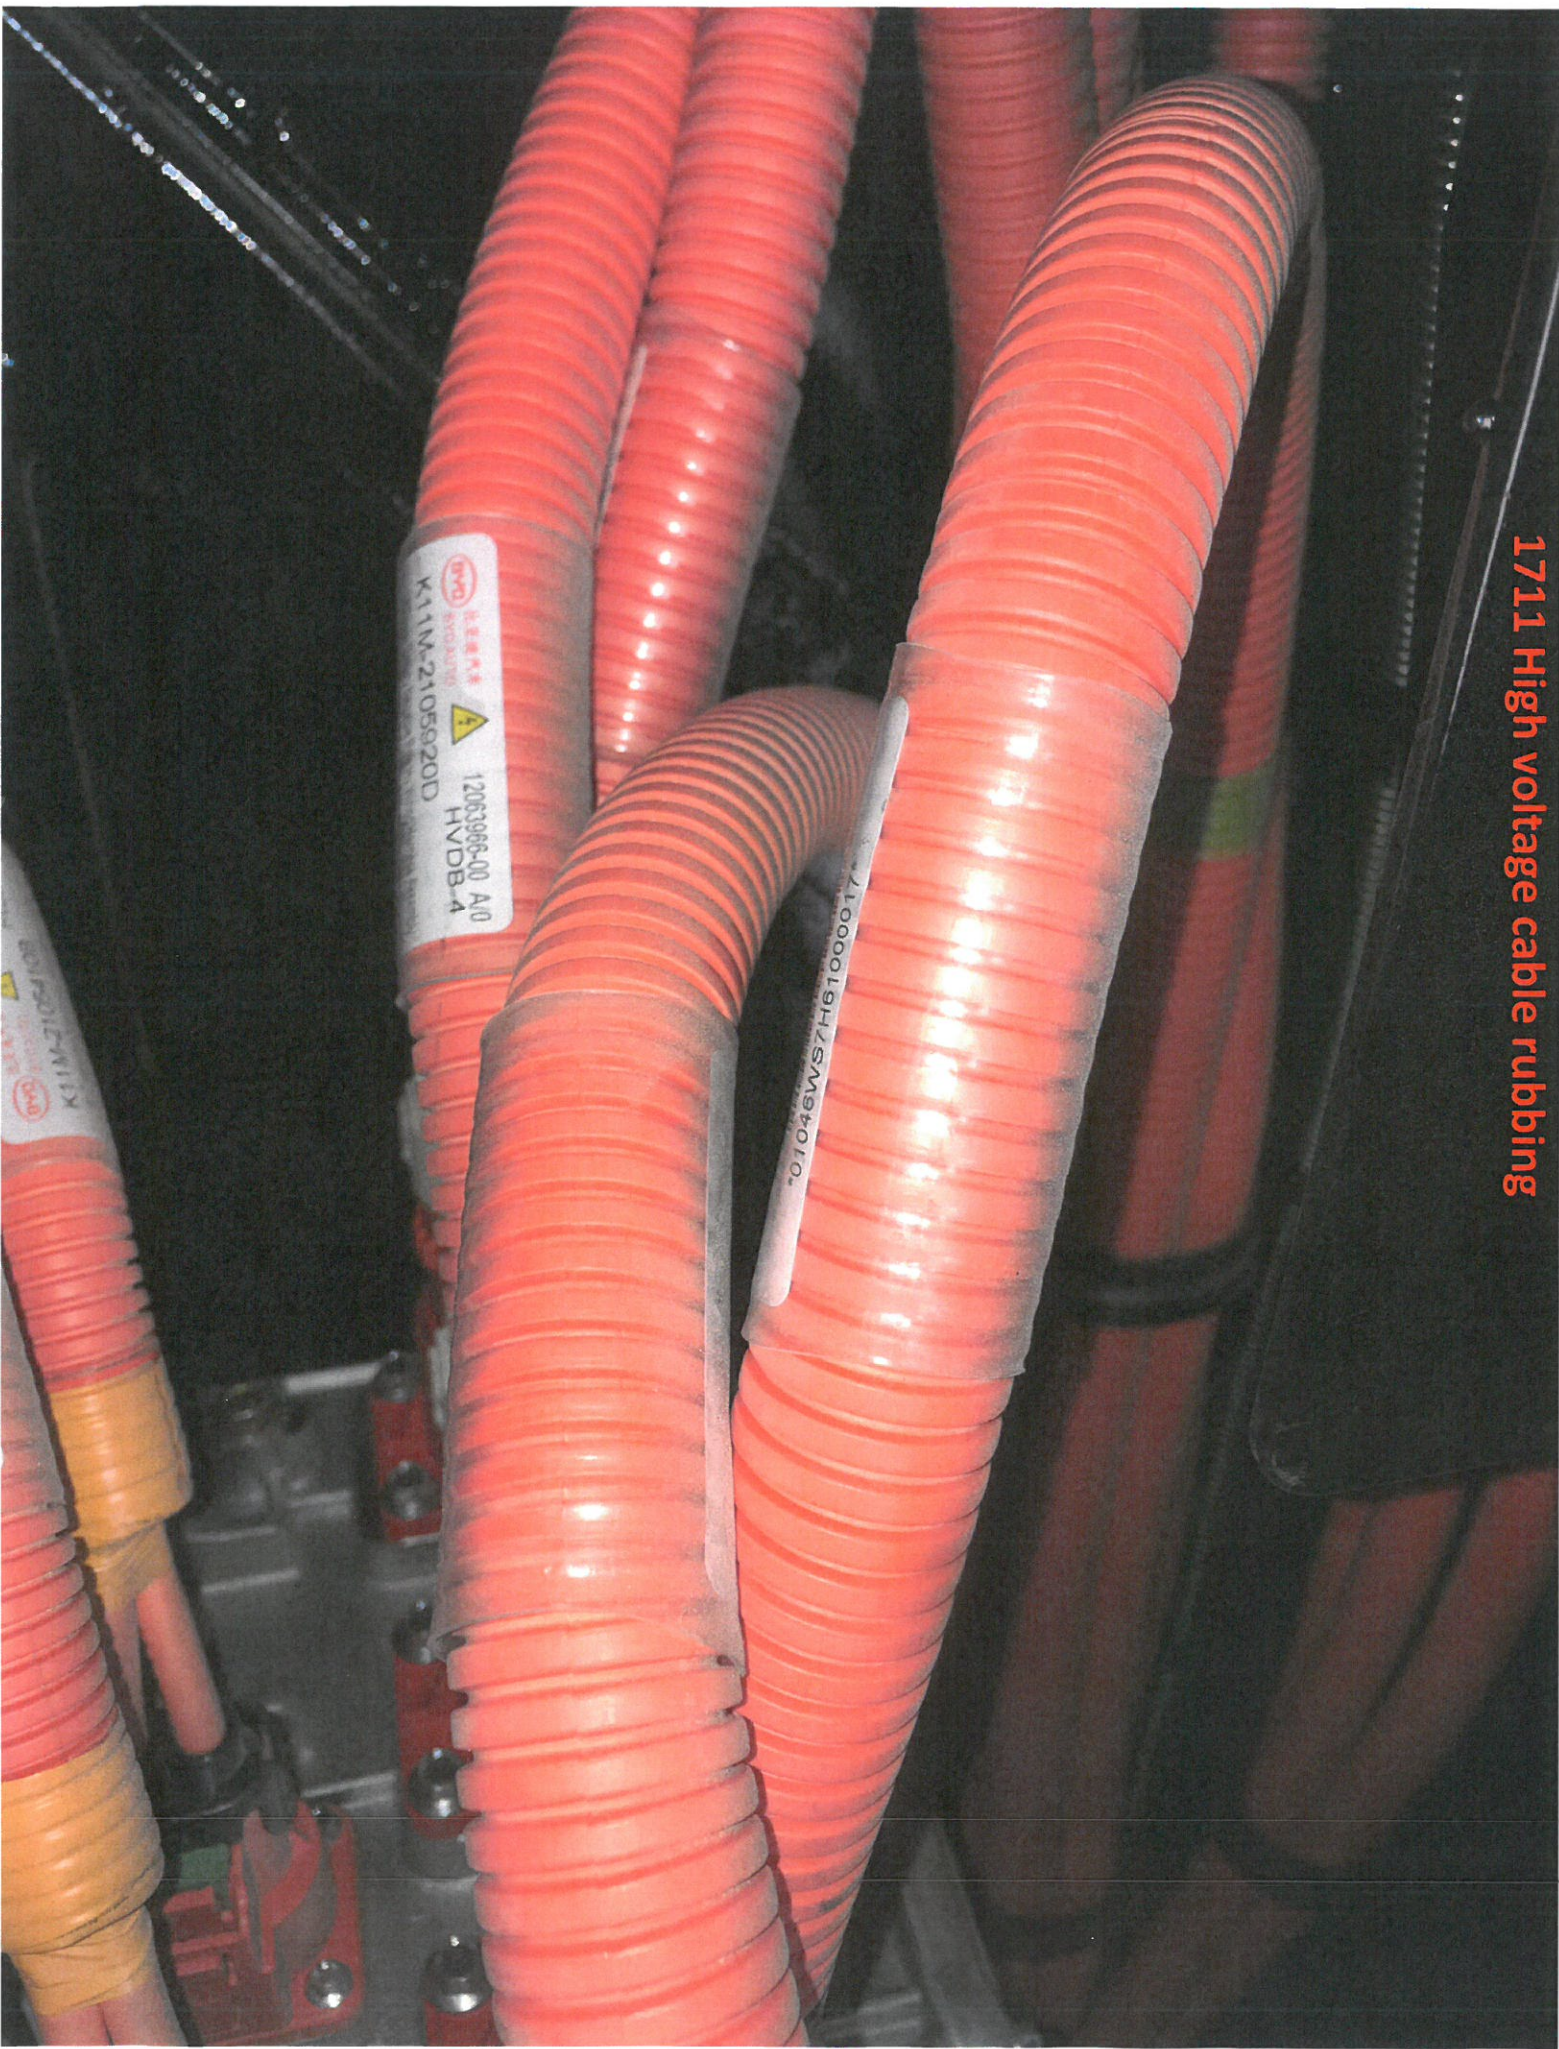

BDV
北京德力西
SINO AUTO
K11M-2105920D
12063966-00 A0
HVDB-A

11000019H/SM94010

BDV
SINO AUTO
K11M-2105920D

1711 Cracked weld



1711 Cracked weld



STAINLESS STEEL



4
3
2
1


21 22 23 24 25 26 27 28 29 30

1711 Questionable welds and incomplete

**1711 Lines and cables
exposed to road hazards**




1711 Cracking panel

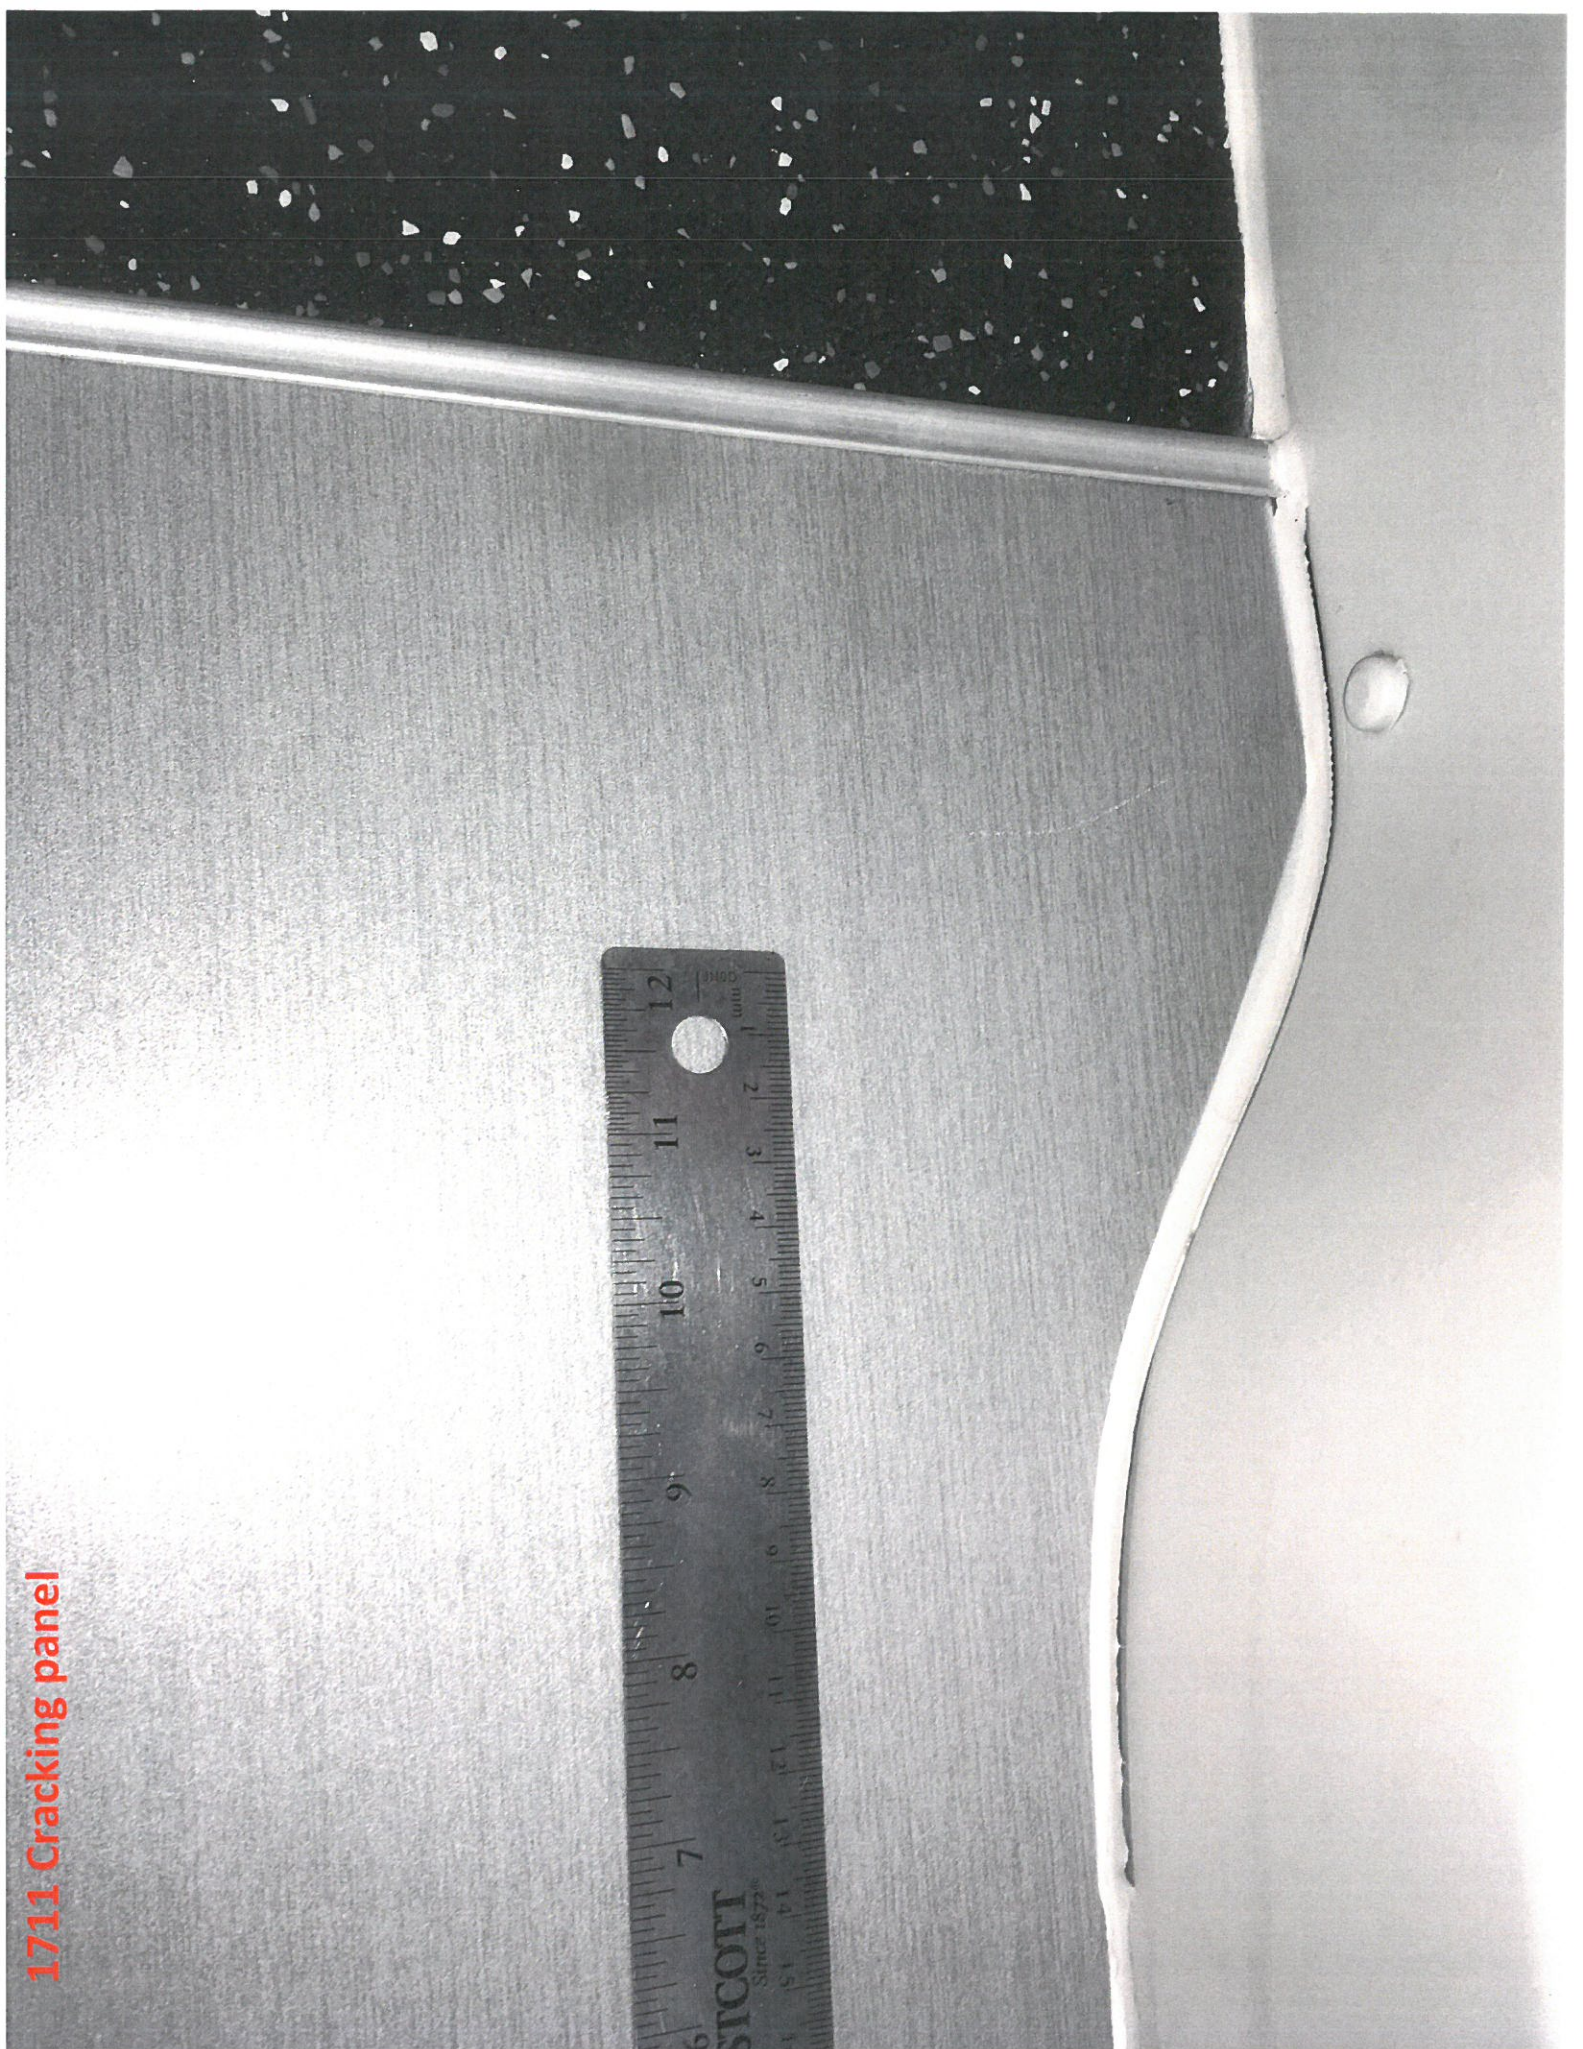

1711 Front of joint,
warped panel



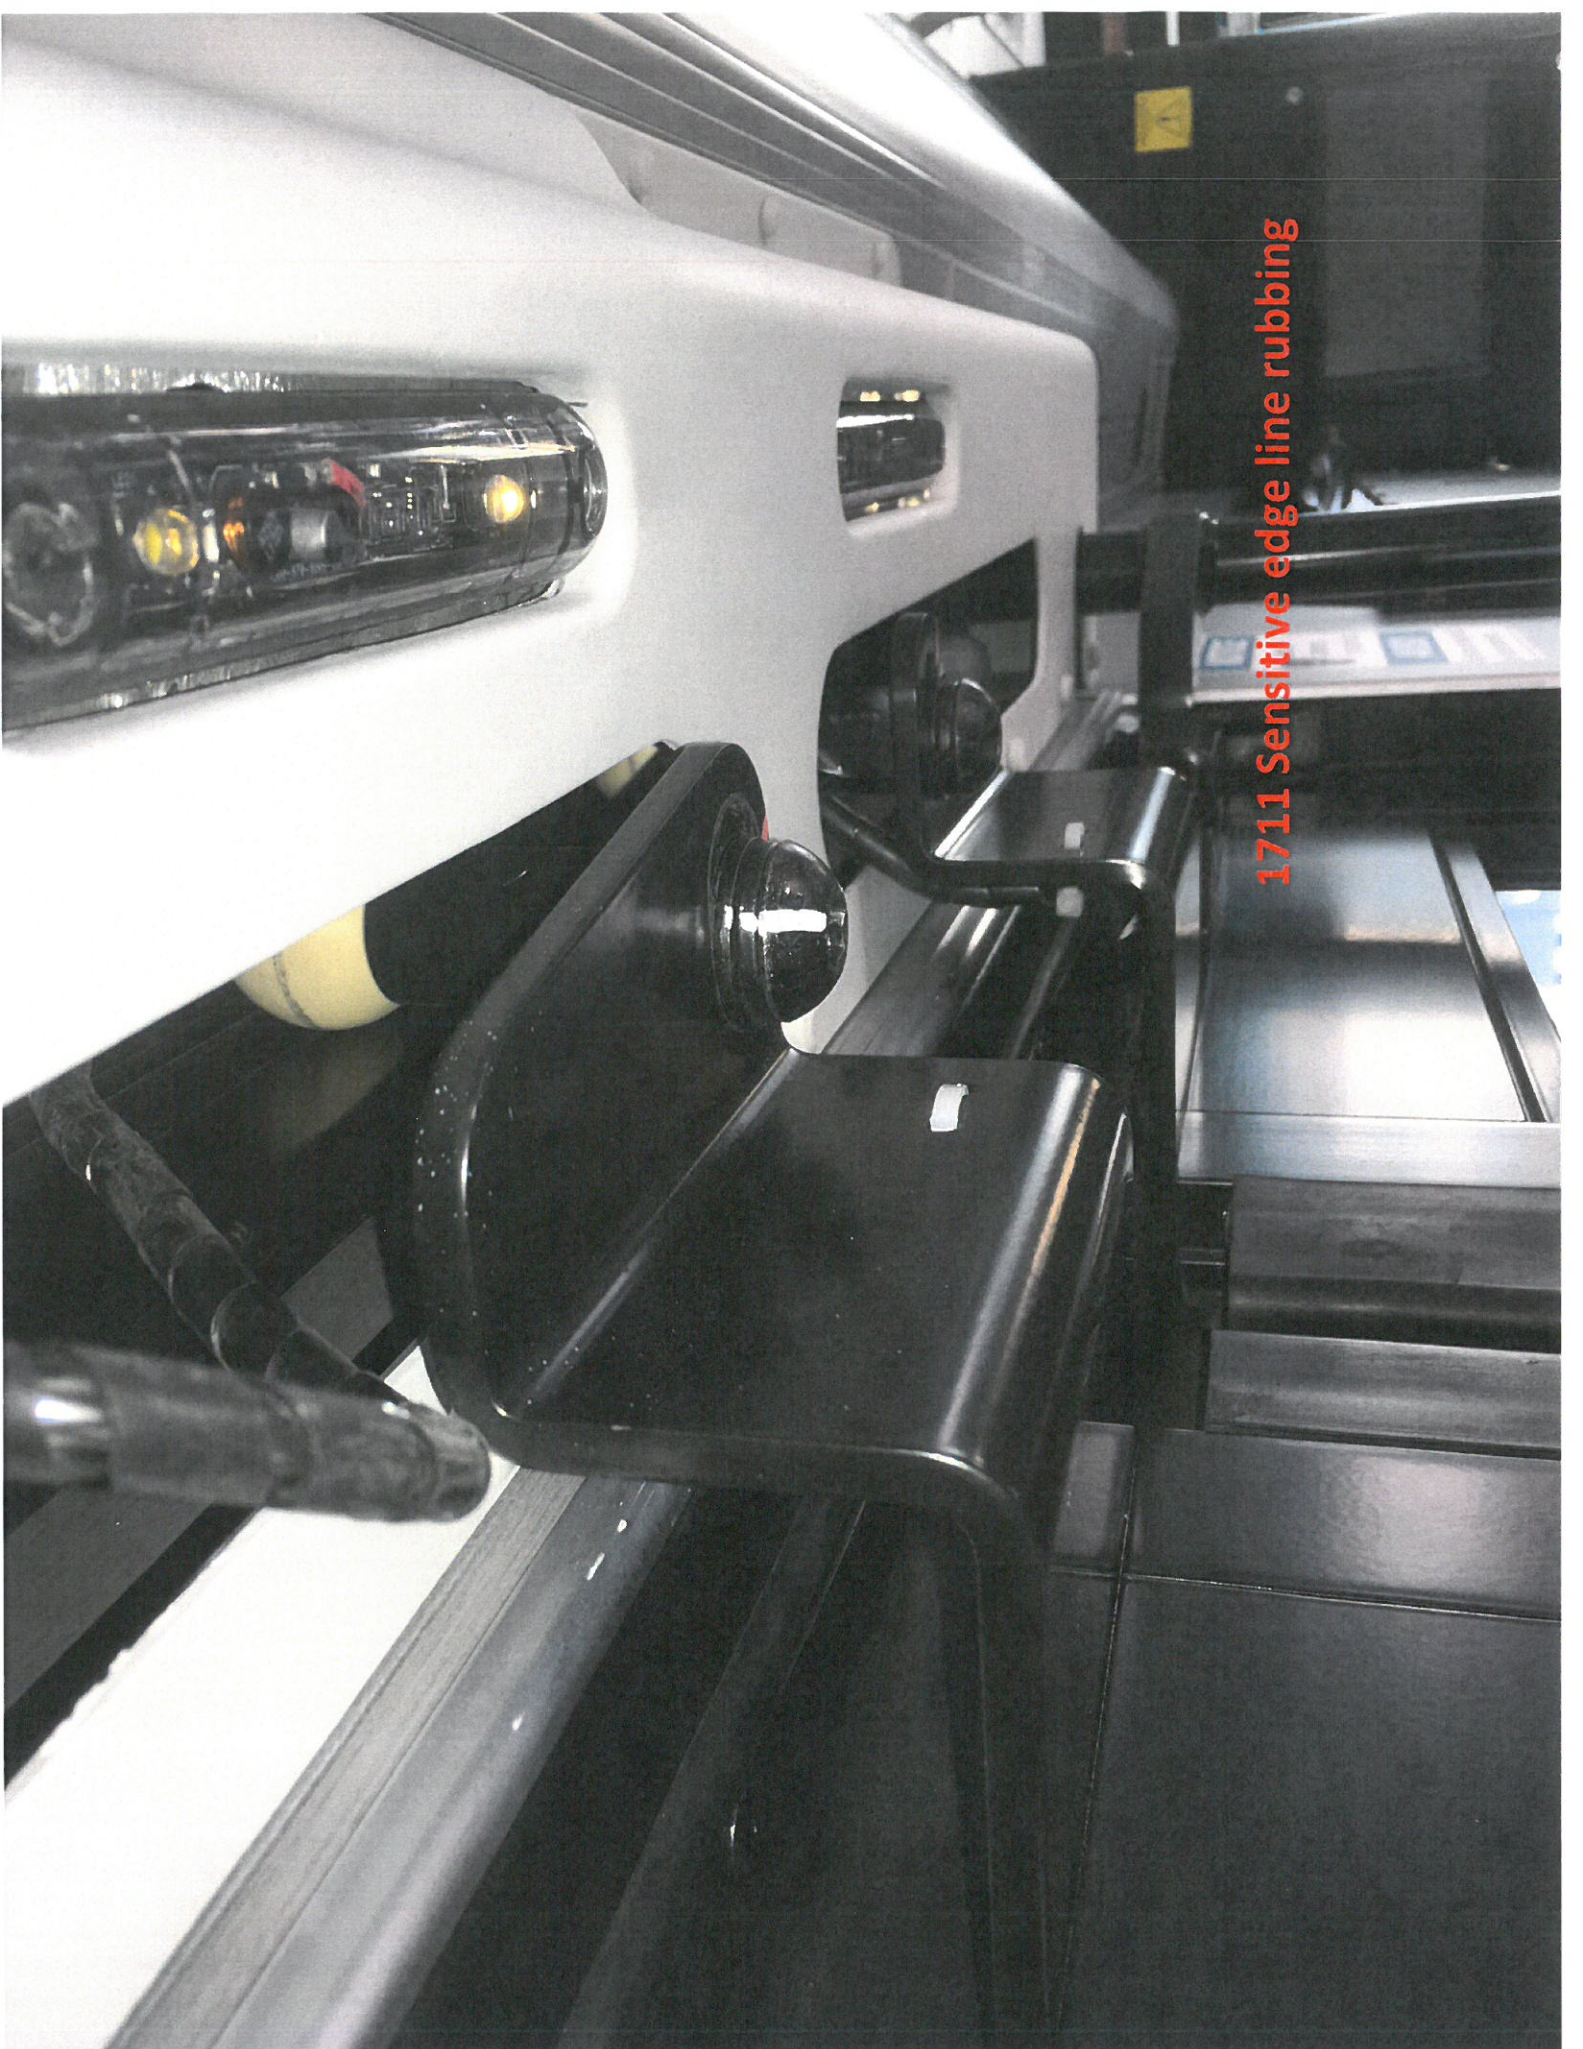

1711 Sensitive edge line rubbing