



March 2021

CITY OF ALBUQUERQUE
SIERRA GRANDE AVE - LOYOLA AVE TO LOYOLA PL
SPEED STUDY

NTMP P803000
TASK 28.17



ONE
ALBUQUE
RQUE

City of Albuquerque

Sierra Grande Avenue

SPEED STUDY

NTMP P803000

NTP #28.17

WCI 1810002228

March 2021



Audra V. Gallegos
03.03.2021



Table of Contents

Tables	1
Introduction	1
Project Area and Background	1
Existing Conditions	2
Traffic Conditions	2
Safety	2
Crash Data	2
Speed	2
Typical Sections	2
NTMP Traffic Calming Criteria	4
Summary of Results	4
Recommendations	5

Figures

Figure 1: Project Area and Existing Traffic Volumes	1
Figure 2: Sierra Grande Avenue Speed Limit	2
Figure 3: Sierra Grande Avenue West.....	3
Figure 4: Sierra Grande Avenue East	3
Figure 5: Sierra Grande Avenue Existing Typical Section.....	4

Tables

Table 1: Percentage of Vehicles Exceeding Speed Limit.....	2
Table 2: Summary of Results.....	5

Appendices

Appendix A – Traffic Data

Introduction

This report documents the speed study analysis on Sierra Grande Avenue from Loyola Avenue to Loyola Place in Albuquerque, New Mexico. The purpose of this project is to collect and analyze the traffic volumes, speed, and safety of Sierra Grande Avenue, a two-way street, from Loyola Avenue to Loyola Place to determine if it meets the traffic calming criterion described in the *City of Albuquerque (COA) Neighborhood Traffic Management Program (NTMP)*, October 2020, and the *Institute of Transportation Engineers (ITE) Traffic Engineering Handbook*, 6th Edition.

Project Area and Background

The Sierra Grande Avenue project is located in Albuquerque, New Mexico and is a two-lane, undivided local road that runs east-west between Loyola Avenue and Loyola Place. Loyola Avenue is a two-lane, undivided local road that runs east-west and intersects the west end of Sierra Grande Avenue at a T-intersection. Loyola Place is a two-lane, undivided local road that runs north-south and intersects the east end of Sierra Grande Avenue at a T-intersection. See **Figure 1** for a map of the project area.



Figure 1: Project Area and Existing Traffic Volumes

Task 28.17: Sierra Grande Avenue

A request has been made to the City of Albuquerque to determine if traffic calming is appropriate for this location. Wilson & Company was tasked by the City of Albuquerque to determine if Sierra Grande Avenue warrants traffic calming measures.

Existing Conditions

Traffic Conditions

Sierra Grande Avenue is an urban local road with an Average Daily Traffic (ADT) of 278 vehicles and an existing speed limit of 25 mph. Existing tube count data (volume, speed, and class) was collected for 48-hours on Wednesday, October 14, 2020 and Thursday, October 15, 2020. The full traffic count data can be found in [Appendix A](#).

Safety

Crash Data

Historical crash data was provided by the City of Albuquerque. Five years of crash data (2019, 2018, 2017, 2016, and 2015) were obtained to evaluate the existing safety condition of Sierra Grande Avenue. There were no reported crashes on Sierra Grande Avenue.

Speed

Speed data was collected on Sierra Grande Avenue for a 48-hour period on Wednesday, October 14, 2020 and Thursday, October 15, 2020. See [Table 1](#) for the percentage of vehicles exceeding the speed limit by 5 mph and 7 mph.

Table 1: Percentage of Vehicles Exceeding Speed Limit

Speed	Percentage of Vehicles Exceeding Speed Limit			
	October 14, 2020		October 15, 2020	
	Counter 1	Counter 2	Counter 1	Counter 2
5 mph	32%	16%	26%	17%
7 mph	15%	10%	17%	9%

Speed data can be found in the traffic counts located in [Appendix A](#). Up to 32% of vehicle speeds exceed the posted speed limit (25 mph) by 5 mph or more at Counter 1 and up to 17% at Counter 2. For Counter 1, up to 17% of vehicle speeds exceed the posted speed limit (25 mph) by 7 mph or more and up to 10% at Counter 2.

Typical Sections

Sierra Grande Avenue is a 28-ft wide roadway with curb and gutter, and 4-ft wide sidewalks. See [Figure 3](#) and [Figure 4](#) for photos of the existing roadway, and [Figure 5](#) for the existing Sierra Grande Avenue typical section.



Figure 2: Sierra Grande Avenue Speed Limit



Figure 3: Sierra Grande Avenue looking West



Figure 4: Sierra Grande Avenue looking East

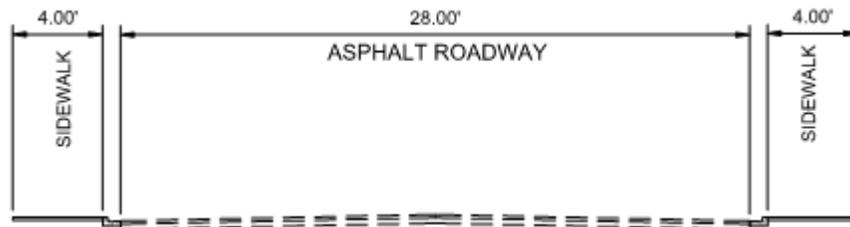


Figure 5: Sierra Grande Avenue Existing Typical Section

NTMP Traffic Calming Criteria

In order to meet the traffic calming criterion described in the *COA NTMP*, one or more of the following threshold criteria must be met:

1. Over a twenty-four-hour period, 15% of the vehicles traveling in the study area exceeded 7 miles per hour over the speed limit.
2. Three reported crashes in a 5-year period where the police report identified speed as either a primary or contributing cause of the crash.
3. A crash involving a pedestrian or cyclist in a school zone in a five-year period.
4. Over a twenty-four-hour period more than 800 vehicles were counted traveling through the study area and 15% of the vehicles traveling in the study area exceeded 5 miles per hour over the speed limit.
5. Over a twenty-four-hour period, 15% of the vehicles traveling in the study area exceeded 5 miles per hour over the speed limit and there was at least one reported crash in a 5-year period where the police report identified speed as either a primary or contributing cause of the crash.
6. Over a twenty-four-hour period, 15% of the vehicles traveling in the study area exceeded 5 miles per hour over the speed limit and a field survey conducted by the Traffic Engineering Division determined that 25% of the peak hour traffic was cut-through traffic.
7. Over a twenty-four-hour period more than 800 vehicles were counted traveling through the study area and there was at least one reported crash in a 5-year period where the police report identified speed as either a primary or contributing cause of the crash.
8. Over a twenty-four-hour period more than 800 vehicles were counted traveling through the study area and a field survey conducted by the Traffic Engineering Division determined that 25% of the peak hour traffic was cut-through traffic.
9. A field survey conducted by the Traffic Engineering Division determined that 25% of the peak hour traffic was cut-through traffic and there was at least one reported crash in 5 years where the police report identified speed as either a primary or contributing cause of the crash.

Summary of Results

There were no crashes reported on Sierra Grande Avenue in the past five years. The daily traffic volumes for Sierra Grande Avenue were less than 800 vehicles. Over 15% of vehicle speeds exceeded the posted speed limit by 5 mph and by 7 mph. See [Table 2](#) for the summary of results for Sierra Grande Avenue.

Table 2: Summary of Results

Criteria	Threshold								
	1	2	3	4	5	6	7	8	9
15% of vehicles speeds > 7 mph over posted speed limit	X								
15% of vehicles speeds > 5 mph over posted speed limit				X	X	X			
3 reported crashes with speed as primary contributing factor									
1 reported crashes with speed as primary contributing factor									
Pedestrian or cyclist involved crash									
More than 800 vehicles daily									
25% cut-through traffic									
Meets Threshold	Yes	No							

 Threshold Criteria
 Meets Criteria

Recommendations

After analyzing the crash, volume, and speed data, it was determined that Sierra Grande Avenue does meet one of the nine (9) thresholds and, therefore, **does** meet the minimum traffic calming criterion as described in the *COA NTMP*.

Appendix A – Traffic Data



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Counter #1 Sierra
Grande Ave
Date Printed: 10/19/2020
Start Date: 10/14/2020
End Date: 10/15/2020
GPS Accuracy: 0 ft
Location Verified: No

Location 1:
Location 2:
Latitude: 35.087883
Longitude: -106.511474

10/14/2020	West, A to B	East, B to A	Total
	Time		
	12:00 AM	0	1
	1:00	0	1
	2:00	0	1
	3:00	0	1
	4:00	0	0
	5:00	0	0
	6:00	1	0
	7:00	8	6
	8:00	7	9
	9:00	8	4
	10:00	8	13
	11:00	7	14
	12:00 PM	7	19
	1:00	5	11
	2:00	7	19
	3:00	3	16
	4:00	2	26
	5:00	6	22
	6:00	3	18
	7:00	4	13
	8:00	5	10
	9:00	4	1
	10:00	2	6
	11:00	0	6
	Total	87	217
	Percent	28.6%	71.4%
	AM Peak	7:00	12:00 PM
	Volume	8	19
	PM Peak	12:00 PM	4:00
	Volume	7	26
			304



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Counter #1 Sierra
Grande Ave
Date Printed: 10/19/2020
Start Date: 10/14/2020
End Date: 10/15/2020
GPS Accuracy: 0 ft
Location Verified: No

Location 1:
Location 2:
Latitude: 35.087883
Longitude: -106.511474

10/15/2020	West, A to B	East, B to A	Total
	Time		
	12:00 AM	0	0
	1:00	2	2
	2:00	0	1
	3:00	0	1
	4:00	0	0
	5:00	0	1
	6:00	4	4
	7:00	5	7
	8:00	6	12
	9:00	7	10
	10:00	8	9
	11:00	11	16
	12:00 PM	6	10
	1:00	9	10
	2:00	7	19
	3:00	3	19
	4:00	6	21
	5:00	4	20
	6:00	5	24
	7:00	2	4
	8:00	2	11
	9:00	1	7
	10:00	2	1
	11:00	0	4
	Total	90	202
	Percent	30.8%	69.2%
	AM Peak	11:00	11:00
	Volume	11	16
	PM Peak	1:00	6:00
	Volume	9	24
	Grand Total	177	419
	Percent	29.7%	70.3%
	ADT	ADT: 298	AADT: 298




WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Counter #1 Sierra Grande Ave
Date Printed: 10/19/2020
Start Date: 10/14/2020
End Date: 10/15/2020
GPS Accuracy: 0 ft
Location Verified: No

Location 1:
Location 2:
Latitude: 35.087883
Longitude: -106.511474

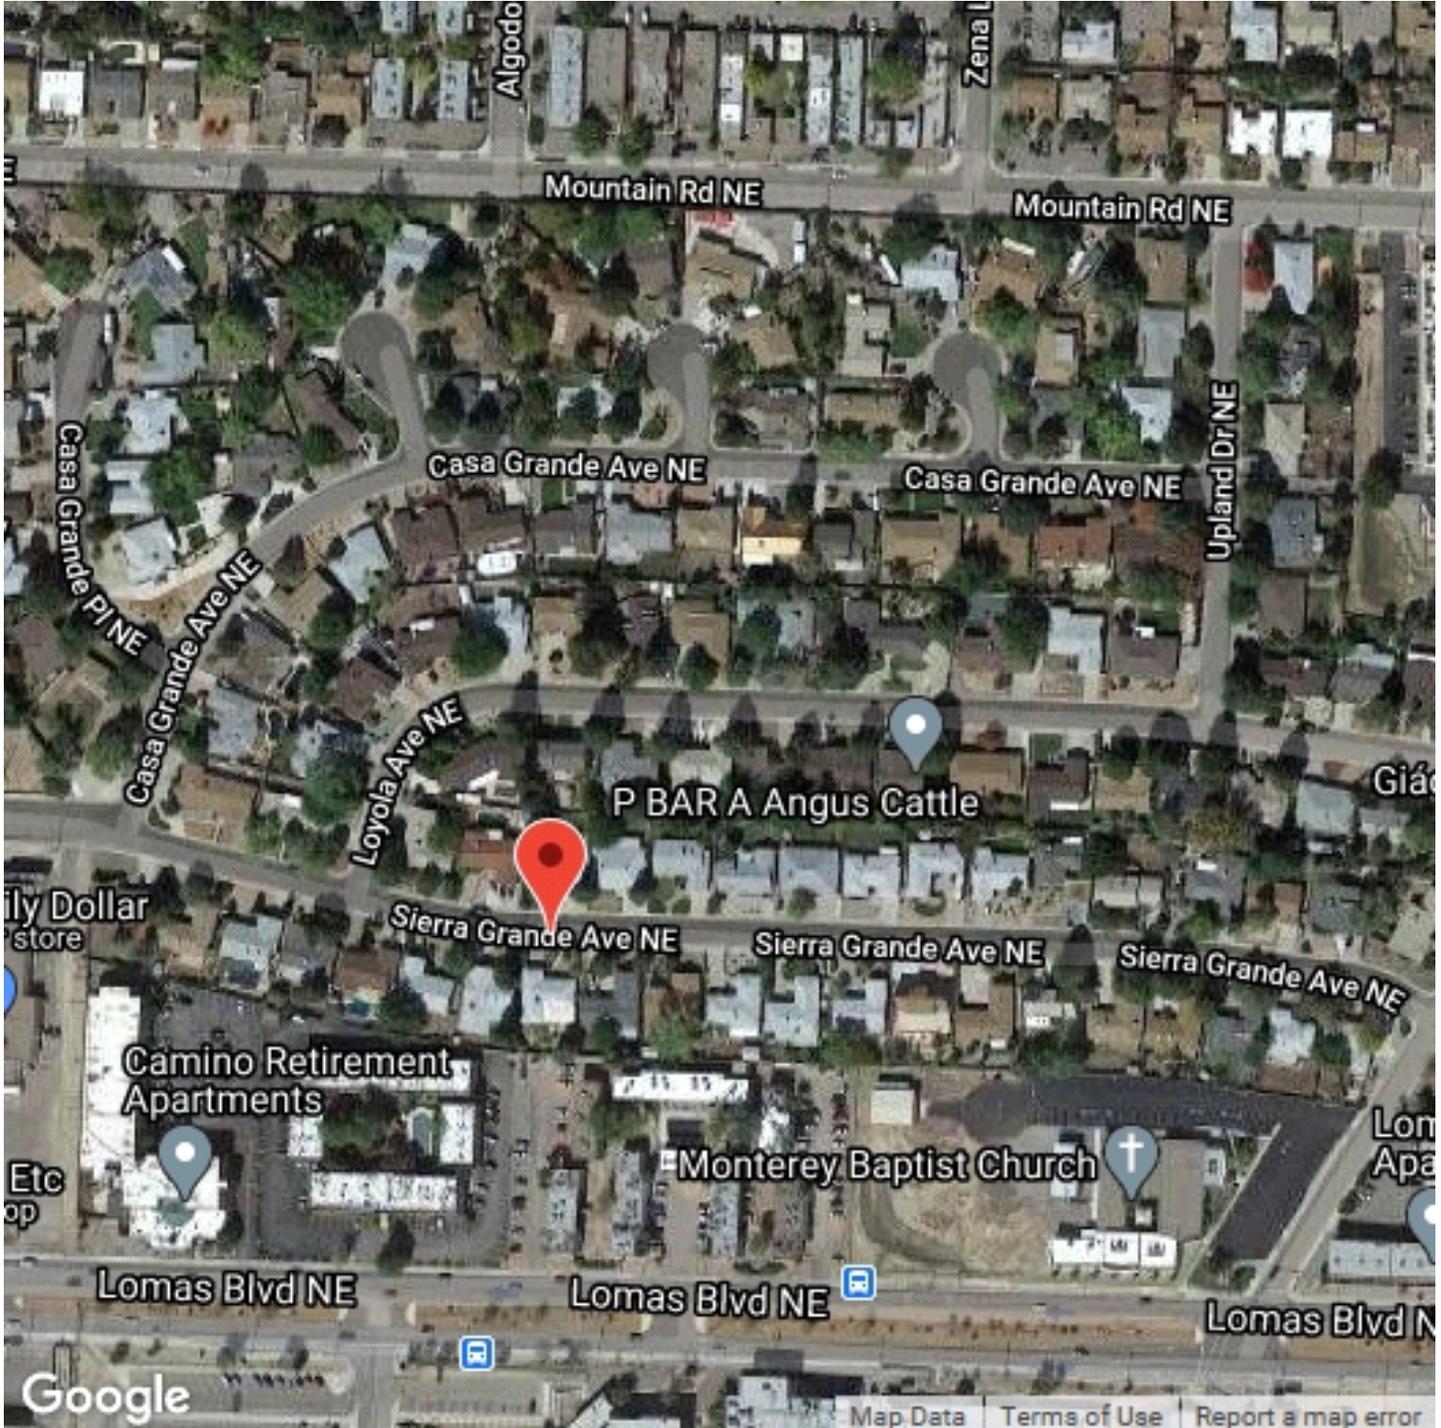



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Counter #1 Sierra
Grande Ave
Date Printed: 10/19/2020
Start Date: 10/14/2020
End Date: 10/15/2020
GPS Accuracy: 0 ft
Location Verified: No

Latitude: 35.087883
Longitude: -106.511474
Direction: West, A to B

10/14/2020	0 - 15	> 15 -	> 20 -	> 25 -	> 30 -	> 35 -	> 40 -	> 45 -	> 50 -	> 55 -	> 60 -	> 65 -	> 70	Total
Time	MPH	20 MPH	25 MPH	30 MPH	35 MPH	40 MPH	45 MPH	50 MPH	55 MPH	60 MPH	65 MPH	70 MPH	MPH	
12:00 AM	0	0	0	0	0	0	0	0	0	0	0	0	0	0
1:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
2:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
3:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
4:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
5:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
6:00	0	0	0	0	1	0	0	0	0	0	0	0	0	1
7:00	1	0	6	0	1	0	0	0	0	0	0	0	0	8
8:00	0	0	2	3	2	0	0	0	0	0	0	0	0	7
9:00	0	0	1	2	5	0	0	0	0	0	0	0	0	8
10:00	1	0	3	2	1	1	0	0	0	0	0	0	0	8
11:00	0	0	1	3	3	0	0	0	0	0	0	0	0	7
12:00 PM	0	1	2	2	2	0	0	0	0	0	0	0	0	7
1:00	0	1	2	2	0	0	0	0	0	0	0	0	0	5
2:00	0	0	2	4	1	0	0	0	0	0	0	0	0	7
3:00	1	0	0	1	1	0	0	0	0	0	0	0	0	3
4:00	0	1	0	1	0	0	0	0	0	0	0	0	0	2
5:00	1	0	3	1	1	0	0	0	0	0	0	0	0	6
6:00	0	2	0	1	0	0	0	0	0	0	0	0	0	3
7:00	0	0	0	2	1	1	0	0	0	0	0	0	0	4
8:00	1	0	0	1	3	0	0	0	0	0	0	0	0	5
9:00	0	0	0	2	2	0	0	0	0	0	0	0	0	4
10:00	0	1	1	0	0	0	0	0	0	0	0	0	0	2
11:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
Total	5	6	23	27	24	2	0	0	0	0	0	0	0	87



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Counter #1 Sierra
Grande Ave
Date Printed: 10/19/2020
Start Date: 10/14/2020
End Date: 10/15/2020
GPS Accuracy: 0 ft
Location Verified: No

Latitude: 35.087883
Longitude: -106.511474
Direction: West, A to B

10/15/2020	0 - 15	> 15 -	> 20 -	> 25 -	> 30 -	> 35 -	> 40 -	> 45 -	> 50 -	> 55 -	> 60 -	> 65 -	> 70	Total
Time	MPH	20 MPH	25 MPH	30 MPH	35 MPH	40 MPH	45 MPH	50 MPH	55 MPH	60 MPH	65 MPH	70 MPH	MPH	
12:00 AM	0	0	0	0	0	0	0	0	0	0	0	0	0	0
1:00	1	0	0	1	0	0	0	0	0	0	0	0	0	2
2:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
3:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
4:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
5:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
6:00	0	1	1	2	0	0	0	0	0	0	0	0	0	4
7:00	0	2	2	1	0	0	0	0	0	0	0	0	0	5
8:00	0	0	1	3	2	0	0	0	0	0	0	0	0	6
9:00	0	0	2	5	0	0	0	0	0	0	0	0	0	7
10:00	0	1	4	2	0	0	1	0	0	0	0	0	0	8
11:00	0	1	3	5	2	0	0	0	0	0	0	0	0	11
12:00 PM	0	1	0	4	1	0	0	0	0	0	0	0	0	6
1:00	0	1	1	6	1	0	0	0	0	0	0	0	0	9
2:00	2	2	2	0	0	1	0	0	0	0	0	0	0	7
3:00	0	0	0	2	0	1	0	0	0	0	0	0	0	3
4:00	0	1	1	4	0	0	0	0	0	0	0	0	0	6
5:00	0	2	1	1	0	0	0	0	0	0	0	0	0	4
6:00	0	1	3	1	0	0	0	0	0	0	0	0	0	5
7:00	0	0	0	2	0	0	0	0	0	0	0	0	0	2
8:00	0	0	2	0	0	0	0	0	0	0	0	0	0	2
9:00	0	0	0	1	0	0	0	0	0	0	0	0	0	1
10:00	0	1	1	0	0	0	0	0	0	0	0	0	0	2
11:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
Total	3	14	24	40	6	2	1	0	0	0	0	0	0	90
Grand Total	8	20	47	67	30	4	1	0	0	0	0	0	0	177
Stats	Percentile		15th	50th	85th	95th								
	Speed		19.8	25.8	30.6	32.9								
	Mean Speed (Average)		26.2											
	10 MPH Pace Speed		20-29											
	Number in Pace		113											
	Percent in Pace		67.0%											
	Number > 25 MPH		102											
	Percent > 25 MPH		60.4%											



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Counter #1 Sierra
Grande Ave
Date Printed: 10/19/2020
Start Date: 10/14/2020
End Date: 10/15/2020
GPS Accuracy: 0 ft
Location Verified: No

Latitude: 35.087883
Longitude: -106.511474
Direction: East, B to A

10/14/2020	0 - 15	> 15 -	> 20 -	> 25 -	> 30 -	> 35 -	> 40 -	> 45 -	> 50 -	> 55 -	> 60 -	> 65 -	> 70	Total
Time	MPH	20 MPH	25 MPH	30 MPH	35 MPH	40 MPH	45 MPH	50 MPH	55 MPH	60 MPH	65 MPH	70 MPH	MPH	
12:00 AM	0	0	0	0	0	0	0	1	0	0	0	0	0	1
1:00	0	0	0	0	1	0	0	0	0	0	0	0	0	1
2:00	0	1	0	0	0	0	0	0	0	0	0	0	0	1
3:00	0	0	0	0	1	0	0	0	0	0	0	0	0	1
4:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
5:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
6:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
7:00	0	1	2	1	1	1	0	0	0	0	0	0	0	6
8:00	0	2	0	3	4	0	0	0	0	0	0	0	0	9
9:00	0	1	0	2	1	0	0	0	0	0	0	0	0	4
10:00	1	1	3	2	5	1	0	0	0	0	0	0	0	13
11:00	0	1	1	8	3	1	0	0	0	0	0	0	0	14
12:00 PM	0	3	2	9	3	2	0	0	0	0	0	0	0	19
1:00	1	0	4	3	0	2	1	0	0	0	0	0	0	11
2:00	0	1	6	7	2	2	1	0	0	0	0	0	0	19
3:00	0	0	3	7	5	1	0	0	0	0	0	0	0	16
4:00	0	1	7	9	6	2	1	0	0	0	0	0	0	26
5:00	0	4	5	6	6	0	1	0	0	0	0	0	0	22
6:00	2	1	3	7	5	0	0	0	0	0	0	0	0	18
7:00	1	2	4	5	1	0	0	0	0	0	0	0	0	13
8:00	0	0	3	5	2	0	0	0	0	0	0	0	0	10
9:00	0	0	0	1	0	0	0	0	0	0	0	0	0	1
10:00	0	0	3	0	2	0	1	0	0	0	0	0	0	6
11:00	0	0	1	0	2	2	0	1	0	0	0	0	0	6
Total	5	19	47	75	50	14	5	2	0	0	0	0	0	217



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Counter #1 Sierra
Grande Ave
Date Printed: 10/19/2020
Start Date: 10/14/2020
End Date: 10/15/2020
GPS Accuracy: 0 ft
Location Verified: No

Latitude: 35.087883
Longitude: -106.511474
Direction: East, B to A

10/15/2020	0 - 15	> 15 -	> 20 -	> 25 -	> 30 -	> 35 -	> 40 -	> 45 -	> 50 -	> 55 -	> 60 -	> 65 -	> 70	Total
Time	MPH	20 MPH	25 MPH	30 MPH	35 MPH	40 MPH	45 MPH	50 MPH	55 MPH	60 MPH	65 MPH	70 MPH	MPH	
12:00 AM	0	0	0	0	0	0	0	0	0	0	0	0	0	0
1:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
2:00	0	1	0	0	0	0	0	0	0	0	0	0	0	1
3:00	0	0	0	0	1	0	0	0	0	0	0	0	0	1
4:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
5:00	0	0	1	0	0	0	0	0	0	0	0	0	0	1
6:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
7:00	0	0	0	1	1	0	0	0	0	0	0	0	0	2
8:00	0	2	3	6	0	1	0	0	0	0	0	0	0	12
9:00	0	2	2	4	2	0	0	0	0	0	0	0	0	10
10:00	0	1	1	4	3	0	0	0	0	0	0	0	0	9
11:00	0	2	1	5	7	1	0	0	0	0	0	0	0	16
12:00 PM	0	0	2	3	2	2	1	0	0	0	0	0	0	10
1:00	1	1	3	5	0	0	0	0	0	0	0	0	0	10
2:00	2	3	0	6	3	3	2	0	0	0	0	0	0	19
3:00	0	1	4	5	6	2	1	0	0	0	0	0	0	19
4:00	0	1	3	8	6	2	1	0	0	0	0	0	0	21
5:00	1	0	12	1	4	2	0	0	0	0	0	0	0	20
6:00	2	4	5	8	5	0	0	0	0	0	0	0	0	24
7:00	0	1	1	1	1	0	0	0	0	0	0	0	0	4
8:00	0	3	2	2	3	1	0	0	0	0	0	0	0	11
9:00	0	0	3	3	0	1	0	0	0	0	0	0	0	7
10:00	0	0	1	0	0	0	0	0	0	0	0	0	0	1
11:00	0	0	0	1	2	0	1	0	0	0	0	0	0	4
Total	6	22	44	63	46	15	6	0	0	0	0	0	0	202
Grand Total	11	41	91	138	96	29	11	2	0	0	0	0	0	419
Stats	Percentile		15th	50th	85th	95th								
	Speed		20.4	27.1	33	37.6								
	Mean Speed (Average)		27.8											
	10 MPH Pace Speed		25-34											
	Number in Pace		234											
	Percent in Pace		57.0%											
	Number > 25 MPH		276											
	Percent > 25 MPH		67.6%											




WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Counter #1 Sierra Grande Ave
Date Printed: 10/19/2020
Start Date: 10/14/2020
End Date: 10/15/2020
GPS Accuracy: 0 ft
Location Verified: No

Latitude: 35.087883
Longitude: -106.511474

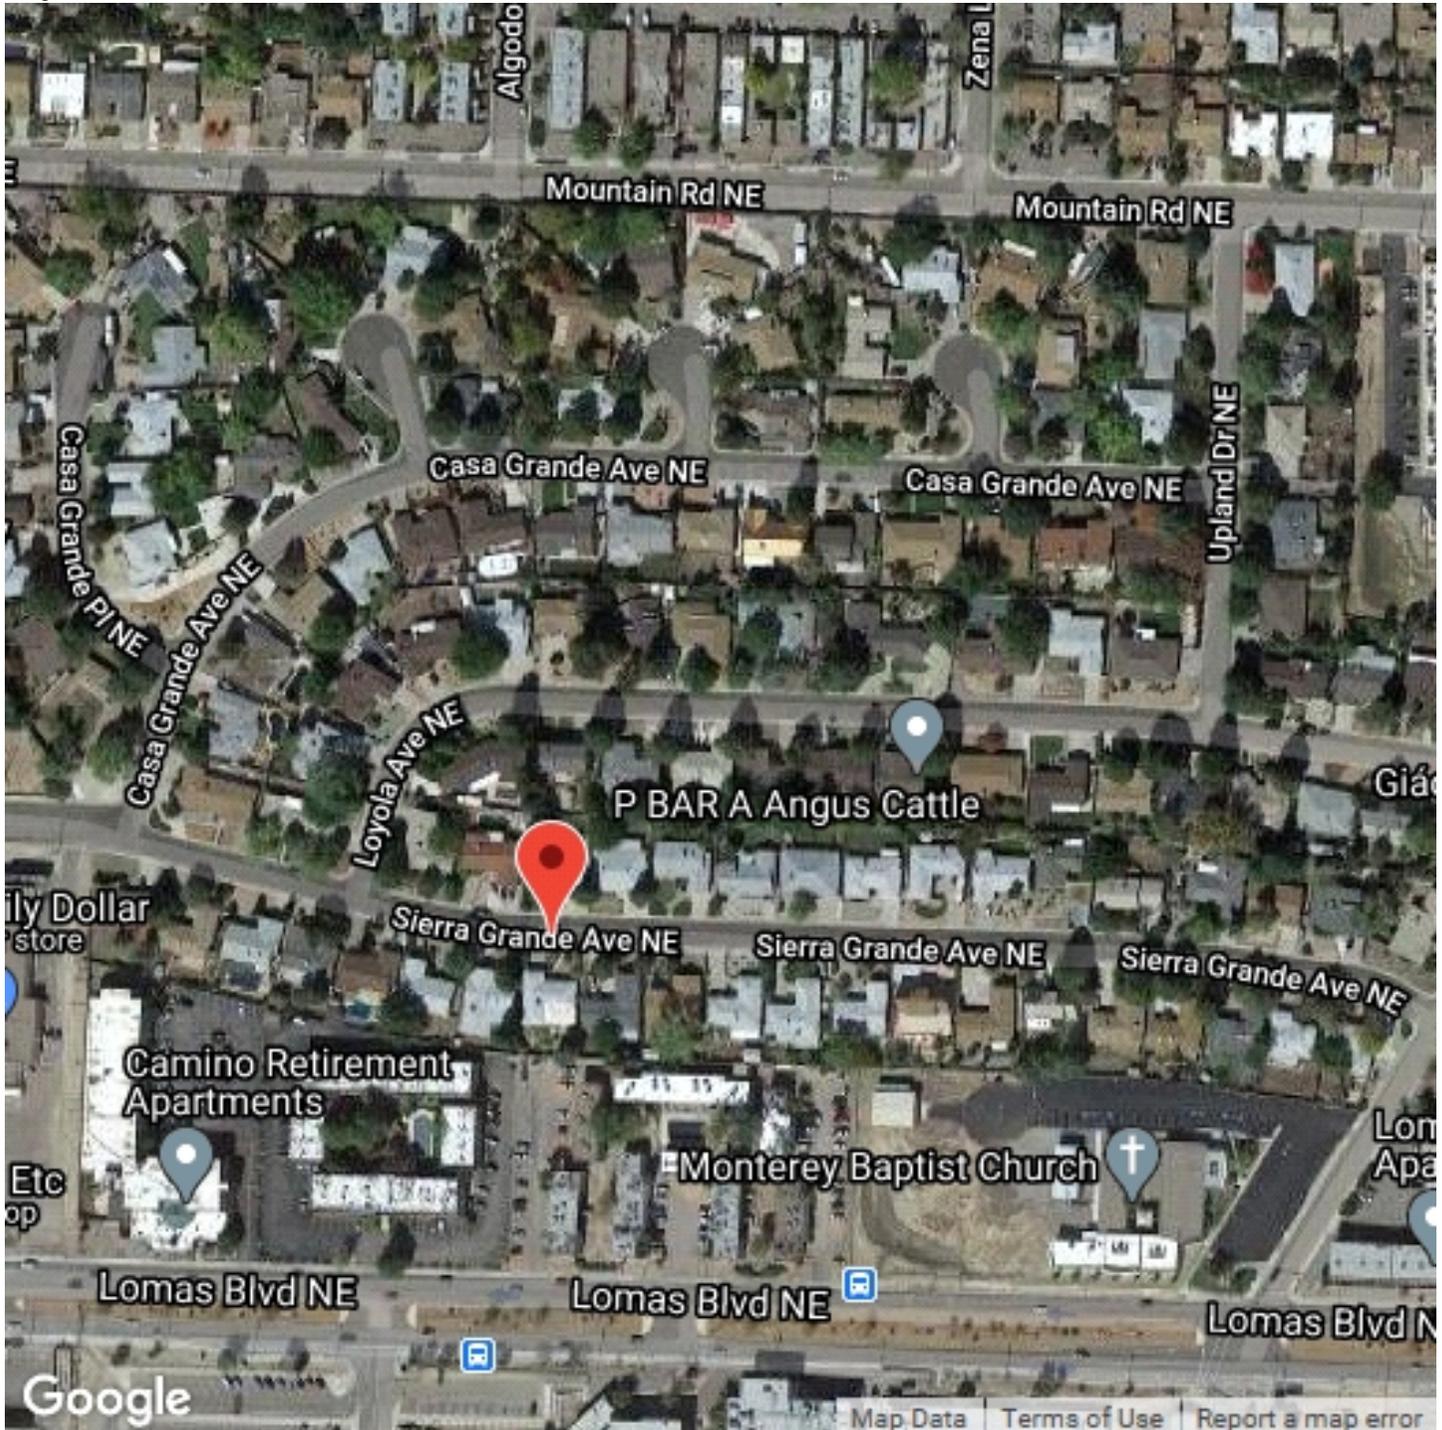



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

Speed Enforcement Evaluator

Analysis Dates


Start: 10/14/2020

End: 10/14/2020

Total Percentage of Enforceable Violations


Posted Speed Limit 25 MPH

Enforcement Tolerance 5 MPH

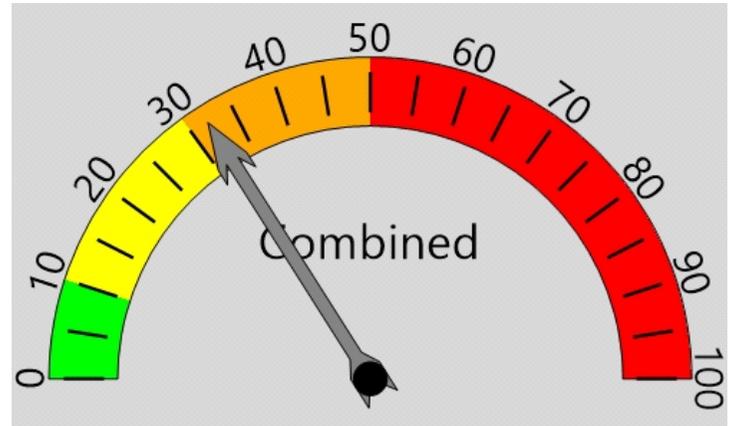

Percent Speeding: 32%

Rating: Medium

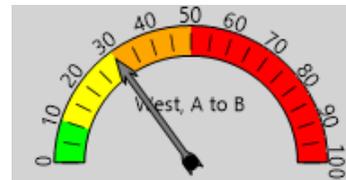

Percent Speeding: 30%

Rating: Medium



Percent Speeding: 33%

Rating: Medium

Vehicle Totals - Combined

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
10	25	70	102	74	16	5	2	0	0	0	0	0
85th Percentile: 32												

Vehicle Totals - West, A to B

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
5	6	23	27	24	2	0	0	0	0	0	0	0
85th Percentile: 31.6												

Vehicle Totals - East, B to A

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
5	19	47	75	50	14	5	2	0	0	0	0	0
85th Percentile: 32.8												



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

Speed Enforcement Evaluator


Analysis Dates

Start: 10/15/2020

End: 10/15/2020


Total Percentage of Enforceable Violations

Posted Speed Limit 25 MPH
Enforcement Tolerance 5 MPH

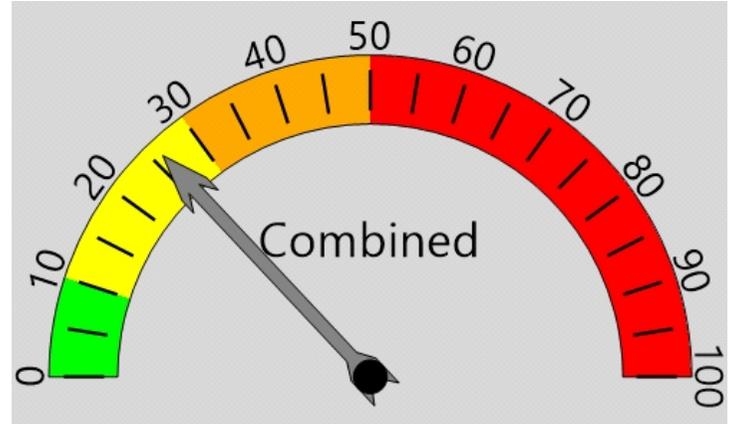


Percent Speeding: 26%

Rating: Medium Low

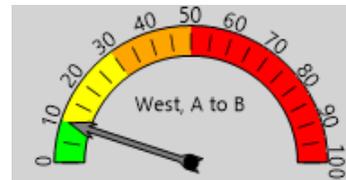

Percent Speeding: 10%

Rating: Medium Low

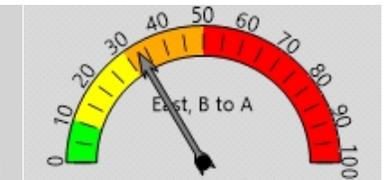

Percent Speeding: 33%

Rating: Medium

Vehicle Totals - Combined

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
9	36	68	103	52	17	7	0	0	0	0	0	0
85th Percentile: 32.5												

Vehicle Totals - West, A to B

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
3	14	24	40	6	2	1	0	0	0	0	0	0
85th Percentile: 28.9												

Vehicle Totals - East, B to A

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
6	22	44	63	46	15	6	0	0	0	0	0	0
85th Percentile: 33.6												



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109


Speed Enforcement Evaluator

Analysis Dates

Start: 10/14/2020
End: 10/14/2020


Total Percentage of Enforceable Violations

Posted Speed Limit 25 MPH
Enforcement Tolerance 7 MPH

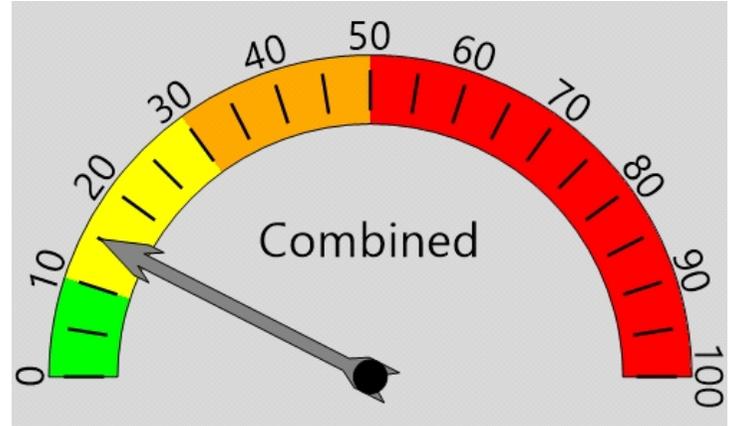


Percent Speeding: 15%

Rating: Medium Low

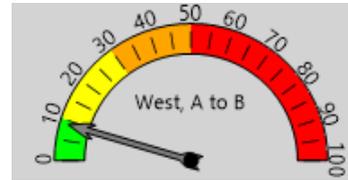

Percent Speeding: 9%

Rating: Low

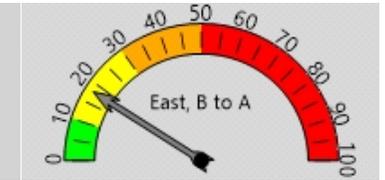

Percent Speeding: 18%

Rating: Medium Low

Vehicle Totals - Combined

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
10	25	70	102	74	16	5	2	0	0	0	0	0
85th Percentile: 32												

Vehicle Totals - West, A to B

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
5	6	23	27	24	2	0	0	0	0	0	0	0
85th Percentile: 31.6												

Vehicle Totals - East, B to A

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
5	19	47	75	50	14	5	2	0	0	0	0	0
85th Percentile: 32.8												



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

Speed Enforcement Evaluator


Analysis Dates

Start: 10/15/2020

End: 10/15/2020


Total Percentage of Enforceable Violations

Posted Speed Limit 25 MPH
Enforcement Tolerance 7 MPH

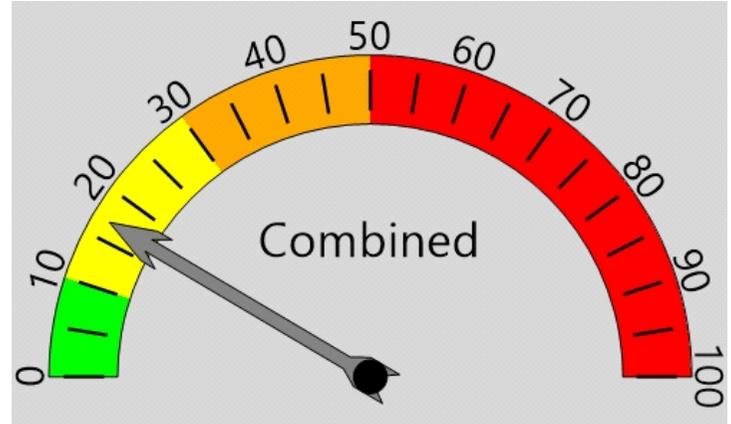


Percent Speeding: 17%

Rating: Medium Low

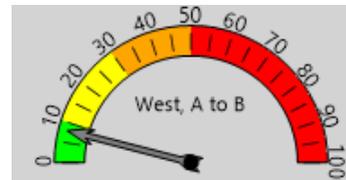

Percent Speeding: 8%

Rating: Low

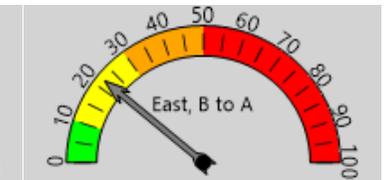

Percent Speeding: 22%

Rating: Medium Low

Vehicle Totals - Combined

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
9	36	68	103	52	17	7	0	0	0	0	0	0
85th Percentile: 32.5												

Vehicle Totals - West, A to B

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
3	14	24	40	6	2	1	0	0	0	0	0	0
85th Percentile: 28.9												

Vehicle Totals - East, B to A

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
6	22	44	63	46	15	6	0	0	0	0	0	0
85th Percentile: 33.6												



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Counter #1 Sierra
Grande Ave
Date Printed: 10/19/2020
Start Date: 10/14/2020
End Date: 10/15/2020
GPS Accuracy: 0 ft
Location Verified: No

Latitude: 35.087883
Longitude: -106.511474
Direction: West, A to B

10/14/2020 Time	Motor Cycles	Cars & Trailers	2 Axle Long	Buses	2 Axle 6 Tire	3 Axle Single	4 Axle Single	<5 Axl Double	5 Axle Double	>6 Axl Double	<6 Axl Multi	6 Axle Multi	>6 Axl Multi	No Class	Total
12:00 AM	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
1:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
2:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
3:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
4:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
5:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
6:00	0	0	1	0	0	0	0	0	0	0	0	0	0	0	1
7:00	0	6	2	0	0	0	0	0	0	0	0	0	0	0	8
8:00	0	6	0	0	1	0	0	0	0	0	0	0	0	0	7
9:00	0	6	2	0	0	0	0	0	0	0	0	0	0	0	8
10:00	0	4	2	0	2	0	0	0	0	0	0	0	0	0	8
11:00	0	6	1	0	0	0	0	0	0	0	0	0	0	0	7
12:00 PM	0	4	3	0	0	0	0	0	0	0	0	0	0	0	7
1:00	0	4	1	0	0	0	0	0	0	0	0	0	0	0	5
2:00	0	5	2	0	0	0	0	0	0	0	0	0	0	0	7
3:00	0	1	1	0	1	0	0	0	0	0	0	0	0	0	3
4:00	0	1	1	0	0	0	0	0	0	0	0	0	0	0	2
5:00	0	6	0	0	0	0	0	0	0	0	0	0	0	0	6
6:00	0	2	1	0	0	0	0	0	0	0	0	0	0	0	3
7:00	0	1	2	0	1	0	0	0	0	0	0	0	0	0	4
8:00	0	5	0	0	0	0	0	0	0	0	0	0	0	0	5
9:00	0	3	1	0	0	0	0	0	0	0	0	0	0	0	4
10:00	0	2	0	0	0	0	0	0	0	0	0	0	0	0	2
11:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
Total	0	62	20	0	5	0	0	0	0	0	0	0	0	0	87
Percent	0.0%	71.3%	23.0%	0.0%	5.7%	0.0%	0.0%	0.0%	0.0%	0.0%	0.0%	0.0%	0.0%	0.0%	
AM Peak		7:00	7:00		10:00										7:00
	*	6	2	*	2	*	*	*	*	*	*	*	*	*	8
PM Peak		5:00	12:00 PM		3:00										12:00 PM
	*	6	3	*	1	*	*	*	*	*	*	*	*	*	7



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Counter #1 Sierra
Grande Ave
Date Printed: 10/19/2020
Start Date: 10/14/2020
End Date: 10/15/2020
GPS Accuracy: 0 ft
Location Verified: No

Latitude: 35.087883
Longitude: -106.511474
Direction: West, A to B

10/15/2020 Time	Motor Cycles	Cars & Trailers	2 Axle Long	Buses	2 Axle 6 Tire	3 Axle Single	4 Axle Single	<5 Axl Double	5 Axle Double	>6 Axl Double	<6 Axl Multi	6 Axle Multi	>6 Axl Multi	No Class	Total
12:00 AM	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
1:00	0	1	0	0	1	0	0	0	0	0	0	0	0	0	2
2:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
3:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
4:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
5:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
6:00	0	3	1	0	0	0	0	0	0	0	0	0	0	0	4
7:00	0	4	1	0	0	0	0	0	0	0	0	0	0	0	5
8:00	0	5	0	0	1	0	0	0	0	0	0	0	0	0	6
9:00	0	3	3	0	1	0	0	0	0	0	0	0	0	0	7
10:00	0	6	2	0	0	0	0	0	0	0	0	0	0	0	8
11:00	0	8	2	0	1	0	0	0	0	0	0	0	0	0	11
12:00 PM	0	6	0	0	0	0	0	0	0	0	0	0	0	0	6
1:00	0	7	1	0	1	0	0	0	0	0	0	0	0	0	9
2:00	0	4	1	0	0	1	0	0	0	0	0	0	0	1	7
3:00	0	1	2	0	0	0	0	0	0	0	0	0	0	0	3
4:00	0	6	0	0	0	0	0	0	0	0	0	0	0	0	6
5:00	0	2	2	0	0	0	0	0	0	0	0	0	0	0	4
6:00	0	5	0	0	0	0	0	0	0	0	0	0	0	0	5
7:00	0	2	0	0	0	0	0	0	0	0	0	0	0	0	2
8:00	0	1	1	0	0	0	0	0	0	0	0	0	0	0	2
9:00	0	0	1	0	0	0	0	0	0	0	0	0	0	0	1
10:00	0	2	0	0	0	0	0	0	0	0	0	0	0	0	2
11:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
Total	0	66	17	0	5	1	0	0	0	0	0	0	0	1	90
Percent	0.0%	73.3%	18.9%	0.0%	5.6%	1.1%	0.0%	0.0%	0.0%	0.0%	0.0%	0.0%	0.0%	1.1%	
AM Peak		11:00	9:00		1:00										11:00
	*	8	3	*	1	*	*	*	*	*	*	*	*	*	11
PM Peak		1:00	3:00		1:00	2:00								2:00	1:00
	*	7	2	*	1	1	*	*	*	*	*	*	*	1	9
Grand Total	0	128	37	0	10	1	0	0	0	0	0	0	0	1	177
Percent	0.0%	72.3%	20.9%	0.0%	5.6%	0.6%	0.0%	0.0%	0.0%	0.0%	0.0%	0.0%	0.0%	0.6%	



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Counter #1 Sierra
Grande Ave
Date Printed: 10/19/2020
Start Date: 10/14/2020
End Date: 10/15/2020
GPS Accuracy: 0 ft
Location Verified: No

Latitude: 35.087883
Longitude: -106.511474
Direction: East, B to A

10/14/2020 Time	Motor Cycles	Cars & Trailers	2 Axle Long	Buses	2 Axle 6 Tire	3 Axle Single	4 Axle Single	<5 Axl Double	5 Axle Double	>6 Axl Double	<6 Axl Multi	6 Axle Multi	>6 Axl Multi	No Class	Total
12:00 AM	0	1	0	0	0	0	0	0	0	0	0	0	0	0	1
1:00	0	1	0	0	0	0	0	0	0	0	0	0	0	0	1
2:00	0	1	0	0	0	0	0	0	0	0	0	0	0	0	1
3:00	0	1	0	0	0	0	0	0	0	0	0	0	0	0	1
4:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
5:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
6:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
7:00	0	5	1	0	0	0	0	0	0	0	0	0	0	0	6
8:00	0	5	2	0	2	0	0	0	0	0	0	0	0	0	9
9:00	0	3	1	0	0	0	0	0	0	0	0	0	0	0	4
10:00	0	7	3	0	2	0	0	1	0	0	0	0	0	0	13
11:00	0	8	2	1	3	0	0	0	0	0	0	0	0	0	14
12:00 PM	0	13	4	0	1	0	0	0	1	0	0	0	0	0	19
1:00	2	5	4	0	0	0	0	0	0	0	0	0	0	0	11
2:00	0	14	4	0	1	0	0	0	0	0	0	0	0	0	19
3:00	0	9	4	0	3	0	0	0	0	0	0	0	0	0	16
4:00	0	17	6	0	2	0	0	1	0	0	0	0	0	0	26
5:00	0	18	3	0	1	0	0	0	0	0	0	0	0	0	22
6:00	0	10	6	0	2	0	0	0	0	0	0	0	0	0	18
7:00	0	7	2	0	4	0	0	0	0	0	0	0	0	0	13
8:00	0	8	2	0	0	0	0	0	0	0	0	0	0	0	10
9:00	0	0	0	0	1	0	0	0	0	0	0	0	0	0	1
10:00	0	4	2	0	0	0	0	0	0	0	0	0	0	0	6
11:00	0	6	0	0	0	0	0	0	0	0	0	0	0	0	6
Total	2	143	46	1	22	0	0	2	1	0	0	0	0	0	217
Percent	0.9%	65.9%	21.2%	0.5%	10.1%	0.0%	0.0%	0.9%	0.5%	0.0%	0.0%	0.0%	0.0%	0.0%	
AM Peak		11:00	10:00	11:00	11:00			10:00							11:00
	*	8	3	1	3	*	*	1	*	*	*	*	*	*	14
PM Peak	1:00	5:00	4:00		7:00			4:00	12:00 PM						4:00
	2	18	6	*	4	*	*	1	1	*	*	*	*	*	26



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Counter #1 Sierra
Grande Ave
Date Printed: 10/19/2020
Start Date: 10/14/2020
End Date: 10/15/2020
GPS Accuracy: 0 ft
Location Verified: No

Latitude: 35.087883
Longitude: -106.511474
Direction: East, B to A

10/15/2020 Time	Motor Cycles	Cars & Trailers	2 Axle Long	Buses	2 Axle 6 Tire	3 Axle Single	4 Axle Single	<5 Axl Double	5 Axle Double	>6 Axl Double	<6 Axl Multi	6 Axle Multi	>6 Axl Multi	No Class	Total
12:00 AM	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
1:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
2:00	0	1	0	0	0	0	0	0	0	0	0	0	0	0	1
3:00	0	1	0	0	0	0	0	0	0	0	0	0	0	0	1
4:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
5:00	0	1	0	0	0	0	0	0	0	0	0	0	0	0	1
6:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
7:00	0	1	0	0	1	0	0	0	0	0	0	0	0	0	2
8:00	0	10	0	0	2	0	0	0	0	0	0	0	0	0	12
9:00	0	6	1	0	3	0	0	0	0	0	0	0	0	0	10
10:00	0	6	2	0	1	0	0	0	0	0	0	0	0	0	9
11:00	0	11	3	0	2	0	0	0	0	0	0	0	0	0	16
12:00 PM	0	7	2	0	1	0	0	0	0	0	0	0	0	0	10
1:00	0	7	1	0	2	0	0	0	0	0	0	0	0	0	10
2:00	1	15	3	0	0	0	0	0	0	0	0	0	0	0	19
3:00	0	12	6	0	1	0	0	0	0	0	0	0	0	0	19
4:00	0	18	0	0	3	0	0	0	0	0	0	0	0	0	21
5:00	0	14	5	0	1	0	0	0	0	0	0	0	0	0	20
6:00	0	18	2	0	4	0	0	0	0	0	0	0	0	0	24
7:00	0	1	2	0	1	0	0	0	0	0	0	0	0	0	4
8:00	0	8	3	0	0	0	0	0	0	0	0	0	0	0	11
9:00	0	4	3	0	0	0	0	0	0	0	0	0	0	0	7
10:00	0	0	0	0	1	0	0	0	0	0	0	0	0	0	1
11:00	0	3	0	0	1	0	0	0	0	0	0	0	0	0	4
Total	1	144	33	0	24	0	0	0	0	0	0	0	0	0	202
Percent	0.5%	71.3%	16.3%	0.0%	11.9%	0.0%	0.0%	0.0%	0.0%	0.0%	0.0%	0.0%	0.0%	0.0%	
AM Peak		11:00	11:00		9:00										11:00
	*	11	3	*	3	*	*	*	*	*	*	*	*	*	16
PM Peak	2:00	4:00	3:00		6:00										6:00
	1	18	6	*	4	*	*	*	*	*	*	*	*	*	24
Grand Total	3	287	79	1	46	0	0	2	1	0	0	0	0	0	419
Percent	0.7%	68.5%	18.9%	0.2%	11.0%	0.0%	0.0%	0.5%	0.2%	0.0%	0.0%	0.0%	0.0%	0.0%	




WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Counter #1 Sierra Grande Ave
Date Printed: 10/19/2020
Start Date: 10/14/2020
End Date: 10/15/2020
GPS Accuracy: 0 ft
Location Verified: No

Latitude: 35.087883
Longitude: -106.511474

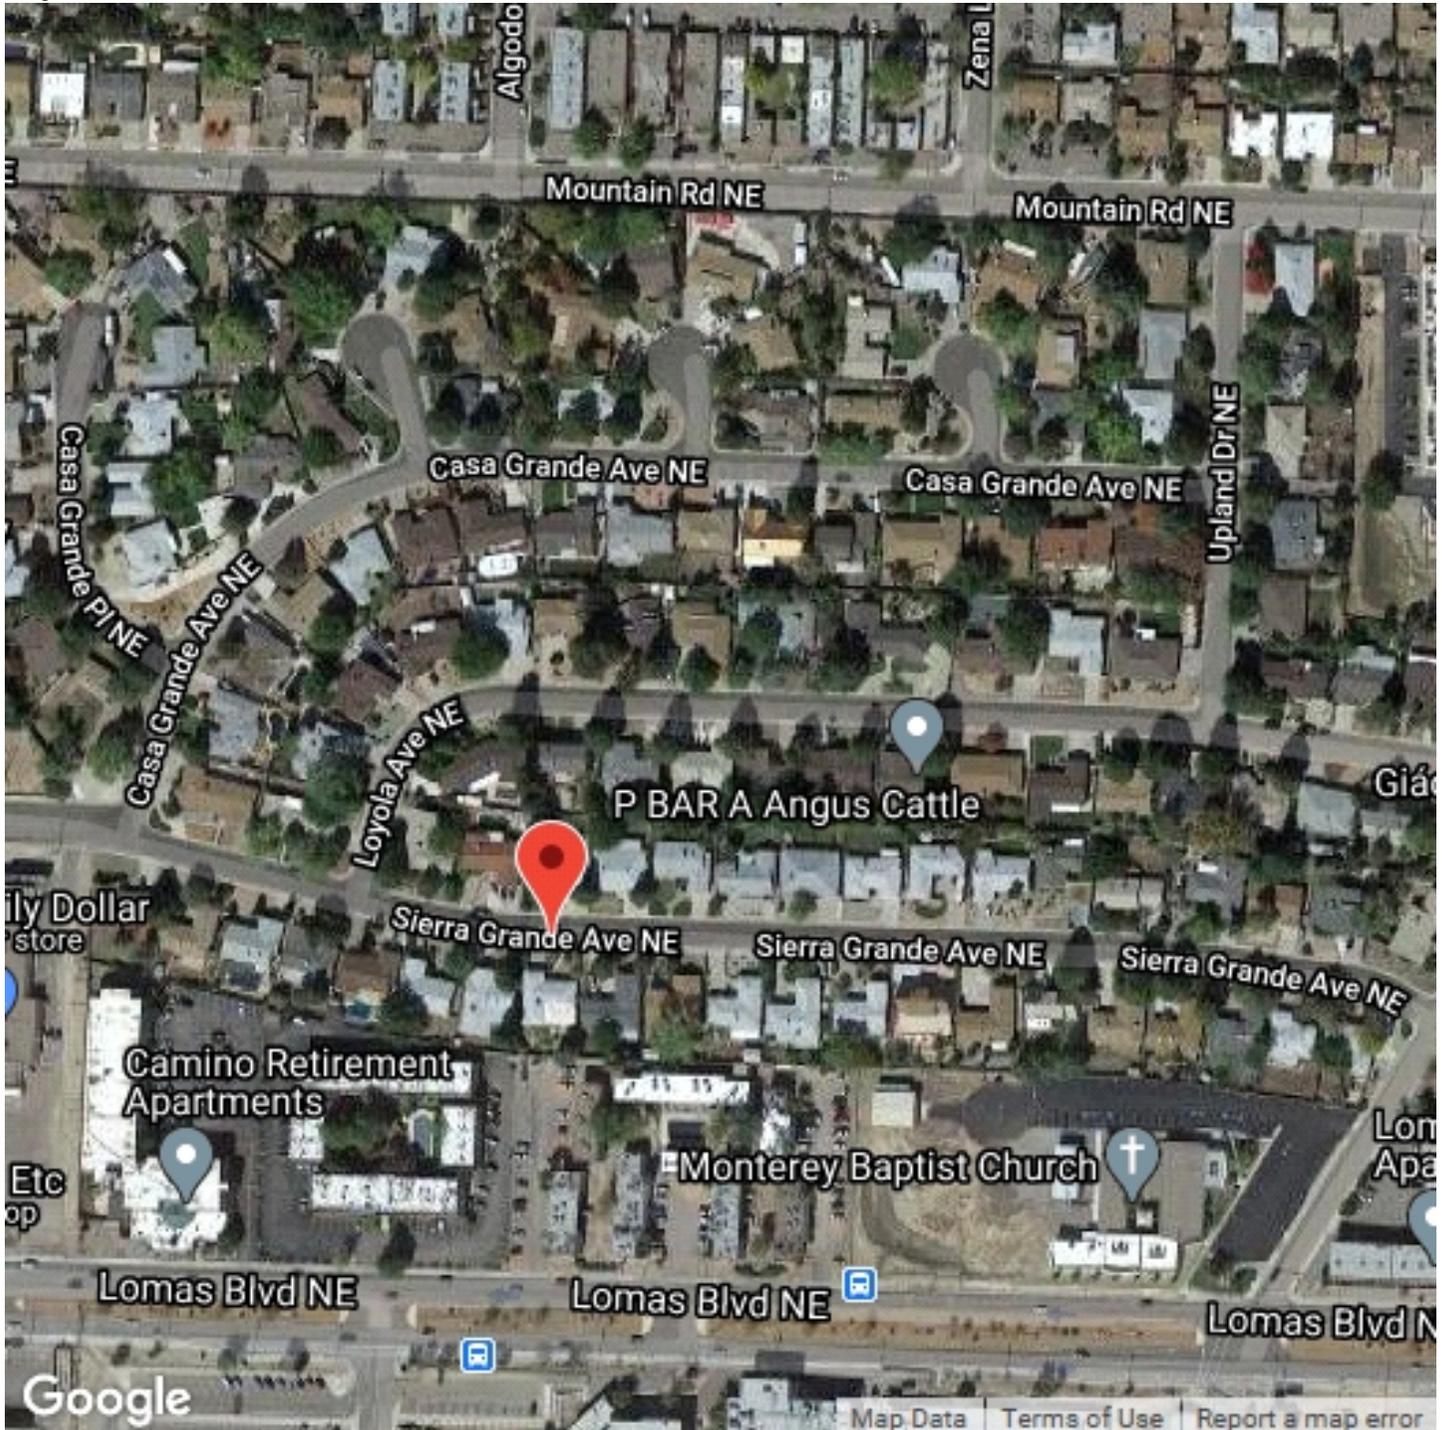



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Counter #2 Sierra
Grande Ave
Date Printed: 10/19/2020
Start Date: 10/14/2020
End Date: 10/15/2020
GPS Accuracy: 0 ft
Location Verified: No

Location 1:
Location 2:
Latitude: 35.087857
Longitude: -106.509360

10/14/2020	West, A to B	East, B to A	Total
	Time		
	12:00 AM	0	2
	1:00	0	1
	2:00	0	1
	3:00	0	1
	4:00	0	0
	5:00	0	0
	6:00	0	0
	7:00	4	6
	8:00	6	8
	9:00	8	3
	10:00	6	13
	11:00	5	14
	12:00 PM	7	15
	1:00	2	10
	2:00	4	17
	3:00	3	15
	4:00	1	26
	5:00	5	16
	6:00	2	17
	7:00	3	9
	8:00	6	9
	9:00	3	2
	10:00	2	6
	11:00	0	6
	Total	67	197
	Percent	25.4%	74.6%
	AM Peak	9:00	12:00 PM
	Volume	8	15
	PM Peak	12:00 PM	4:00
	Volume	7	26



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Counter #2 Sierra
Grande Ave
Date Printed: 10/19/2020
Start Date: 10/14/2020
End Date: 10/15/2020
GPS Accuracy: 0 ft
Location Verified: No

Location 1:
Location 2:
Latitude: 35.087857
Longitude: -106.509360

10/15/2020	West, A to B	East, B to A	Total
	Time		
	12:00 AM	0	0
	1:00	2	2
	2:00	0	1
	3:00	0	1
	4:00	0	0
	5:00	0	1
	6:00	2	0
	7:00	0	2
	8:00	5	10
	9:00	5	9
	10:00	6	7
	11:00	10	13
	12:00 PM	6	12
	1:00	10	8
	2:00	3	16
	3:00	3	19
	4:00	4	20
	5:00	3	17
	6:00	5	23
	7:00	2	4
	8:00	3	9
	9:00	1	7
	10:00	1	0
	11:00	0	3
	Total	71	182
	Percent	28.1%	71.9%
	AM Peak	11:00	11:00
	Volume	10	13
	PM Peak	1:00	6:00
	Volume	10	23
	Grand Total	138	379
	Percent	26.7%	73.3%
	ADT	ADT: 258	AADT: 258




WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Counter #2 Sierra Grande Ave
Date Printed: 10/19/2020
Start Date: 10/14/2020
End Date: 10/15/2020
GPS Accuracy: 0 ft
Location Verified: No

Location 1:
Location 2:
Latitude: 35.087857
Longitude: -106.509360

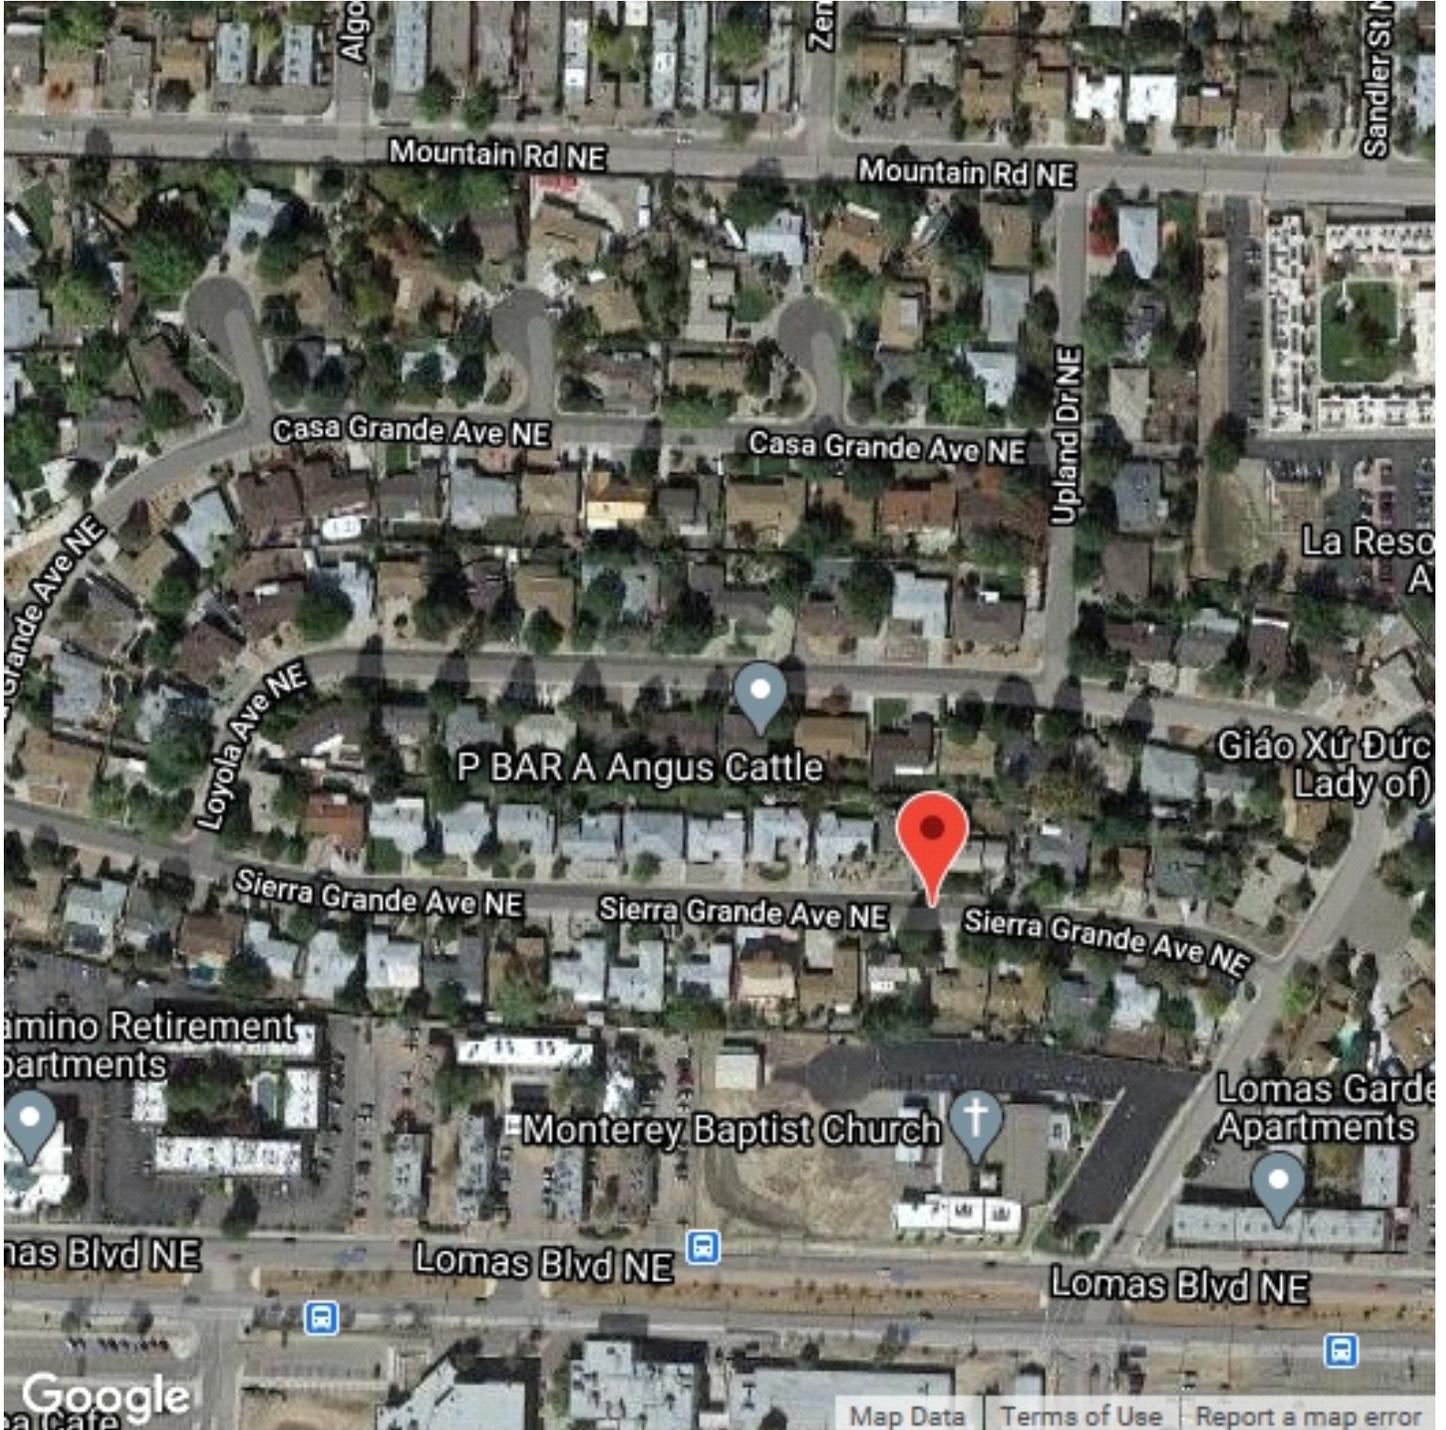



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Counter #2 Sierra
Grande Ave

Date Printed: 10/19/2020

Start Date: 10/14/2020

End Date: 10/15/2020

GPS Accuracy: 0 ft

Location Verified: No

Latitude: 35.087857
Longitude: -106.509360
Direction: West, A to B

10/14/2020	0 - 15	> 15 -	> 20 -	> 25 -	> 30 -	> 35 -	> 40 -	> 45 -	> 50 -	> 55 -	> 60 -	> 65 -	> 70	Total
Time	MPH	20 MPH	25 MPH	30 MPH	35 MPH	40 MPH	45 MPH	50 MPH	55 MPH	60 MPH	65 MPH	70 MPH	MPH	
12:00 AM	0	0	0	0	0	0	0	0	0	0	0	0	0	0
1:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
2:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
3:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
4:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
5:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
6:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
7:00	0	0	2	1	1	0	0	0	0	0	0	0	0	4
8:00	1	0	1	2	2	0	0	0	0	0	0	0	0	6
9:00	0	0	2	2	4	0	0	0	0	0	0	0	0	8
10:00	0	1	3	1	0	1	0	0	0	0	0	0	0	6
11:00	0	0	1	2	2	0	0	0	0	0	0	0	0	5
12:00 PM	1	1	2	2	1	0	0	0	0	0	0	0	0	7
1:00	0	0	0	1	0	1	0	0	0	0	0	0	0	2
2:00	0	0	2	2	0	0	0	0	0	0	0	0	0	4
3:00	0	0	2	0	1	0	0	0	0	0	0	0	0	3
4:00	0	0	0	0	1	0	0	0	0	0	0	0	0	1
5:00	0	1	3	1	0	0	0	0	0	0	0	0	0	5
6:00	0	2	0	0	0	0	0	0	0	0	0	0	0	2
7:00	0	0	1	1	1	0	0	0	0	0	0	0	0	3
8:00	0	0	0	0	5	1	0	0	0	0	0	0	0	6
9:00	0	0	0	2	0	1	0	0	0	0	0	0	0	3
10:00	0	1	1	0	0	0	0	0	0	0	0	0	0	2
11:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
Total	2	6	20	17	18	4	0	0	0	0	0	0	0	67



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Counter #2 Sierra
Grande Ave
Date Printed: 10/19/2020
Start Date: 10/14/2020
End Date: 10/15/2020
GPS Accuracy: 0 ft
Location Verified: No

Latitude: 35.087857
Longitude: -106.509360
Direction: West, A to B

10/15/2020	0 - 15	> 15 -	> 20 -	> 25 -	> 30 -	> 35 -	> 40 -	> 45 -	> 50 -	> 55 -	> 60 -	> 65 -	> 70	Total
Time	MPH	20 MPH	25 MPH	30 MPH	35 MPH	40 MPH	45 MPH	50 MPH	55 MPH	60 MPH	65 MPH	70 MPH	MPH	
12:00 AM	0	0	0	0	0	0	0	0	0	0	0	0	0	0
1:00	1	0	0	1	0	0	0	0	0	0	0	0	0	2
2:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
3:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
4:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
5:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
6:00	0	1	0	0	1	0	0	0	0	0	0	0	0	2
7:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
8:00	1	0	1	3	0	0	0	0	0	0	0	0	0	5
9:00	0	1	1	3	0	0	0	0	0	0	0	0	0	5
10:00	1	2	2	0	0	0	1	0	0	0	0	0	0	6
11:00	2	0	2	4	2	0	0	0	0	0	0	0	0	10
12:00 PM	1	1	1	1	1	1	0	0	0	0	0	0	0	6
1:00	0	0	4	5	1	0	0	0	0	0	0	0	0	10
2:00	1	0	1	0	0	1	0	0	0	0	0	0	0	3
3:00	0	0	0	1	0	2	0	0	0	0	0	0	0	3
4:00	0	1	0	3	0	0	0	0	0	0	0	0	0	4
5:00	1	0	0	1	1	0	0	0	0	0	0	0	0	3
6:00	2	0	2	1	0	0	0	0	0	0	0	0	0	5
7:00	0	0	0	2	0	0	0	0	0	0	0	0	0	2
8:00	1	0	1	1	0	0	0	0	0	0	0	0	0	3
9:00	0	0	0	1	0	0	0	0	0	0	0	0	0	1
10:00	0	0	1	0	0	0	0	0	0	0	0	0	0	1
11:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
Total	11	6	16	27	6	4	1	0	0	0	0	0	0	71
Grand Total	13	12	36	44	24	8	1	0	0	0	0	0	0	138
Stats	Percentile		15th	50th	85th	95th								
	Speed		19	25.7	31.6	36.1								
	Mean Speed (Average)		26.9											
	10 MPH Pace Speed		20-29											
	Number in Pace		79											
	Percent in Pace		63.0%											
	Number > 25 MPH		77											
	Percent > 25 MPH		61.6%											



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Counter #2 Sierra
Grande Ave

Date Printed: 10/19/2020

Start Date: 10/14/2020

End Date: 10/15/2020

GPS Accuracy: 0 ft

Location Verified: No

Latitude: 35.087857
Longitude: -106.509360
Direction: East, B to A

10/14/2020	0 - 15	> 15 -	> 20 -	> 25 -	> 30 -	> 35 -	> 40 -	> 45 -	> 50 -	> 55 -	> 60 -	> 65 -	> 70	Total
Time	MPH	20 MPH	25 MPH	30 MPH	35 MPH	40 MPH	45 MPH	50 MPH	55 MPH	60 MPH	65 MPH	70 MPH	MPH	
12:00 AM	1	0	0	0	0	0	1	0	0	0	0	0	0	2
1:00	0	0	0	0	1	0	0	0	0	0	0	0	0	1
2:00	1	0	0	0	0	0	0	0	0	0	0	0	0	1
3:00	0	0	0	1	0	0	0	0	0	0	0	0	0	1
4:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
5:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
6:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
7:00	0	2	2	0	2	0	0	0	0	0	0	0	0	6
8:00	1	1	2	4	0	0	0	0	0	0	0	0	0	8
9:00	0	0	0	3	0	0	0	0	0	0	0	0	0	3
10:00	1	3	4	3	2	0	0	0	0	0	0	0	0	13
11:00	0	5	4	5	0	0	0	0	0	0	0	0	0	14
12:00 PM	0	1	6	7	1	0	0	0	0	0	0	0	0	15
1:00	1	0	4	2	1	2	0	0	0	0	0	0	0	10
2:00	1	0	8	6	2	0	0	0	0	0	0	0	0	17
3:00	0	0	7	6	2	0	0	0	0	0	0	0	0	15
4:00	0	3	10	11	1	1	0	0	0	0	0	0	0	26
5:00	0	3	3	8	1	1	0	0	0	0	0	0	0	16
6:00	2	4	5	5	0	1	0	0	0	0	0	0	0	17
7:00	3	0	4	2	0	0	0	0	0	0	0	0	0	9
8:00	0	3	2	4	0	0	0	0	0	0	0	0	0	9
9:00	0	1	0	1	0	0	0	0	0	0	0	0	0	2
10:00	0	1	2	2	1	0	0	0	0	0	0	0	0	6
11:00	0	0	1	3	0	1	1	0	0	0	0	0	0	6
Total	11	27	64	74	13	7	1	0	0	0	0	0	0	197



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Counter #2 Sierra
Grande Ave
Date Printed: 10/19/2020
Start Date: 10/14/2020
End Date: 10/15/2020
GPS Accuracy: 0 ft
Location Verified: No

Latitude: 35.087857
Longitude: -106.509360
Direction: East, B to A

10/15/2020	0 - 15	> 15 -	> 20 -	> 25 -	> 30 -	> 35 -	> 40 -	> 45 -	> 50 -	> 55 -	> 60 -	> 65 -	> 70	Total
Time	MPH	20 MPH	25 MPH	30 MPH	35 MPH	40 MPH	45 MPH	50 MPH	55 MPH	60 MPH	65 MPH	70 MPH	MPH	
12:00 AM	0	0	0	0	0	0	0	0	0	0	0	0	0	0
1:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
2:00	0	1	0	0	0	0	0	0	0	0	0	0	0	1
3:00	0	0	0	1	0	0	0	0	0	0	0	0	0	1
4:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
5:00	0	0	1	0	0	0	0	0	0	0	0	0	0	1
6:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
7:00	0	0	1	1	0	0	0	0	0	0	0	0	0	2
8:00	1	2	4	2	1	0	0	0	0	0	0	0	0	10
9:00	1	3	1	3	1	0	0	0	0	0	0	0	0	9
10:00	0	3	2	2	0	0	0	0	0	0	0	0	0	7
11:00	2	2	3	5	1	0	0	0	0	0	0	0	0	13
12:00 PM	1	1	2	6	1	1	0	0	0	0	0	0	0	12
1:00	0	3	4	1	0	0	0	0	0	0	0	0	0	8
2:00	1	2	5	2	3	3	0	0	0	0	0	0	0	16
3:00	0	2	4	5	7	1	0	0	0	0	0	0	0	19
4:00	2	1	7	5	4	1	0	0	0	0	0	0	0	20
5:00	1	3	5	5	3	0	0	0	0	0	0	0	0	17
6:00	5	4	7	6	1	0	0	0	0	0	0	0	0	23
7:00	1	0	0	3	0	0	0	0	0	0	0	0	0	4
8:00	0	1	3	3	2	0	0	0	0	0	0	0	0	9
9:00	0	2	4	0	0	1	0	0	0	0	0	0	0	7
10:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
11:00	0	0	0	2	0	1	0	0	0	0	0	0	0	3
Total	15	30	53	52	24	8	0	0	0	0	0	0	0	182
Grand Total	26	57	117	126	37	15	1	0	0	0	0	0	0	379
Stats	Percentile		15th	50th	85th	95th								
	Speed		18.4	24.5	29.5	33.5								
	Mean Speed (Average)		25.3											
	10 MPH Pace Speed		20-29											
	Number in Pace		242											
	Percent in Pace		68.0%											
	Number > 25 MPH		179											
	Percent > 25 MPH		50.7%											




WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Counter #2 Sierra Grande Ave
Date Printed: 10/19/2020
Start Date: 10/14/2020
End Date: 10/15/2020
GPS Accuracy: 0 ft
Location Verified: No

Latitude: 35.087857
Longitude: -106.509360

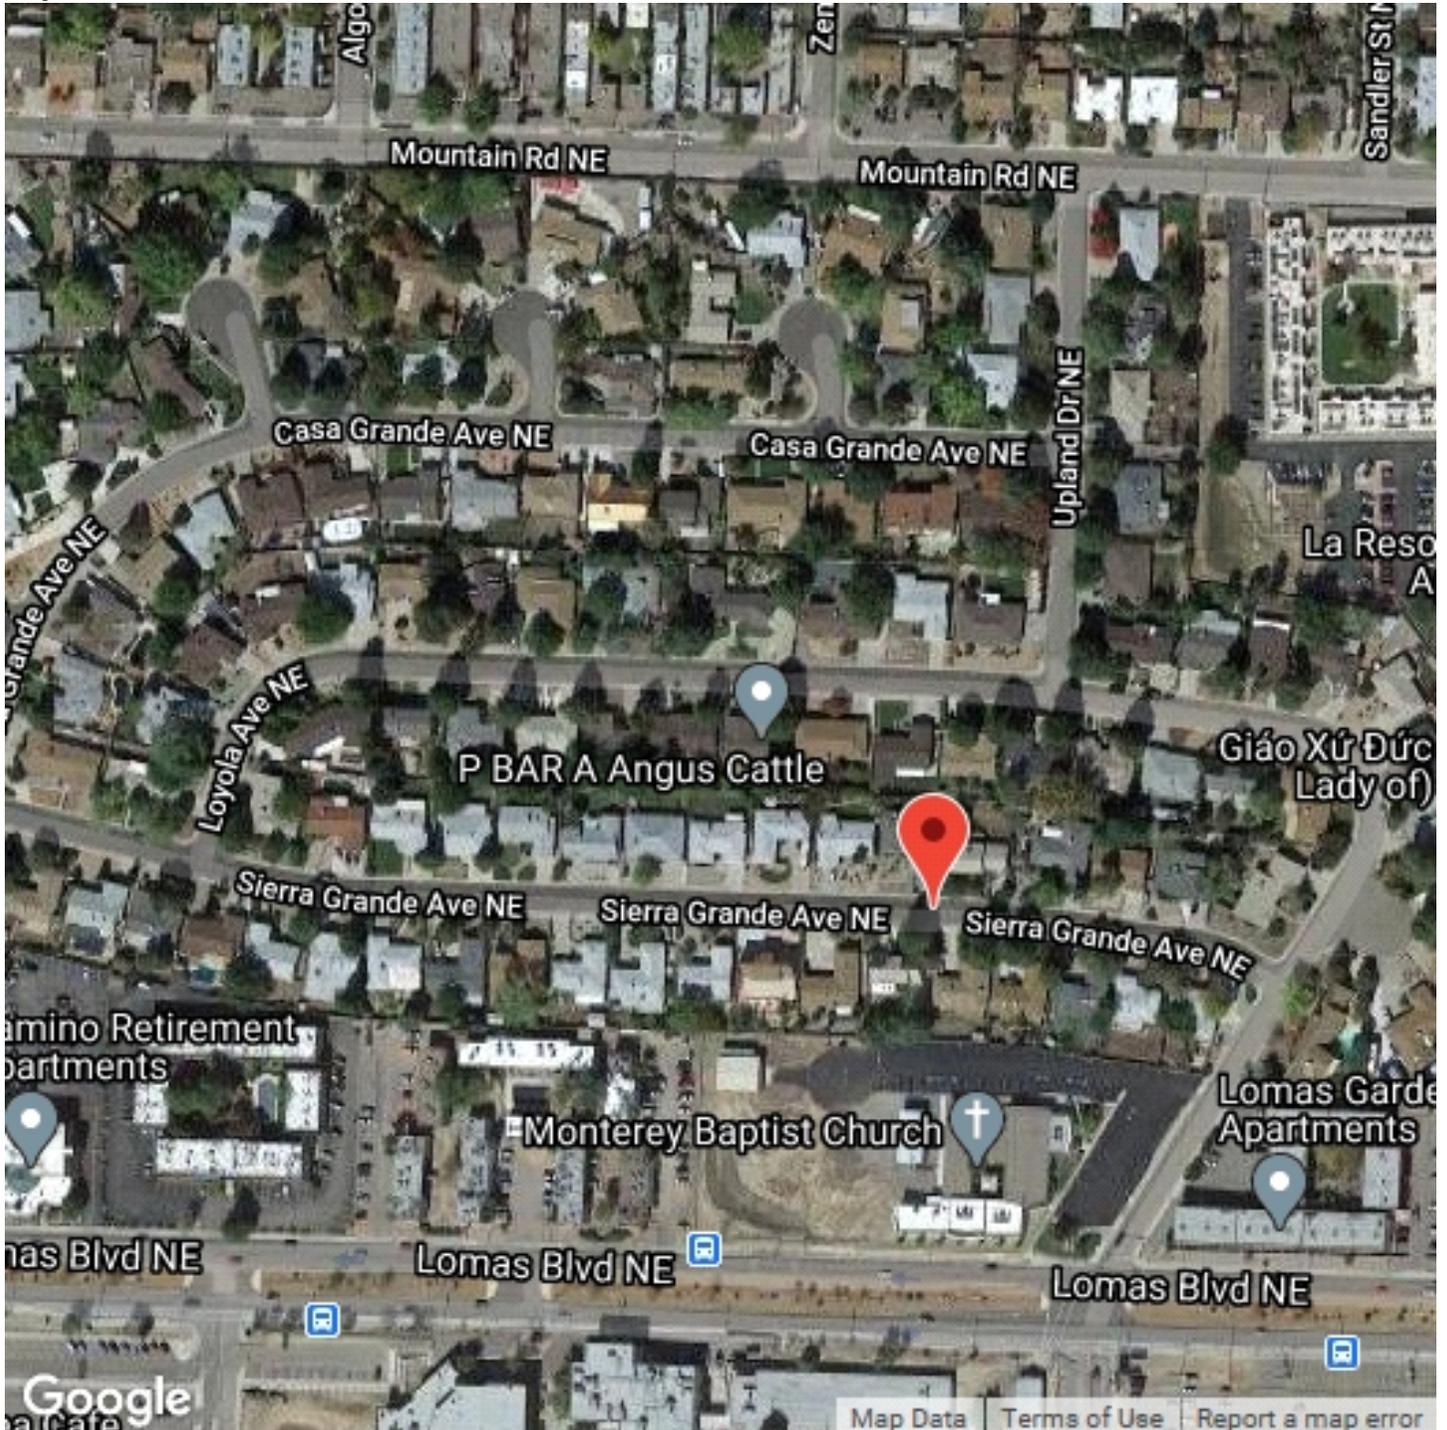



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

Speed Enforcement Evaluator

Analysis Dates


Start: 10/14/2020

End: 10/14/2020

Total Percentage of Enforceable Violations

Posted Speed Limit 25 MPH

Enforcement Tolerance 5 MPH

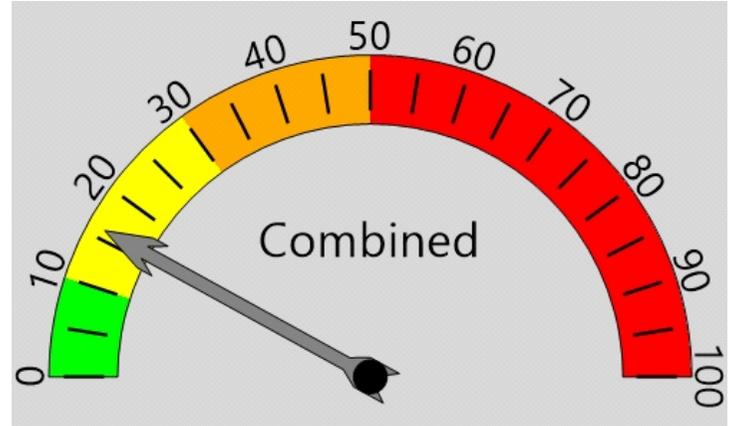


Percent Speeding: 16%

Rating: Medium Low



Percent Speeding: 33%

Rating: Medium

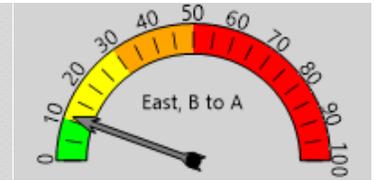

Percent Speeding: 11%

Rating: Medium Low

Vehicle Totals - Combined

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
13	33	84	91	31	11	1	0	0	0	0	0	0
85th Percentile: 30.3												

Vehicle Totals - West, A to B

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
2	6	20	17	18	4	0	0	0	0	0	0	0
85th Percentile: 32.9												

Vehicle Totals - East, B to A

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
11	27	64	74	13	7	1	0	0	0	0	0	0
85th Percentile: 28.7												



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

Speed Enforcement Evaluator

Analysis Dates


Start: 10/15/2020

End: 10/15/2020

Total Percentage of Enforceable Violations


Posted Speed Limit 25 MPH

Enforcement Tolerance 5 MPH

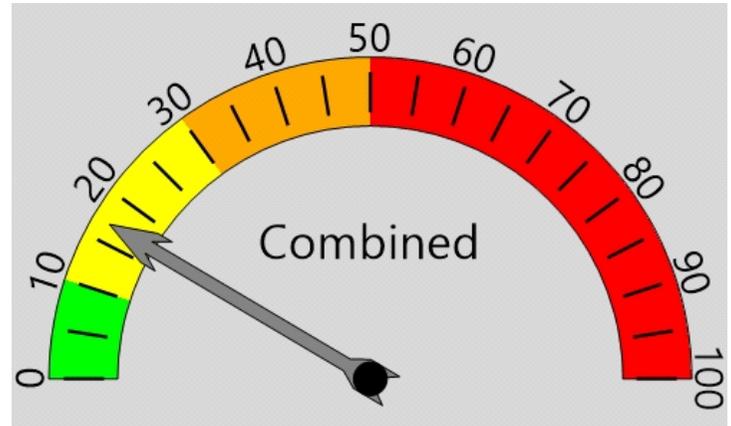


Percent Speeding: 17%

Rating: Medium Low

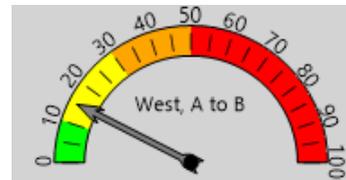

Percent Speeding: 15%

Rating: Medium Low

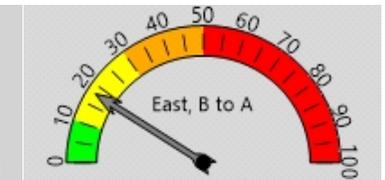

Percent Speeding: 18%

Rating: Medium Low

Vehicle Totals - Combined

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
26	36	69	79	30	12	1	0	0	0	0	0	0
85th Percentile: 30.4												

Vehicle Totals - West, A to B

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
11	6	16	27	6	4	1	0	0	0	0	0	0
85th Percentile: 29.8												

Vehicle Totals - East, B to A

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
15	30	53	52	24	8	0	0	0	0	0	0	0
85th Percentile: 30.5												



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

Speed Enforcement Evaluator


Analysis Dates

Start: 10/14/2020

End: 10/14/2020


Total Percentage of Enforceable Violations

Posted Speed Limit 25 MPH
Enforcement Tolerance 7 MPH

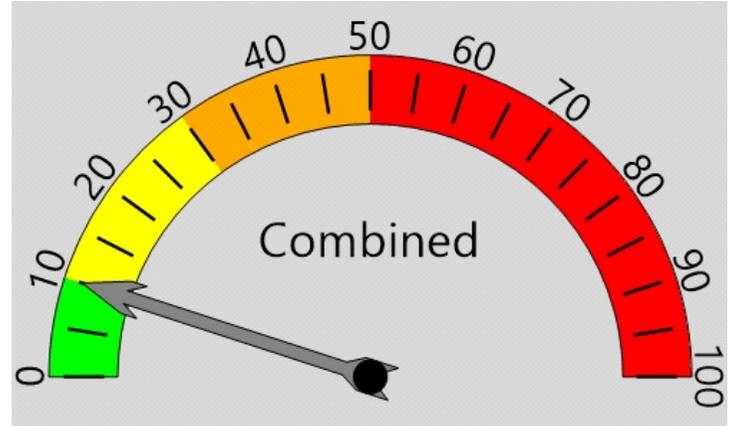


Percent Speeding: 10%

Rating: Medium Low

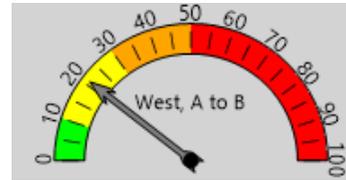

Percent Speeding: 21%

Rating: Medium Low

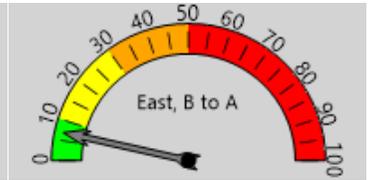

Percent Speeding: 7%

Rating: Low

Vehicle Totals - Combined

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
13	33	84	91	31	11	1	0	0	0	0	0	0
85th Percentile: 30.3												

Vehicle Totals - West, A to B

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
2	6	20	17	18	4	0	0	0	0	0	0	0
85th Percentile: 32.9												

Vehicle Totals - East, B to A

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
11	27	64	74	13	7	1	0	0	0	0	0	0
85th Percentile: 28.7												



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109


Speed Enforcement Evaluator

Analysis Dates

Start: 10/15/2020
End: 10/15/2020


Total Percentage of Enforceable Violations

Posted Speed Limit 25 MPH
Enforcement Tolerance 7 MPH

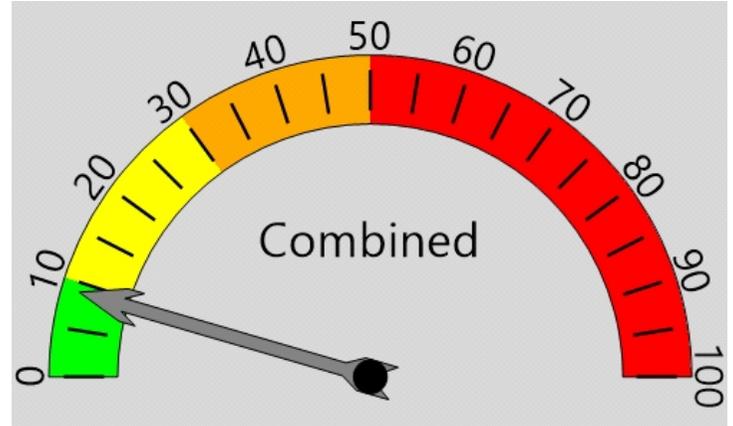


Percent Speeding: 9%

Rating: Low

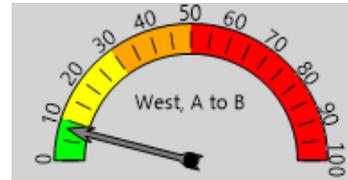

Percent Speeding: 8%

Rating: Low

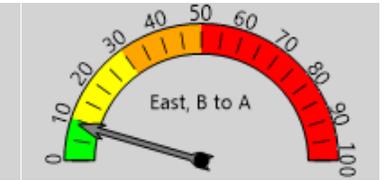

Percent Speeding: 9%

Rating: Low

Vehicle Totals - Combined

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
26	36	69	79	30	12	1	0	0	0	0	0	0
85th Percentile: 30.4												

Vehicle Totals - West, A to B

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
11	6	16	27	6	4	1	0	0	0	0	0	0
85th Percentile: 29.8												

Vehicle Totals - East, B to A

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
15	30	53	52	24	8	0	0	0	0	0	0	0
85th Percentile: 30.5												



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Counter #2 Sierra
Grande Ave
Date Printed: 10/19/2020
Start Date: 10/14/2020
End Date: 10/15/2020
GPS Accuracy: 0 ft
Location Verified: No

Latitude: 35.087857
Longitude: -106.509360
Direction: West, A to B

10/14/2020 Time	Motor Cycles	Cars & Trailers	2 Axle Long	Buses	2 Axle 6 Tire	3 Axle Single	4 Axle Single	<5 Axl Double	5 Axle Double	>6 Axl Double	<6 Axl Multi	6 Axle Multi	>6 Axl Multi	No Class	Total
12:00 AM	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
1:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
2:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
3:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
4:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
5:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
6:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
7:00	0	4	0	0	0	0	0	0	0	0	0	0	0	0	4
8:00	0	5	0	0	1	0	0	0	0	0	0	0	0	0	6
9:00	0	5	2	0	1	0	0	0	0	0	0	0	0	0	8
10:00	0	1	4	0	1	0	0	0	0	0	0	0	0	0	6
11:00	0	4	1	0	0	0	0	0	0	0	0	0	0	0	5
12:00 PM	0	3	4	0	0	0	0	0	0	0	0	0	0	0	7
1:00	0	1	1	0	0	0	0	0	0	0	0	0	0	0	2
2:00	0	1	3	0	0	0	0	0	0	0	0	0	0	0	4
3:00	0	1	1	0	1	0	0	0	0	0	0	0	0	0	3
4:00	0	1	0	0	0	0	0	0	0	0	0	0	0	0	1
5:00	0	5	0	0	0	0	0	0	0	0	0	0	0	0	5
6:00	0	2	0	0	0	0	0	0	0	0	0	0	0	0	2
7:00	0	0	2	0	1	0	0	0	0	0	0	0	0	0	3
8:00	0	5	1	0	0	0	0	0	0	0	0	0	0	0	6
9:00	0	2	1	0	0	0	0	0	0	0	0	0	0	0	3
10:00	0	2	0	0	0	0	0	0	0	0	0	0	0	0	2
11:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
Total	0	42	20	0	5	0	0	0	0	0	0	0	0	0	67
Percent	0.0%	62.7%	29.9%	0.0%	7.5%	0.0%	0.0%	0.0%	0.0%	0.0%	0.0%	0.0%	0.0%	0.0%	
AM Peak		8:00	10:00		8:00										9:00
	*	5	4	*	1	*	*	*	*	*	*	*	*	*	8
PM Peak		5:00	12:00 PM		3:00										12:00 PM
	*	5	4	*	1	*	*	*	*	*	*	*	*	*	7



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Counter #2 Sierra
Grande Ave
Date Printed: 10/19/2020
Start Date: 10/14/2020
End Date: 10/15/2020
GPS Accuracy: 0 ft
Location Verified: No

Latitude: 35.087857
Longitude: -106.509360
Direction: West, A to B

10/15/2020 Time	Motor Cycles	Cars & Trailers	2 Axle Long	Buses	2 Axle 6 Tire	3 Axle Single	4 Axle Single	<5 Axl Double	5 Axle Double	>6 Axl Double	<6 Axl Multi	6 Axle Multi	>6 Axl Multi	No Class	Total
12:00 AM	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
1:00	0	1	0	0	1	0	0	0	0	0	0	0	0	0	2
2:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
3:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
4:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
5:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
6:00	0	2	0	0	0	0	0	0	0	0	0	0	0	0	2
7:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
8:00	0	4	0	0	1	0	0	0	0	0	0	0	0	0	5
9:00	0	1	3	0	1	0	0	0	0	0	0	0	0	0	5
10:00	0	3	3	0	0	0	0	0	0	0	0	0	0	0	6
11:00	0	7	1	0	2	0	0	0	0	0	0	0	0	0	10
12:00 PM	0	6	0	0	0	0	0	0	0	0	0	0	0	0	6
1:00	0	6	2	0	1	0	0	1	0	0	0	0	0	0	10
2:00	0	2	0	0	1	0	0	0	0	0	0	0	0	0	3
3:00	0	1	2	0	0	0	0	0	0	0	0	0	0	0	3
4:00	0	3	1	0	0	0	0	0	0	0	0	0	0	0	4
5:00	0	1	2	0	0	0	0	0	0	0	0	0	0	0	3
6:00	0	4	0	0	1	0	0	0	0	0	0	0	0	0	5
7:00	0	2	0	0	0	0	0	0	0	0	0	0	0	0	2
8:00	0	1	2	0	0	0	0	0	0	0	0	0	0	0	3
9:00	0	0	1	0	0	0	0	0	0	0	0	0	0	0	1
10:00	0	1	0	0	0	0	0	0	0	0	0	0	0	0	1
11:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
Total	0	45	17	0	8	0	0	1	0	0	0	0	0	0	71
Percent	0.0%	63.4%	23.9%	0.0%	11.3%	0.0%	0.0%	1.4%	0.0%	0.0%	0.0%	0.0%	0.0%	0.0%	
AM Peak		11:00	9:00		11:00										11:00
	*	7	3	*	2	*	*	*	*	*	*	*	*	*	10
PM Peak		12:00	1:00		1:00			1:00							1:00
	*	6	2	*	1	*	*	1	*	*	*	*	*	*	10
Grand Total	0	87	37	0	13	0	0	1	0	0	0	0	0	0	138
Percent	0.0%	63.0%	26.8%	0.0%	9.4%	0.0%	0.0%	0.7%	0.0%	0.0%	0.0%	0.0%	0.0%	0.0%	



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Counter #2 Sierra
Grande Ave
Date Printed: 10/19/2020
Start Date: 10/14/2020
End Date: 10/15/2020
GPS Accuracy: 0 ft
Location Verified: No

Latitude: 35.087857
Longitude: -106.509360
Direction: East, B to A

10/14/2020 Time	Motor Cycles	Cars & Trailers	2 Axle Long	Buses	2 Axle 6 Tire	3 Axle Single	4 Axle Single	<5 Axl Double	5 Axle Double	>6 Axl Double	<6 Axl Multi	6 Axle Multi	>6 Axl Multi	No Class	Total
12:00 AM	0	2	0	0	0	0	0	0	0	0	0	0	0	0	2
1:00	0	1	0	0	0	0	0	0	0	0	0	0	0	0	1
2:00	0	1	0	0	0	0	0	0	0	0	0	0	0	0	1
3:00	0	1	0	0	0	0	0	0	0	0	0	0	0	0	1
4:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
5:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
6:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
7:00	0	6	0	0	0	0	0	0	0	0	0	0	0	0	6
8:00	0	6	2	0	0	0	0	0	0	0	0	0	0	0	8
9:00	0	3	0	0	0	0	0	0	0	0	0	0	0	0	3
10:00	0	8	3	0	2	0	0	0	0	0	0	0	0	0	13
11:00	0	8	4	1	1	0	0	0	0	0	0	0	0	0	14
12:00 PM	0	12	2	0	0	0	0	0	1	0	0	0	0	0	15
1:00	0	7	3	0	0	0	0	0	0	0	0	0	0	0	10
2:00	0	12	5	0	0	0	0	0	0	0	0	0	0	0	17
3:00	0	10	4	0	1	0	0	0	0	0	0	0	0	0	15
4:00	0	19	5	0	1	0	0	1	0	0	0	0	0	0	26
5:00	0	16	0	0	0	0	0	0	0	0	0	0	0	0	16
6:00	0	13	4	0	0	0	0	0	0	0	0	0	0	0	17
7:00	0	6	1	0	2	0	0	0	0	0	0	0	0	0	9
8:00	0	9	0	0	0	0	0	0	0	0	0	0	0	0	9
9:00	0	1	1	0	0	0	0	0	0	0	0	0	0	0	2
10:00	0	5	1	0	0	0	0	0	0	0	0	0	0	0	6
11:00	0	6	0	0	0	0	0	0	0	0	0	0	0	0	6
Total	0	152	35	1	7	0	0	1	1	0	0	0	0	0	197
Percent	0.0%	77.2%	17.8%	0.5%	3.6%	0.0%	0.0%	0.5%	0.5%	0.0%	0.0%	0.0%	0.0%	0.0%	
AM Peak		10:00	11:00	11:00	10:00										11:00
	*	8	4	1	2	*	*	*	*	*	*	*	*	*	14
PM Peak		4:00	2:00		7:00			4:00	12:00						4:00
	*	19	5	*	2	*	*	1	1	*	*	*	*	*	26



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Counter #2 Sierra
Grande Ave
Date Printed: 10/19/2020
Start Date: 10/14/2020
End Date: 10/15/2020
GPS Accuracy: 0 ft
Location Verified: No

Latitude: 35.087857
Longitude: -106.509360
Direction: East, B to A

10/15/2020 Time	Motor Cycles	Cars & Trailers	2 Axle Long	Buses	2 Axle 6 Tire	3 Axle Single	4 Axle Single	<5 Axl Double	5 Axle Double	>6 Axl Double	<6 Axl Multi	6 Axle Multi	>6 Axl Multi	No Class	Total
12:00 AM	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
1:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
2:00	0	1	0	0	0	0	0	0	0	0	0	0	0	0	1
3:00	0	1	0	0	0	0	0	0	0	0	0	0	0	0	1
4:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
5:00	0	1	0	0	0	0	0	0	0	0	0	0	0	0	1
6:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
7:00	0	1	0	0	1	0	0	0	0	0	0	0	0	0	2
8:00	0	8	1	0	1	0	0	0	0	0	0	0	0	0	10
9:00	0	5	2	0	2	0	0	0	0	0	0	0	0	0	9
10:00	0	5	2	0	0	0	0	0	0	0	0	0	0	0	7
11:00	0	9	3	0	0	0	0	0	0	0	0	0	0	1	13
12:00 PM	0	10	2	0	0	0	0	0	0	0	0	0	0	0	12
1:00	0	6	2	0	0	0	0	0	0	0	0	0	0	0	8
2:00	1	13	2	0	0	0	0	0	0	0	0	0	0	0	16
3:00	0	17	2	0	0	0	0	0	0	0	0	0	0	0	19
4:00	1	16	2	0	0	0	0	0	0	0	0	0	0	1	20
5:00	0	15	0	0	0	0	0	0	0	0	0	0	0	2	17
6:00	0	17	6	0	0	0	0	0	0	0	0	0	0	0	23
7:00	0	2	2	0	0	0	0	0	0	0	0	0	0	0	4
8:00	0	9	0	0	0	0	0	0	0	0	0	0	0	0	9
9:00	0	5	2	0	0	0	0	0	0	0	0	0	0	0	7
10:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
11:00	0	2	1	0	0	0	0	0	0	0	0	0	0	0	3
Total	2	143	29	0	4	0	0	0	0	0	0	0	0	4	182
Percent	1.1%	78.6%	15.9%	0.0%	2.2%	0.0%	0.0%	0.0%	0.0%	0.0%	0.0%	0.0%	0.0%	2.2%	
AM Peak		11:00	11:00		9:00									11:00	11:00
	*	9	3	*	2	*	*	*	*	*	*	*	*	1	13
PM Peak	2:00	3:00	6:00											5:00	6:00
	1	17	6	*	*	*	*	*	*	*	*	*	*	2	23
Grand Total	2	295	64	1	11	0	0	1	1	0	0	0	0	4	379
Percent	0.5%	77.8%	16.9%	0.3%	2.9%	0.0%	0.0%	0.3%	0.3%	0.0%	0.0%	0.0%	0.0%	1.1%	




WILSON & COMPANY



4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Counter #2 Sierra Grande Ave
Date Printed: 10/19/2020
Start Date: 10/14/2020
End Date: 10/15/2020
GPS Accuracy: 0 ft
Location Verified: No

Latitude: 35.087857
Longitude: -106.509360

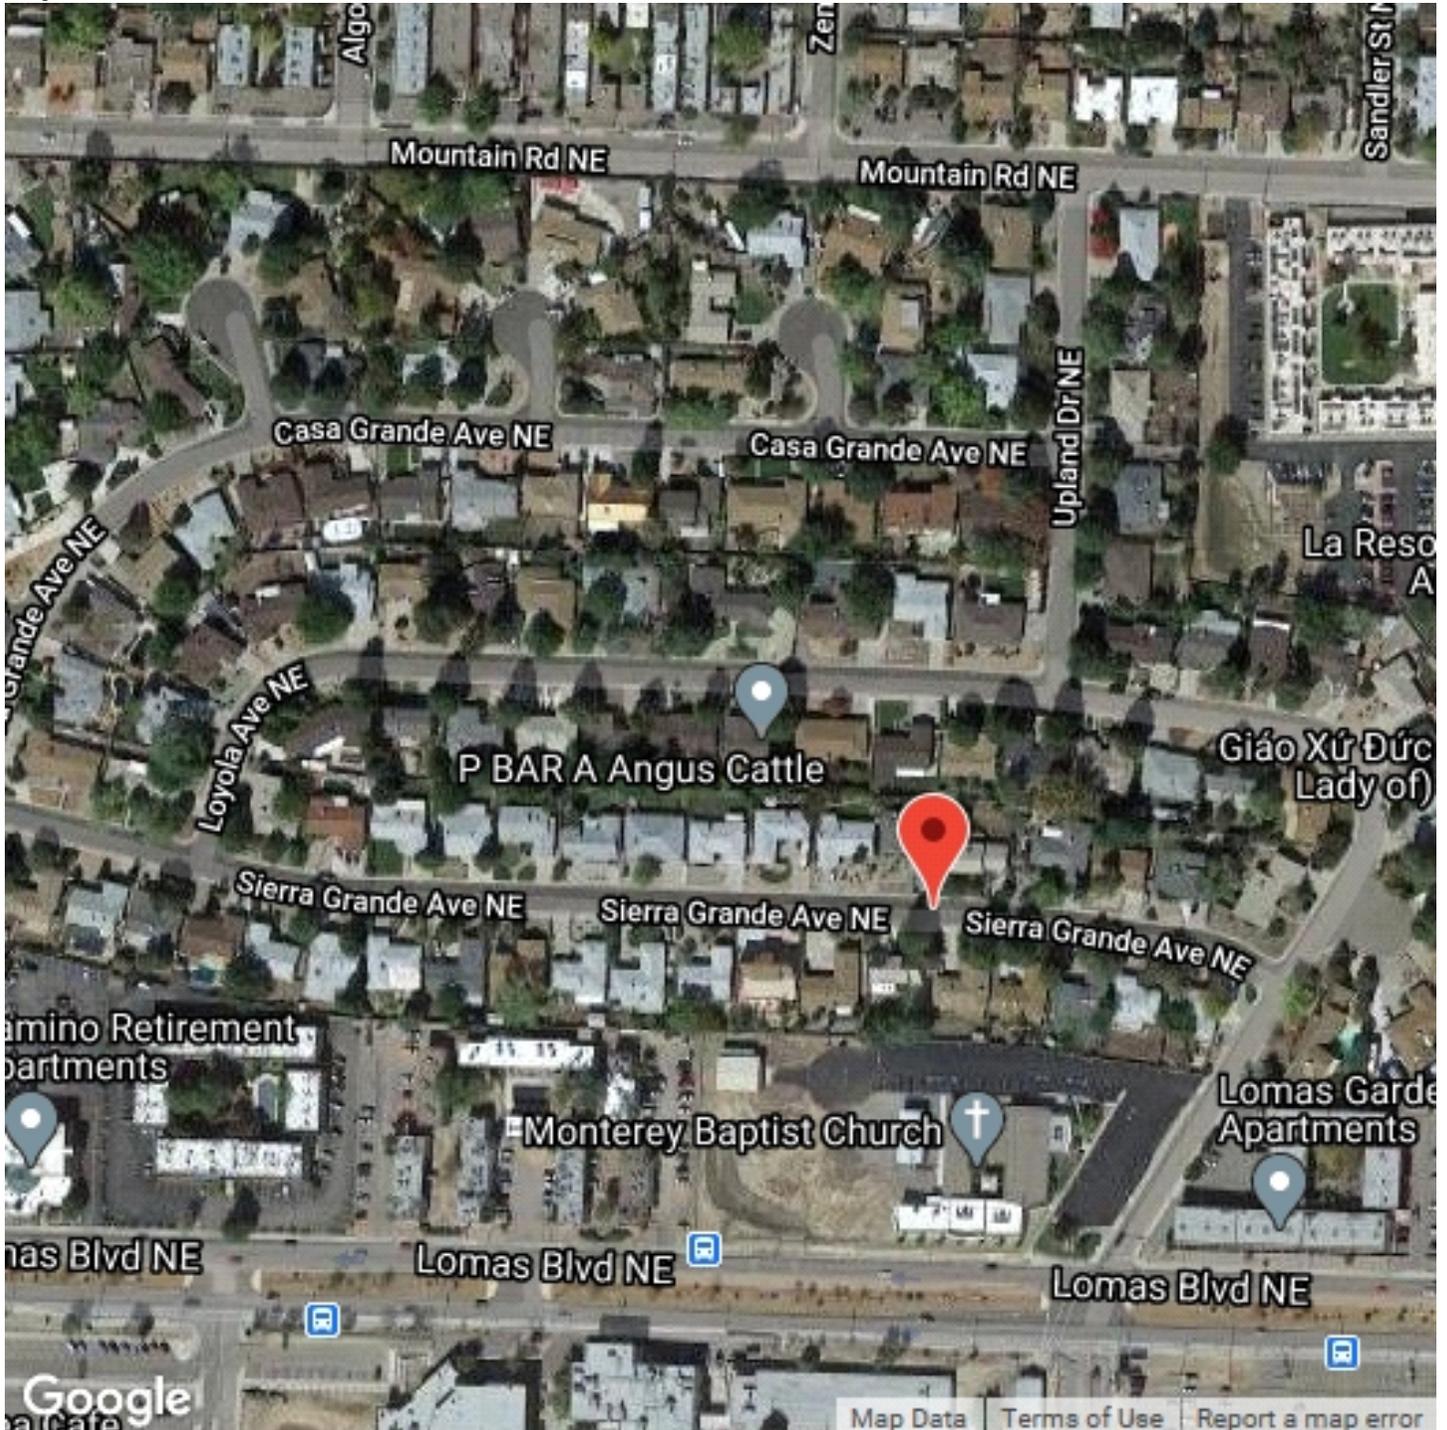

Appendix B – Crash Data

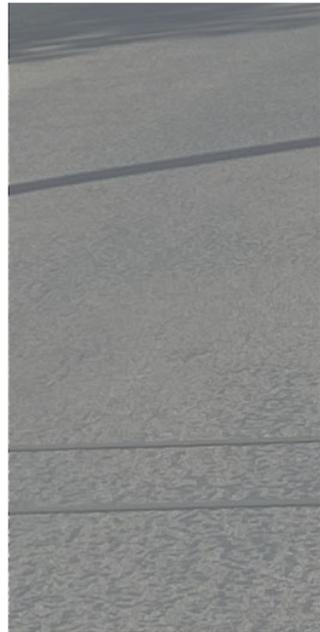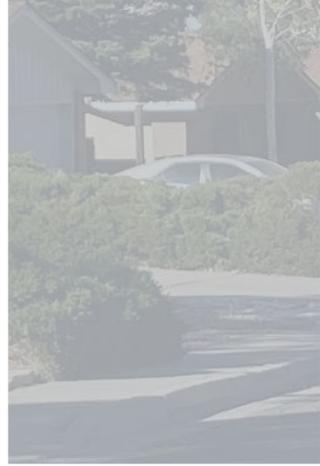

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109
phone: 505-348-4000
fax: 505-348-4055

www.wilsonco.com

