



March 2021

CITY OF ALBUQUERQUE
**DESERT SPRINGS DR -
SPRING FLOWER RD TO DESERT CANYON PL
SPEED STUDY**

NTMP P803000
TASK 28.3

City of Albuquerque

Desert Springs Drive

SPEED STUDY

NTMP P803000

NTP #28.3

WCI 1810002228

March 2021



Table of Contents

Tables	1
Introduction	1
Project Area and Background	1
Existing Conditions	2
Traffic Conditions	2
Safety	2
Crash Data	2
Crash Analysis	2
Speed	3
Typical Sections	3
NTMP Traffic Calming Criteria	4
Summary of Results	5
Recommendations	6

Figures

Figure 1: Project Area and Existing Traffic Volumes	1
Figure 2: Desert Springs Drive Speed Limit	3
Figure 3: Desert Springs Drive looking North	3
Figure 4: Desert Springs Drive looking South	4
Figure 5: Desert Springs Drive Existing Typical Section	4

Tables

Table 1: Crash Summary	2
Table 2: Percentage of Vehicles Exceeding Speed Limit	3
Table 3: Summary of Results	5

Appendices

- Appendix A – Traffic Data
- Appendix B – Crash Reports

Introduction

This report documents the speed study analysis on Desert Springs Drive from Spring Flower Road to Desert Canyon Place in Albuquerque, New Mexico. The purpose of this project is to collect and analyze the traffic volumes, speed, and safety of Desert Springs Drive, a two-way street, from Spring Flower Road to Desert Canyon Place to determine if it meets the traffic calming criterion described in the *City of Albuquerque (COA) Neighborhood Traffic Management Program (NTMP)*, October 2020, and the *Institute of Transportation Engineers (ITE) Traffic Engineering Handbook*, 6th Edition.

Project Area and Background

The Desert Springs Drive project is located in Albuquerque, New Mexico and is a two-lane, undivided local road that runs north-south between Spring Flower Road and Desert Canyon Place. Spring Flower Road is a two-lane, undivided local road that runs east-west and intersects the south end of Desert Springs Drive at a T-intersection. Desert Canyon Place is a two-lane, undivided local road that runs east-west and intersects the north end of Desert Springs at a four-way stop-controlled intersection. See **Figure 1** for a map of the project area.

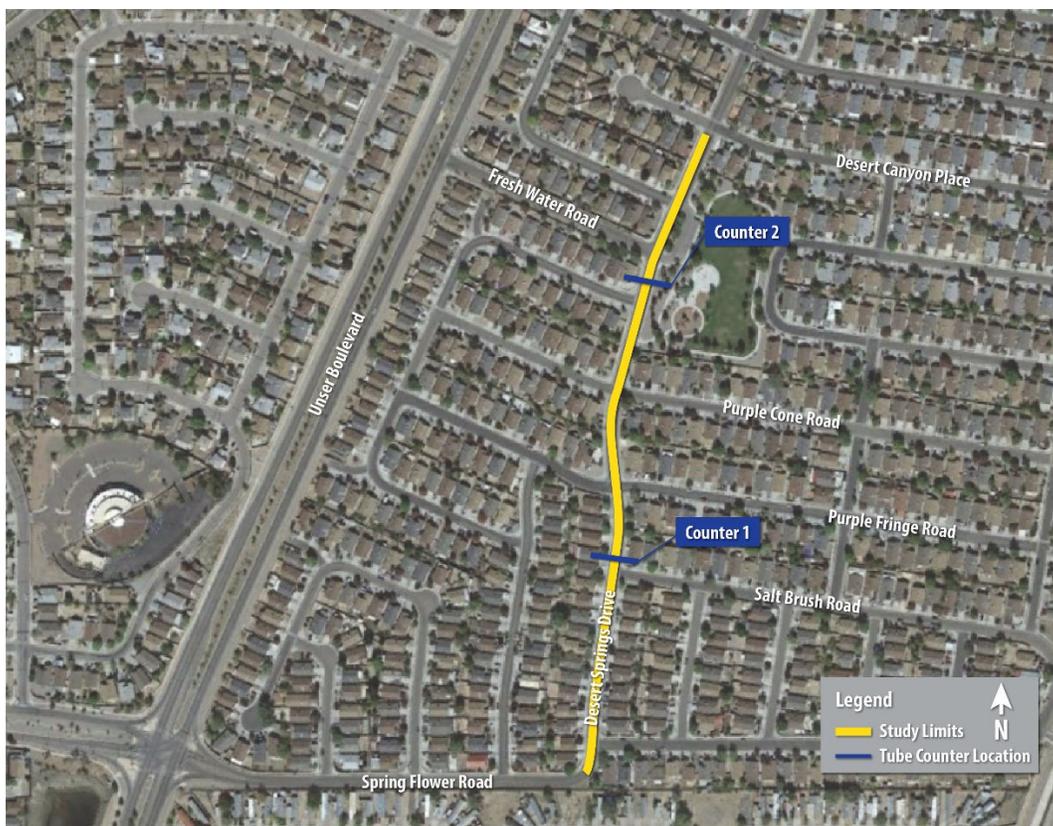


Figure 1: Project Area and Existing Traffic Volumes

A request has been made to the City of Albuquerque to determine if traffic calming is appropriate for this location. Wilson & Company was tasked by the City of Albuquerque to determine if Desert Springs Drive warrants traffic calming measures.

Existing Conditions

Traffic Conditions

Existing tube count data (volume, speed, and class) was collected for 48-hours on Wednesday, November 4, 2020 and Thursday, November 5, 2020. Desert Springs Drive is an urban local road with an Average Daily Traffic (ADT) of 1,607 vehicles and an existing speed limit of 25 mph. The full traffic count data can be found in [Appendix A](#).

Safety

Crash Data

Historical crash data was provided by the City of Albuquerque. Five years of crash data (2013-2017) were obtained to evaluate the existing safety condition of Desert Springs Drive. See [Table 1](#) for crash summary.

Table 1: Crash Summary

Crash Date	Crash Intersecting Street	Crash Primary Street	Crash Analysis	Severity	Contributing Factors	Crash Correct with Traffic Calming
1/13/2013	Purple Cone Road SW	Desert Springs Drive SW	Intersection - From Same Direction/One Left Turn	Injury Crash	Failed to Yield Right of Way	No
2/18/2014	Desert Springs Drive SW	Desert Springs Drive SW	Parked Vehicle - Unknown/Not Stated	Property Damage	Missing Data	No
4/16/2017	Desert Canyon Place SW	Desert Springs Drive SW	Fixed Object - Median Raised or Curb	Injury Crash	Alcohol/Drug Involved	No
8/14/2017	April Flowers Drive SW	Desert Springs Drive SW	Other Vehicle - From Opposite Direction	Property Damage	Passed Stop Sign	No
8/20/2017	Saltbrush Road SW	Desert Springs Drive SW	Vehicle Parked in Proper Location	Injury Crash	Excessive Speed	Yes

Crash Analysis

The following observations were concluded from the review of the five years (2013-2017) of crash data (five total crashes). See [Appendix B](#) for crash reports.

- Out of the total, four crashes occurred in clear conditions while one crash (2/18/2014) was left blank on the crash report.
- Out of the total crashes, two crashes resulted in property damage and three crashes resulted in property damage.
- Two of the six crashes occurred during the day and one in dark-lighted conditions.
- One crash on Desert Springs Drive that occurred on 8/20/2017 involved excessive speed.

Speed

Speed data was collected on Desert Springs Drive for a 48-hour period on Wednesday, November 4, 2020 and Thursday, November 5, 2020. See [Table 2](#) for the percentage of vehicles exceeding the speed limit by 5 mph and 7 mph.

Table 2: Percentage of Vehicles Exceeding Speed Limit

Location	Percentage of Vehicles Exceeding Speed Limit			
	November 4, 2020		November 5, 2020	
	Counter 1	Counter 2	Counter 1	Counter 2
5 mph	1%	27%	1%	25%
7 mph	1%	15%	0%	14%

Speed data can be found in the traffic counts located in [Appendix A](#). At least 1% of vehicle speeds exceed the posted speed limit (25 mph) by 5 mph or more at Counter 1 and 25% at Counter 2. For Counter 1, 1% of vehicle speeds exceed the posted speed limit (25 mph) by 7 mph or more and 15% at Counter 2.



Figure 2: Desert Springs Drive Speed Limit

Typical Sections

Desert Springs Drive is a 28-ft wide roadway with a 4-ft to 5-ft wide buffers, curb and gutter, and 4-ft to 5-ft wide sidewalks. See [Figure 3](#) and [Figure 4](#) for photos of the existing roadway, and [Figure 5](#) for the existing Desert Springs Drive typical section.



Figure 3: Desert Springs Drive looking North



Figure 4: Desert Springs Drive looking South

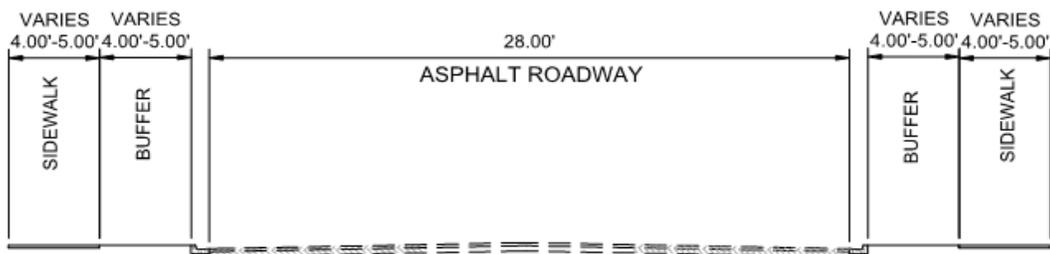


Figure 5: Desert Springs Drive Existing Typical Section

NTMP Traffic Calming Criteria

In order to meet the traffic calming criterion described in the *COA NTMP*, one or more of the following threshold criteria must be met:

1. Over a twenty-four-hour period, 15% of the vehicles traveling in the study area exceeded 7 miles per hour over the speed limit.
2. Three reported crashes in a 5-year period where the police report identified speed as either a primary or contributing cause of the crash.
3. A crash involving a pedestrian or cyclist in a school zone in a five-year period.

Task 28.3: Desert Springs Drive

4. Over a twenty-four-hour period more than 800 vehicles were counted traveling through the study area and 15% of the vehicles traveling in the study area exceeded 5 miles per hour over the speed limit.
5. Over a twenty-four-hour period, 15% of the vehicles traveling in the study area exceeded 5 miles per hour over the speed limit and there was at least one reported crash in a 5-year period where the police report identified speed as either a primary or contributing cause of the crash.
6. Over a twenty-four-hour period, 15% of the vehicles traveling in the study area exceeded 5 miles per hour over the speed limit and a field survey conducted by the Traffic Engineering Division determined that 25% of the peak hour traffic was cut-through traffic.
7. Over a twenty-four-hour period more than 800 vehicles were counted traveling through the study area and there was at least one reported crash in a 5-year period where the police report identified speed as either a primary or contributing cause of the crash.
8. Over a twenty-four-hour period more than 800 vehicles were counted traveling through the study area and a field survey conducted by the Traffic Engineering Division determined that 25% of the peak hour traffic was cut-through traffic.
9. A field survey conducted by the Traffic Engineering Division determined that 25% of the peak hour traffic was cut-through traffic and there was at least one reported crash in 5 years where the police report identified speed as either a primary or contributing cause of the crash.

Summary of Results

Out of the five crashes that were reported in the past five years, one (1) could possibly have been corrected with traffic calming. The daily traffic volumes for Desert Springs Drive were more than 800 vehicles. Over 15% of vehicle speeds exceeded the posted speed limit by 5 mph and by 7 mph. See [Table 3](#) for the summary of results for Desert Springs Drive.

Table 3: Summary of Results

Criteria	Threshold								
	1	2	3	4	5	6	7	8	9
15% of vehicles speeds > 7 mph over posted speed limit	X								
15% of vehicles speeds > 5 mph over posted speed limit				X	X	X			
3 reported crashes with speed as primary or contributing factor									
1 reported crashes with speed as primary or contributing factor					X		X		X
Pedestrian or cyclist involved crash									
More than 800 vehicles daily				X			X	X	
25% cut-through traffic									
Meets Threshold	Yes	No	No	Yes	Yes	No	Yes	No	No

	Threshold Criteria
X	Meets Criteria

Recommendations

After analyzing the crash, volume, and speed data, it was determined that Desert Springs Drive does meet four of the nine (9) thresholds and, therefore, **does** meet the minimum traffic calming criterion as described in the *COA NTMP*.

Appendix A – Traffic Data



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Desert Springs Counter

#1 11-3-2020

Date Printed: 11/9/2020

Start Date: 11/4/2020

End Date: 11/5/2020

GPS Accuracy: 0 ft

Location Verified: No

Location 1:
Location 2:
Latitude: 35.045830
Longitude: -106.721898

11/4/2020 South, A to B North, B to A			
Time			Total
12:00 AM	5	4	9
1:00	1	1	2
2:00	1	3	4
3:00	2	2	4
4:00	3	5	8
5:00	5	11	16
6:00	17	33	50
7:00	23	24	47
8:00	20	32	52
9:00	19	21	40
10:00	18	29	47
11:00	22	22	44
12:00 PM	36	35	71
1:00	29	35	64
2:00	26	25	51
3:00	43	42	85
4:00	51	40	91
5:00	61	55	116
6:00	59	45	104
7:00	35	37	72
8:00	33	19	52
9:00	23	13	36
10:00	15	12	27
11:00	6	14	20
Total	553	559	1112
Percent	49.7%	50.3%	
AM Peak	12:00 PM	12:00 PM	12:00 PM
Volume	36	35	71
PM Peak	5:00	5:00	5:00
Volume	61	55	116



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Desert Springs Counter

#1 11-3-2020

Date Printed: 11/9/2020

Start Date: 11/4/2020

End Date: 11/5/2020

GPS Accuracy: 0 ft

Location Verified: No

Location 1:
Location 2:
Latitude: 35.045830
Longitude: -106.721898

11/5/2020 South, A to B North, B to A			
Time			Total
12:00 AM	3	3	6
1:00	1	2	3
2:00	2	8	10
3:00	4	2	6
4:00	3	5	8
5:00	8	16	24
6:00	13	26	39
7:00	20	41	61
8:00	17	29	46
9:00	16	19	35
10:00	18	27	45
11:00	26	23	49
12:00 PM	28	27	55
1:00	28	32	60
2:00	33	32	65
3:00	55	53	108
4:00	60	55	115
5:00	63	48	111
6:00	61	55	116
7:00	45	41	86
8:00	32	25	57
9:00	12	18	30
10:00	19	14	33
11:00	4	10	14
Total	571	611	1182
Percent	48.3%	51.7%	
AM Peak	12:00 PM	7:00	7:00
Volume	28	41	61
PM Peak	5:00	4:00	6:00
Volume	63	55	116
Grand Total	1124	1170	2294
Percent	49.0%	51.0%	
ADT	ADT: 1,147	ADT: 1,147	AADT: 1,147




WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Desert Springs Counter
#1 11-3-2020
Date Printed: 11/9/2020
Start Date: 11/4/2020
End Date: 11/5/2020
GPS Accuracy: 0 ft
Location Verified: No

Location 1:
Location 2:
Latitude: 35.045830
Longitude: -106.721898

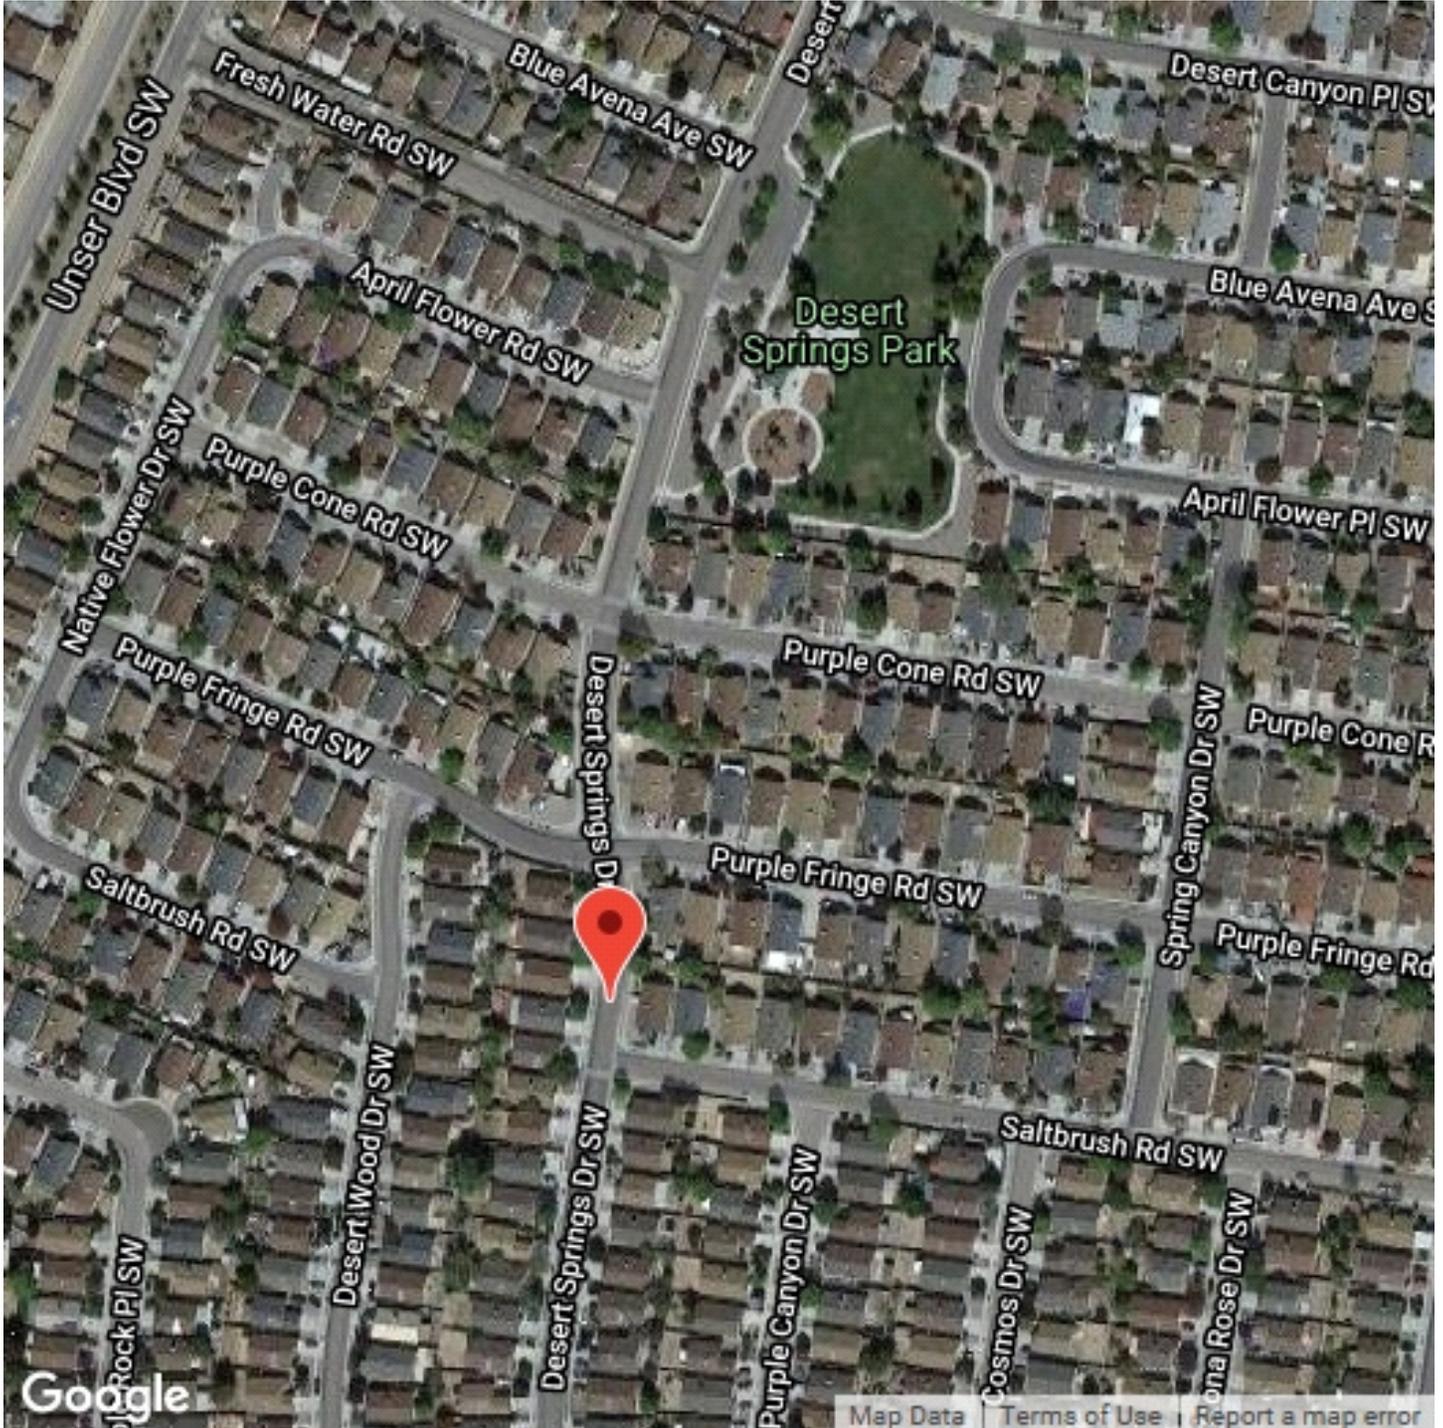



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Desert Springs Counter
#1 11-3-2020

Date Printed: 11/9/2020

Start Date: 11/4/2020

End Date: 11/5/2020

GPS Accuracy: 0 ft

Location Verified: No

Latitude: 35.045830

Longitude: -106.721898

Direction: South, A to B

11/4/2020	0 - 15	> 15 -	> 20 -	> 25 -	> 30 -	> 35 -	> 40 -	> 45 -	> 50 -	> 55 -	> 60 -	> 65 -	> 70	Total
Time	MPH	20 MPH	25 MPH	30 MPH	35 MPH	40 MPH	45 MPH	50 MPH	55 MPH	60 MPH	65 MPH	70 MPH	MPH	
12:00 AM	2	0	1	1	1	0	0	0	0	0	0	0	0	5
1:00	1	0	0	0	0	0	0	0	0	0	0	0	0	1
2:00	0	0	1	0	0	0	0	0	0	0	0	0	0	1
3:00	0	2	0	0	0	0	0	0	0	0	0	0	0	2
4:00	0	1	1	1	0	0	0	0	0	0	0	0	0	3
5:00	1	3	1	0	0	0	0	0	0	0	0	0	0	5
6:00	2	2	8	3	1	1	0	0	0	0	0	0	0	17
7:00	3	8	7	5	0	0	0	0	0	0	0	0	0	23
8:00	0	4	8	7	1	0	0	0	0	0	0	0	0	20
9:00	1	3	9	6	0	0	0	0	0	0	0	0	0	19
10:00	3	5	6	4	0	0	0	0	0	0	0	0	0	18
11:00	5	9	3	5	0	0	0	0	0	0	0	0	0	22
12:00 PM	5	11	20	0	0	0	0	0	0	0	0	0	0	36
1:00	1	12	9	7	0	0	0	0	0	0	0	0	0	29
2:00	1	10	9	6	0	0	0	0	0	0	0	0	0	26
3:00	6	12	19	6	0	0	0	0	0	0	0	0	0	43
4:00	8	23	14	5	1	0	0	0	0	0	0	0	0	51
5:00	22	17	18	4	0	0	0	0	0	0	0	0	0	61
6:00	10	19	23	6	1	0	0	0	0	0	0	0	0	59
7:00	7	7	14	6	1	0	0	0	0	0	0	0	0	35
8:00	3	13	14	3	0	0	0	0	0	0	0	0	0	33
9:00	5	11	3	3	0	1	0	0	0	0	0	0	0	23
10:00	1	6	7	1	0	0	0	0	0	0	0	0	0	15
11:00	0	4	2	0	0	0	0	0	0	0	0	0	0	6
Total	87	182	197	79	6	2	0	0	0	0	0	0	0	553



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Desert Springs Counter

#1 11-3-2020

Date Printed: 11/9/2020

Start Date: 11/4/2020

End Date: 11/5/2020

GPS Accuracy: 0 ft

Location Verified: No

Latitude: 35.045830
Longitude: -106.721898
Direction: South, A to B

11/5/2020	0 - 15	> 15 -	> 20 -	> 25 -	> 30 -	> 35 -	> 40 -	> 45 -	> 50 -	> 55 -	> 60 -	> 65 -	> 70	Total
Time	MPH	20 MPH	25 MPH	30 MPH	35 MPH	40 MPH	45 MPH	50 MPH	55 MPH	60 MPH	65 MPH	70 MPH	MPH	
12:00 AM	0	0	1	2	0	0	0	0	0	0	0	0	0	3
1:00	0	1	0	0	0	0	0	0	0	0	0	0	0	1
2:00	0	1	1	0	0	0	0	0	0	0	0	0	0	2
3:00	1	2	1	0	0	0	0	0	0	0	0	0	0	4
4:00	0	2	0	1	0	0	0	0	0	0	0	0	0	3
5:00	0	4	3	1	0	0	0	0	0	0	0	0	0	8
6:00	1	6	3	3	0	0	0	0	0	0	0	0	0	13
7:00	3	4	10	3	0	0	0	0	0	0	0	0	0	20
8:00	5	5	5	2	0	0	0	0	0	0	0	0	0	17
9:00	2	3	5	6	0	0	0	0	0	0	0	0	0	16
10:00	3	3	10	2	0	0	0	0	0	0	0	0	0	18
11:00	5	9	8	3	1	0	0	0	0	0	0	0	0	26
12:00 PM	2	12	9	5	0	0	0	0	0	0	0	0	0	28
1:00	5	9	11	2	1	0	0	0	0	0	0	0	0	28
2:00	3	12	10	8	0	0	0	0	0	0	0	0	0	33
3:00	6	22	21	5	1	0	0	0	0	0	0	0	0	55
4:00	15	24	16	4	1	0	0	0	0	0	0	0	0	60
5:00	9	28	16	9	1	0	0	0	0	0	0	0	0	63
6:00	13	21	21	5	1	0	0	0	0	0	0	0	0	61
7:00	5	11	21	8	0	0	0	0	0	0	0	0	0	45
8:00	4	8	15	5	0	0	0	0	0	0	0	0	0	32
9:00	3	4	5	0	0	0	0	0	0	0	0	0	0	12
10:00	3	7	7	2	0	0	0	0	0	0	0	0	0	19
11:00	1	1	2	0	0	0	0	0	0	0	0	0	0	4
Total	89	199	201	76	6	0	571							
Grand Total	176	381	398	155	12	2	0	1124						

Stats	Percentile	15th	50th	85th	95th
Speed		14.8	20	24.9	27.3
Mean Speed (Average)		21.5			
10 MPH Pace Speed		15-24			
Number in Pace		771			
Percent in Pace		81.0%			
Number > 25 MPH		169			
Percent > 25 MPH		17.8%			



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Desert Springs Counter

#1 11-3-2020

Date Printed: 11/9/2020

Start Date: 11/4/2020

End Date: 11/5/2020

GPS Accuracy: 0 ft

Location Verified: No

Latitude: 35.045830

Longitude: -106.721898

Direction: North, B to A

11/4/2020	0 - 15	> 15 -	> 20 -	> 25 -	> 30 -	> 35 -	> 40 -	> 45 -	> 50 -	> 55 -	> 60 -	> 65 -	> 70	Total
Time	MPH	20 MPH	25 MPH	30 MPH	35 MPH	40 MPH	45 MPH	50 MPH	55 MPH	60 MPH	65 MPH	70 MPH	MPH	
12:00 AM	2	1	1	0	0	0	0	0	0	0	0	0	0	4
1:00	0	1	0	0	0	0	0	0	0	0	0	0	0	1
2:00	2	0	1	0	0	0	0	0	0	0	0	0	0	3
3:00	2	0	0	0	0	0	0	0	0	0	0	0	0	2
4:00	2	1	2	0	0	0	0	0	0	0	0	0	0	5
5:00	3	3	3	2	0	0	0	0	0	0	0	0	0	11
6:00	13	5	10	4	1	0	0	0	0	0	0	0	0	33
7:00	11	5	5	3	0	0	0	0	0	0	0	0	0	24
8:00	13	3	8	5	1	2	0	0	0	0	0	0	0	32
9:00	5	6	5	5	0	0	0	0	0	0	0	0	0	21
10:00	8	7	10	4	0	0	0	0	0	0	0	0	0	29
11:00	7	5	6	4	0	0	0	0	0	0	0	0	0	22
12:00 PM	9	12	10	4	0	0	0	0	0	0	0	0	0	35
1:00	7	3	21	4	0	0	0	0	0	0	0	0	0	35
2:00	6	6	13	0	0	0	0	0	0	0	0	0	0	25
3:00	11	15	12	4	0	0	0	0	0	0	0	0	0	42
4:00	11	12	12	5	0	0	0	0	0	0	0	0	0	40
5:00	15	15	23	2	0	0	0	0	0	0	0	0	0	55
6:00	13	17	12	2	1	0	0	0	0	0	0	0	0	45
7:00	11	10	9	7	0	0	0	0	0	0	0	0	0	37
8:00	3	5	7	3	1	0	0	0	0	0	0	0	0	19
9:00	2	7	2	2	0	0	0	0	0	0	0	0	0	13
10:00	2	4	4	1	1	0	0	0	0	0	0	0	0	12
11:00	2	8	4	0	0	0	0	0	0	0	0	0	0	14
Total	160	151	180	61	5	2	0	0	0	0	0	0	0	559



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Desert Springs Counter

#1 11-3-2020

Date Printed: 11/9/2020

Start Date: 11/4/2020

End Date: 11/5/2020

GPS Accuracy: 0 ft

Location Verified: No

Latitude: 35.045830
Longitude: -106.721898
Direction: North, B to A

11/5/2020	0 - 15	> 15 -	> 20 -	> 25 -	> 30 -	> 35 -	> 40 -	> 45 -	> 50 -	> 55 -	> 60 -	> 65 -	> 70	Total
Time	MPH	20 MPH	25 MPH	30 MPH	35 MPH	40 MPH	45 MPH	50 MPH	55 MPH	60 MPH	65 MPH	70 MPH	MPH	
12:00 AM	1	1	0	1	0	0	0	0	0	0	0	0	0	3
1:00	1	0	1	0	0	0	0	0	0	0	0	0	0	2
2:00	4	2	2	0	0	0	0	0	0	0	0	0	0	8
3:00	0	1	1	0	0	0	0	0	0	0	0	0	0	2
4:00	2	0	2	1	0	0	0	0	0	0	0	0	0	5
5:00	6	4	5	1	0	0	0	0	0	0	0	0	0	16
6:00	8	7	7	4	0	0	0	0	0	0	0	0	0	26
7:00	21	8	7	5	0	0	0	0	0	0	0	0	0	41
8:00	13	8	6	2	0	0	0	0	0	0	0	0	0	29
9:00	4	5	7	3	0	0	0	0	0	0	0	0	0	19
10:00	9	7	10	1	0	0	0	0	0	0	0	0	0	27
11:00	6	7	6	4	0	0	0	0	0	0	0	0	0	23
12:00 PM	4	11	8	4	0	0	0	0	0	0	0	0	0	27
1:00	12	8	9	3	0	0	0	0	0	0	0	0	0	32
2:00	6	13	10	2	1	0	0	0	0	0	0	0	0	32
3:00	13	14	19	7	0	0	0	0	0	0	0	0	0	53
4:00	13	21	16	4	1	0	0	0	0	0	0	0	0	55
5:00	6	18	21	3	0	0	0	0	0	0	0	0	0	48
6:00	14	19	18	4	0	0	0	0	0	0	0	0	0	55
7:00	8	16	11	5	1	0	0	0	0	0	0	0	0	41
8:00	9	2	13	1	0	0	0	0	0	0	0	0	0	25
9:00	3	10	4	1	0	0	0	0	0	0	0	0	0	18
10:00	3	4	6	1	0	0	0	0	0	0	0	0	0	14
11:00	0	3	4	3	0	0	0	0	0	0	0	0	0	10
Total	166	189	193	60	3	0	0	0	0	0	0	0	0	611
Grand Total	326	340	373	121	8	2	0	0	0	0	0	0	0	1170

Stats	Percentile	15th	50th	85th	95th
Speed		13.2	19	24.2	26.6
Mean Speed (Average)		21.4			
10 MPH Pace Speed		15-24			
Number in Pace		706			
Percent in Pace		84.0%			
Number > 25 MPH		131			
Percent > 25 MPH		15.5%			




WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Desert Springs Counter
#1 11-3-2020
Date Printed: 11/9/2020
Start Date: 11/4/2020
End Date: 11/5/2020
GPS Accuracy: 0 ft
Location Verified: No

Latitude: 35.045830
Longitude: -106.721898

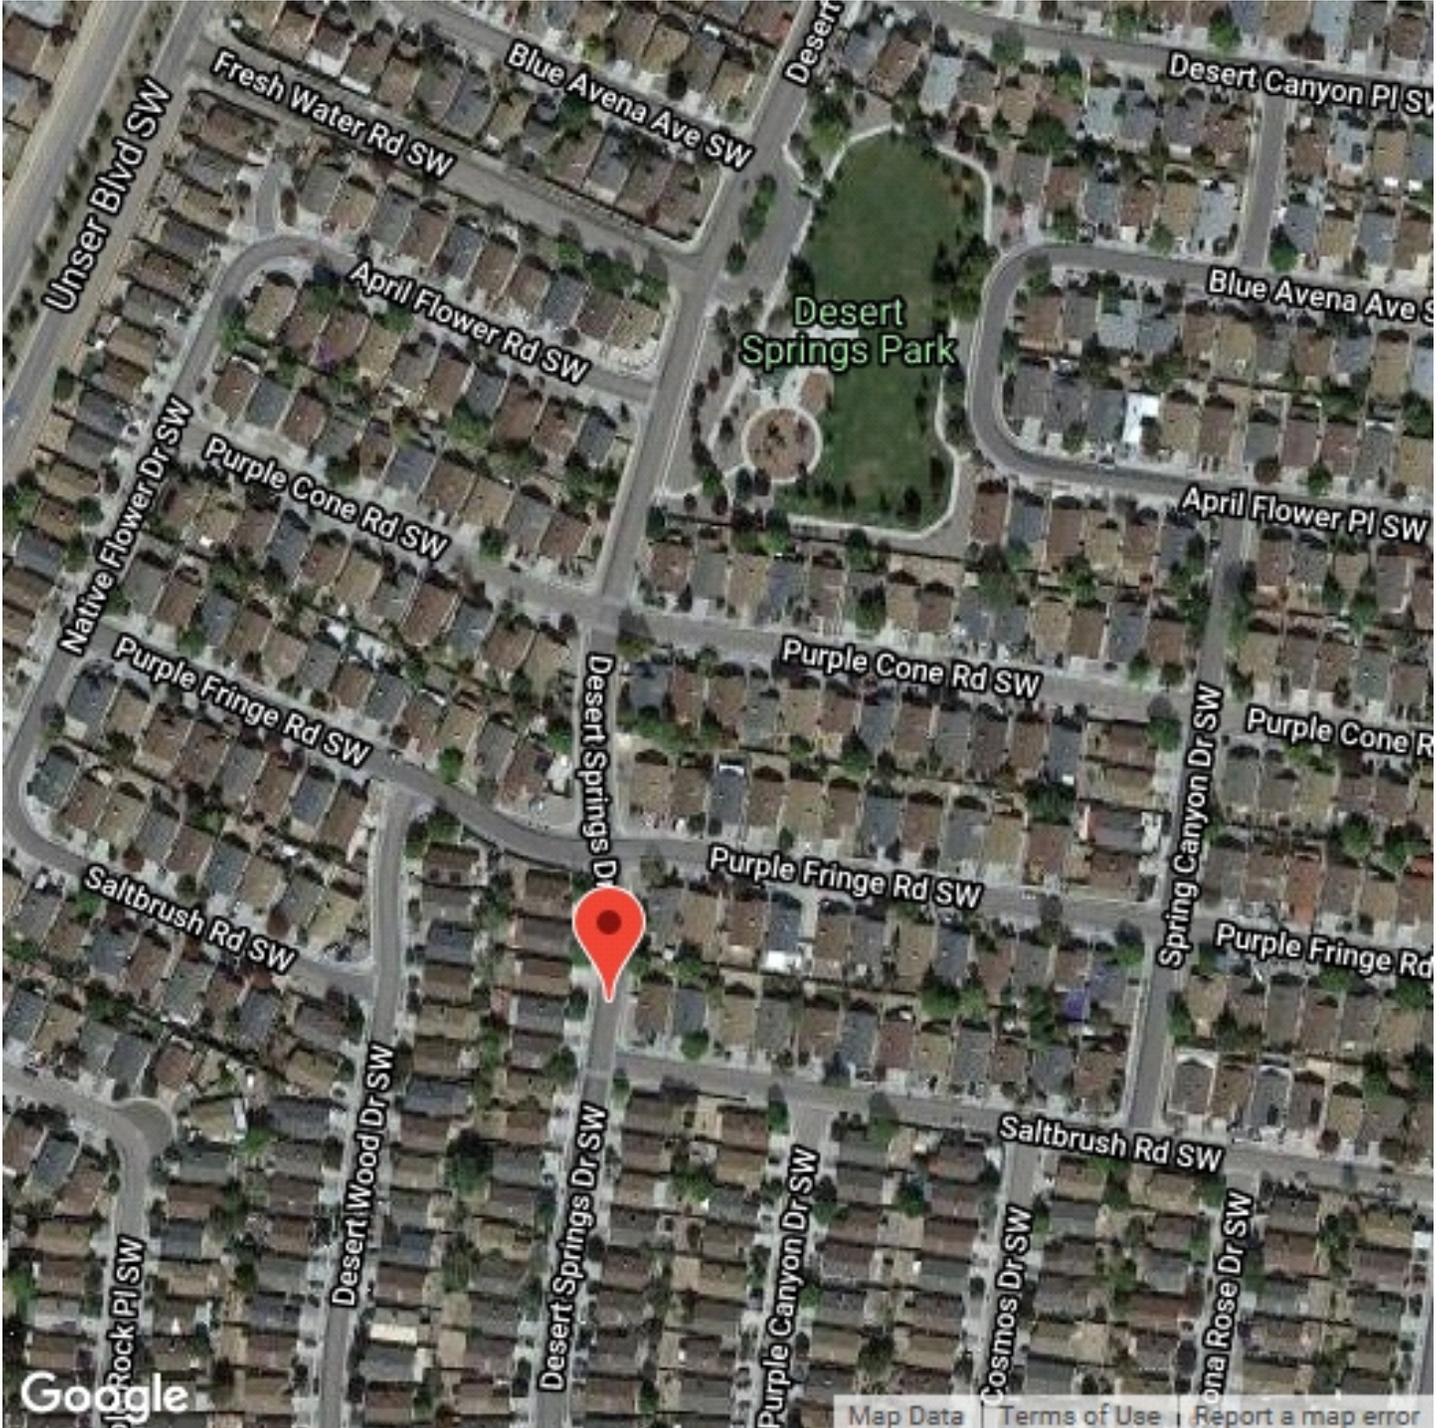



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

Speed Enforcement Evaluator

Analysis Dates


Start: 11/4/2020

End: 11/4/2020

Total Percentage of Enforceable Violations


Posted Speed Limit 25 MPH

Enforcement Tolerance 5 MPH

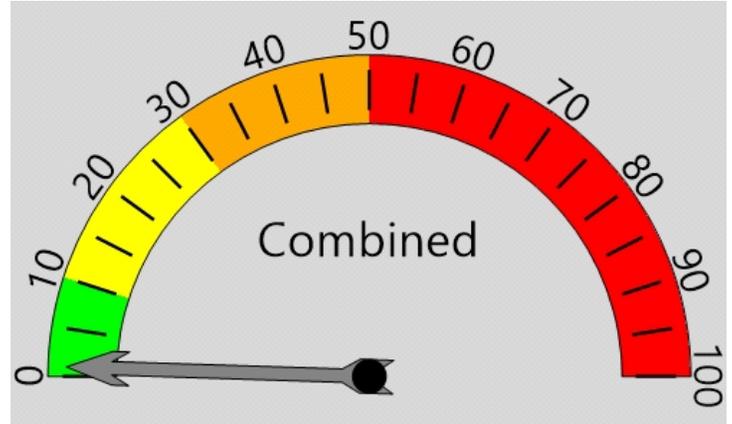


Percent Speeding: 1%

Rating: Low

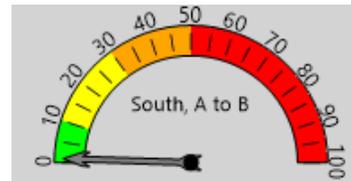

Percent Speeding: 1%

Rating: Low

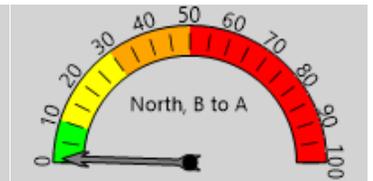

Percent Speeding: 1%

Rating: Low

Vehicle Totals - Combined

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
247	333	377	140	11	4	0	0	0	0	0	0	0

85th Percentile: 24.7

Vehicle Totals - South, A to B

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
87	182	197	79	6	2	0	0	0	0	0	0	0

85th Percentile: 25

Vehicle Totals - North, B to A

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
160	151	180	61	5	2	0	0	0	0	0	0	0

85th Percentile: 24.4



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

Speed Enforcement Evaluator

Analysis Dates


Start: 11/5/2020

End: 11/5/2020

Total Percentage of Enforceable Violations


Posted Speed Limit 25 MPH

Enforcement Tolerance 5 MPH

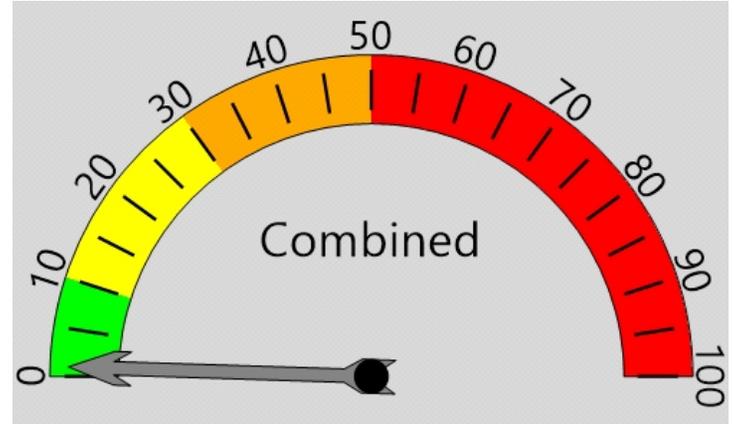


Percent Speeding: 1%

Rating: Low

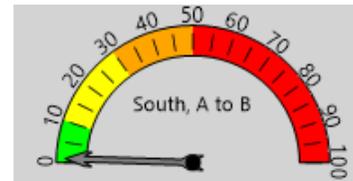

Percent Speeding: 1%

Rating: Low

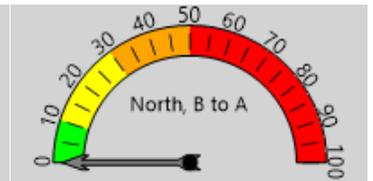

Percent Speeding: 0%

Rating: Low

Vehicle Totals - Combined

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
255	388	394	136	9	0	0	0	0	0	0	0	0

85th Percentile: 24.4

Vehicle Totals - South, A to B

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
89	199	201	76	6	0	0	0	0	0	0	0	0

85th Percentile: 24.8

Vehicle Totals - North, B to A

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
166	189	193	60	3	0	0	0	0	0	0	0	0

85th Percentile: 23.9



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

Speed Enforcement Evaluator

Analysis Dates


Start: 11/4/2020

End: 11/4/2020

Total Percentage of Enforceable Violations


Posted Speed Limit 25 MPH

Enforcement Tolerance 7 MPH

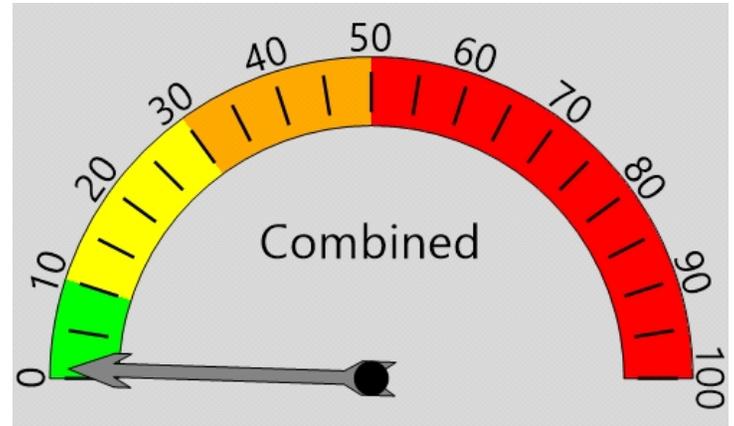


Percent Speeding: 1%

Rating: Low

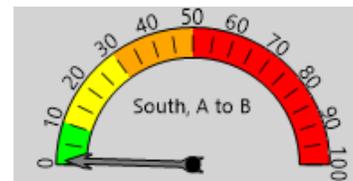

Percent Speeding: 1%

Rating: Low

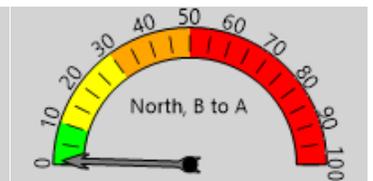

Percent Speeding: 1%

Rating: Low

Vehicle Totals - Combined

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
247	333	377	140	11	4	0	0	0	0	0	0	0
85th Percentile: 24.7												

Vehicle Totals - South, A to B

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
87	182	197	79	6	2	0	0	0	0	0	0	0
85th Percentile: 25												

Vehicle Totals - North, B to A

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
160	151	180	61	5	2	0	0	0	0	0	0	0
85th Percentile: 24.4												



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

Speed Enforcement Evaluator

Analysis Dates


Start: 11/5/2020

End: 11/5/2020

Total Percentage of Enforceable Violations


Posted Speed Limit 25 MPH

Enforcement Tolerance 7 MPH

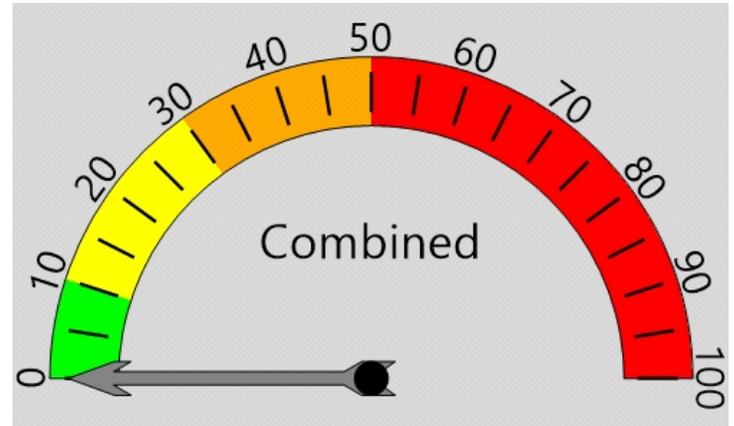


Percent Speeding: 0%

Rating: Low

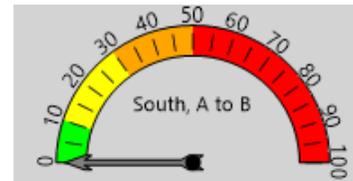

Percent Speeding: 0%

Rating: Low

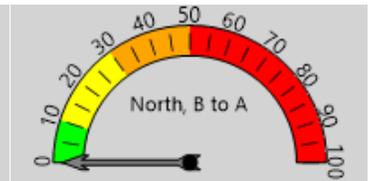

Percent Speeding: 0%

Rating: Low

Vehicle Totals - Combined

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
255	388	394	136	9	0	0	0	0	0	0	0	0

85th Percentile: 24.4

Vehicle Totals - South, A to B

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
89	199	201	76	6	0	0	0	0	0	0	0	0

85th Percentile: 24.8

Vehicle Totals - North, B to A

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
166	189	193	60	3	0	0	0	0	0	0	0	0

85th Percentile: 23.9



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Desert Springs Counter
#1 11-3-2020

Date Printed: 11/9/2020

Start Date: 11/4/2020

End Date: 11/5/2020

GPS Accuracy: 0 ft

Location Verified: No

Latitude: 35.045830

Longitude: -106.721898

Direction: South, A to B

11/4/2020 Time	Motor Cycles	Cars & Trailers	2 Axle Long	Buses	2 Axle 6 Tire	3 Axle Single	4 Axle Single	<5 Axl Double	5 Axle Double	>6 Axl Double	<6 Axl Multi	6 Axle Multi	>6 Axl Multi	No Class	Total
12:00 AM	0	3	2	0	0	0	0	0	0	0	0	0	0	0	5
1:00	0	1	0	0	0	0	0	0	0	0	0	0	0	0	1
2:00	0	1	0	0	0	0	0	0	0	0	0	0	0	0	1
3:00	0	2	0	0	0	0	0	0	0	0	0	0	0	0	2
4:00	0	1	0	0	1	0	0	0	1	0	0	0	0	0	3
5:00	0	0	2	0	2	0	0	0	0	0	0	0	0	1	5
6:00	0	10	4	0	2	0	0	0	0	0	0	0	0	1	17
7:00	0	14	6	0	3	0	0	0	0	0	0	0	0	0	23
8:00	0	10	7	1	2	0	0	0	0	0	0	0	0	0	20
9:00	0	18	1	0	0	0	0	0	0	0	0	0	0	0	19
10:00	0	12	4	0	2	0	0	0	0	0	0	0	0	0	18
11:00	0	16	3	0	2	0	0	0	0	0	0	0	0	1	22
12:00 PM	0	22	7	1	3	0	0	0	0	0	0	0	0	3	36
1:00	0	20	7	0	2	0	0	0	0	0	0	0	0	0	29
2:00	0	18	3	0	4	0	0	1	0	0	0	0	0	0	26
3:00	0	21	17	0	5	0	0	0	0	0	0	0	0	0	43
4:00	0	28	18	0	5	0	0	0	0	0	0	0	0	0	51
5:00	0	41	14	0	4	0	0	1	0	0	0	0	0	1	61
6:00	0	37	14	1	4	1	0	0	0	0	0	0	0	2	59
7:00	1	25	4	0	3	1	0	0	0	0	0	0	0	1	35
8:00	0	22	5	0	4	1	0	0	0	0	0	0	0	1	33
9:00	0	14	4	1	3	0	0	0	0	0	0	0	0	1	23
10:00	0	10	3	0	1	0	0	0	0	0	0	0	0	1	15
11:00	0	3	1	0	0	2	0	0	0	0	0	0	0	0	6
Total	1	349	126	4	52	5	0	2	1	0	0	0	0	13	553
Percent	0.2%	63.1%	22.8%	0.7%	9.4%	0.9%	0.0%	0.4%	0.2%	0.0%	0.0%	0.0%	0.0%	2.4%	
AM Peak		9:00	8:00	8:00	7:00				4:00					5:00	7:00
	*	18	7	1	3	*	*	*	1	*	*	*	*	1	23
PM Peak	7:00	5:00	4:00	12:00	3:00	11:00		2:00						12:00	5:00
				PM										PM	
	1	41	18	1	5	2	*	1	*	*	*	*	*	3	61



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Desert Springs Counter

#1 11-3-2020

Date Printed: 11/9/2020

Start Date: 11/4/2020

End Date: 11/5/2020

GPS Accuracy: 0 ft

Location Verified: No

Latitude: 35.045830

Longitude: -106.721898

Direction: South, A to B

11/5/2020 Time	Motor Cycles	Cars & Trailers	2 Axle Long	Buses	2 Axle 6 Tire	3 Axle Single	4 Axle Single	<5 Axl Double	5 Axle Double	>6 Axl Double	<6 Axl Multi	6 Axle Multi	>6 Axl Multi	No Class	Total
12:00 AM	0	3	0	0	0	0	0	0	0	0	0	0	0	0	3
1:00	0	0	0	0	1	0	0	0	0	0	0	0	0	0	1
2:00	0	2	0	0	0	0	0	0	0	0	0	0	0	0	2
3:00	0	2	1	0	1	0	0	0	0	0	0	0	0	0	4
4:00	0	1	1	0	0	0	0	0	1	0	0	0	0	0	3
5:00	0	4	2	0	2	0	0	0	0	0	0	0	0	0	8
6:00	0	6	6	0	1	0	0	0	0	0	0	0	0	0	13
7:00	0	13	6	0	0	0	0	1	0	0	0	0	0	0	20
8:00	1	7	5	1	2	0	0	0	0	0	0	0	0	1	17
9:00	0	8	7	0	1	0	0	0	0	0	0	0	0	0	16
10:00	0	10	5	0	2	0	0	0	0	0	0	0	0	1	18
11:00	0	13	10	0	3	0	0	0	0	0	0	0	0	0	26
12:00 PM	0	18	4	1	3	2	0	0	0	0	0	0	0	0	28
1:00	0	20	2	0	3	2	0	0	0	0	0	0	0	1	28
2:00	0	23	7	0	3	0	0	0	0	0	0	0	0	0	33
3:00	0	33	17	0	3	2	0	0	0	0	0	0	0	0	55
4:00	0	39	12	0	7	1	0	0	0	0	0	0	0	1	60
5:00	1	42	13	0	4	1	0	0	0	0	0	0	0	2	63
6:00	0	38	12	1	6	1	0	0	0	0	0	0	0	3	61
7:00	0	28	12	0	4	0	0	0	0	0	0	0	0	1	45
8:00	0	17	8	0	4	1	0	0	0	0	0	0	0	2	32
9:00	0	8	3	0	1	0	0	0	0	0	0	0	0	0	12
10:00	0	14	4	0	1	0	0	0	0	0	0	0	0	0	19
11:00	0	2	2	0	0	0	0	0	0	0	0	0	0	0	4
Total	2	351	139	3	52	10	0	1	1	0	0	0	0	12	571
Percent	0.4%	61.5%	24.3%	0.5%	9.1%	1.8%	0.0%	0.2%	0.2%	0.0%	0.0%	0.0%	0.0%	2.1%	
AM Peak	8:00	7:00	11:00	8:00	11:00			7:00	4:00					8:00	11:00
	1	13	10	1	3	*	*	1	1	*	*	*	*	1	26
PM Peak	5:00	5:00	3:00	12:00 PM	4:00	12:00 PM								6:00	5:00
	1	42	17	1	7	2	*	*	*	*	*	*	*	3	63
Grand Total	3	700	265	7	104	15	0	3	2	0	0	0	0	25	1124
Percent	0.3%	62.3%	23.6%	0.6%	9.3%	1.3%	0.0%	0.3%	0.2%	0.0%	0.0%	0.0%	0.0%	2.2%	



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Desert Springs Counter
#1 11-3-2020

Date Printed: 11/9/2020

Start Date: 11/4/2020

End Date: 11/5/2020

GPS Accuracy: 0 ft

Location Verified: No

Latitude: 35.045830

Longitude: -106.721898

Direction: North, B to A

11/4/2020 Time	Motor Cycles	Cars & Trailers	2 Axle Long	Buses	2 Axle 6 Tire	3 Axle Single	4 Axle Single	<5 Axl Double	5 Axle Double	>6 Axl Double	<6 Axl Multi	6 Axle Multi	>6 Axl Multi	No Class	Total
12:00 AM	0	4	0	0	0	0	0	0	0	0	0	0	0	0	4
1:00	0	1	0	0	0	0	0	0	0	0	0	0	0	0	1
2:00	0	2	1	0	0	0	0	0	0	0	0	0	0	0	3
3:00	0	2	0	0	0	0	0	0	0	0	0	0	0	0	2
4:00	1	3	1	0	0	0	0	0	0	0	0	0	0	0	5
5:00	0	6	3	0	0	0	0	0	0	0	0	0	0	2	11
6:00	1	14	10	0	3	1	0	0	0	0	0	0	0	4	33
7:00	0	15	5	0	1	0	0	0	0	0	0	0	0	3	24
8:00	2	23	5	0	1	0	0	0	0	0	0	0	0	1	32
9:00	1	15	3	0	1	0	0	0	0	0	0	0	0	1	21
10:00	0	20	7	0	2	0	0	0	0	0	0	0	0	0	29
11:00	1	16	4	0	1	0	0	0	0	0	0	0	0	0	22
12:00 PM	0	25	6	0	3	0	0	0	0	0	0	0	0	1	35
1:00	0	27	6	0	1	0	0	0	0	0	0	0	0	1	35
2:00	0	18	5	0	1	0	0	0	0	0	0	0	0	1	25
3:00	0	26	13	1	1	0	0	0	0	0	0	0	0	1	42
4:00	1	31	6	0	2	0	0	0	0	0	0	0	0	0	40
5:00	2	34	15	0	3	0	0	0	0	0	0	0	0	1	55
6:00	0	32	12	0	0	0	0	0	0	0	0	0	0	1	45
7:00	0	28	8	0	0	0	0	0	0	0	0	0	0	1	37
8:00	0	17	2	0	0	0	0	0	0	0	0	0	0	0	19
9:00	0	8	5	0	0	0	0	0	0	0	0	0	0	0	13
10:00	0	10	1	0	1	0	0	0	0	0	0	0	0	0	12
11:00	0	6	8	0	0	0	0	0	0	0	0	0	0	0	14
Total	9	383	126	1	21	1	0	0	0	0	0	0	0	18	559
Percent	1.6%	68.5%	22.5%	0.2%	3.8%	0.2%	0.0%	0.0%	0.0%	0.0%	0.0%	0.0%	0.0%	3.2%	
AM Peak	8:00	8:00	6:00		6:00	6:00								6:00	6:00
		2	23	10	*	3	1	*	*	*	*	*	*	4	33
PM Peak	5:00	5:00	5:00	3:00	12:00									12:00	5:00
					PM									PM	
		2	34	15	1	3	*	*	*	*	*	*	*	1	55



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Desert Springs Counter
#1 11-3-2020

Date Printed: 11/9/2020

Start Date: 11/4/2020

End Date: 11/5/2020

GPS Accuracy: 0 ft

Location Verified: No

Latitude: 35.045830

Longitude: -106.721898

Direction: North, B to A

11/5/2020 Time	Motor Cycles	Cars & Trailers	2 Axle Long	Buses	2 Axle 6 Tire	3 Axle Single	4 Axle Single	<5 Axl Double	5 Axle Double	>6 Axl Double	<6 Axl Multi	6 Axle Multi	>6 Axl Multi	No Class	Total
12:00 AM	0	3	0	0	0	0	0	0	0	0	0	0	0	0	3
1:00	0	0	0	0	0	0	0	0	0	0	0	0	0	2	2
2:00	0	6	2	0	0	0	0	0	0	0	0	0	0	0	8
3:00	0	0	1	0	0	0	0	0	0	0	0	0	0	1	2
4:00	0	4	1	0	0	0	0	0	0	0	0	0	0	0	5
5:00	0	5	8	0	1	0	0	0	0	0	0	0	0	2	16
6:00	0	13	6	0	3	0	0	0	0	0	0	0	0	4	26
7:00	0	27	8	0	1	0	0	0	0	0	0	0	0	5	41
8:00	0	20	2	0	1	0	0	0	0	0	0	0	0	6	29
9:00	0	14	4	0	0	0	0	0	0	0	0	0	0	1	19
10:00	0	19	5	0	0	0	0	0	0	0	0	0	0	3	27
11:00	0	16	4	0	1	0	0	0	0	0	0	0	0	2	23
12:00 PM	0	19	4	0	2	0	0	0	0	0	0	0	0	2	27
1:00	1	21	9	0	0	0	0	0	0	0	0	0	0	1	32
2:00	0	23	5	0	1	0	0	0	0	0	0	0	0	3	32
3:00	1	33	16	0	0	0	0	0	0	0	0	0	0	3	53
4:00	0	35	14	0	6	0	0	0	0	0	0	0	0	0	55
5:00	0	35	8	0	1	0	0	1	0	0	0	0	0	3	48
6:00	0	31	21	0	2	0	0	0	0	0	0	0	0	1	55
7:00	1	27	10	1	2	0	0	0	0	0	0	0	0	0	41
8:00	1	16	5	0	2	0	0	0	0	0	0	0	0	1	25
9:00	2	11	4	0	0	0	0	0	0	0	0	0	0	1	18
10:00	1	8	3	0	2	0	0	0	0	0	0	0	0	0	14
11:00	0	6	2	0	1	0	0	0	0	0	0	0	0	1	10
Total	7	392	142	1	26	0	0	1	0	0	0	0	0	42	611
Percent	1.1%	64.2%	23.2%	0.2%	4.3%	0.0%	0.0%	0.2%	0.0%	0.0%	0.0%	0.0%	0.0%	6.9%	
AM Peak		7:00	5:00		6:00									8:00	7:00
	*	27	8	*	3	*	*	*	*	*	*	*	*	6	41
PM Peak	9:00	4:00	6:00	7:00	4:00			5:00						2:00	4:00
	2	35	21	1	6	*	*	1	*	*	*	*	*	3	55
Grand Total	16	775	268	2	47	1	0	1	0	0	0	0	0	60	1170
Percent	1.4%	66.2%	22.9%	0.2%	4.0%	0.1%	0.0%	0.1%	0.0%	0.0%	0.0%	0.0%	0.0%	5.1%	




WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Desert Springs Counter
#1 11-3-2020
Date Printed: 11/9/2020
Start Date: 11/4/2020
End Date: 11/5/2020
GPS Accuracy: 0 ft
Location Verified: No

Latitude: 35.045830
Longitude: -106.721898

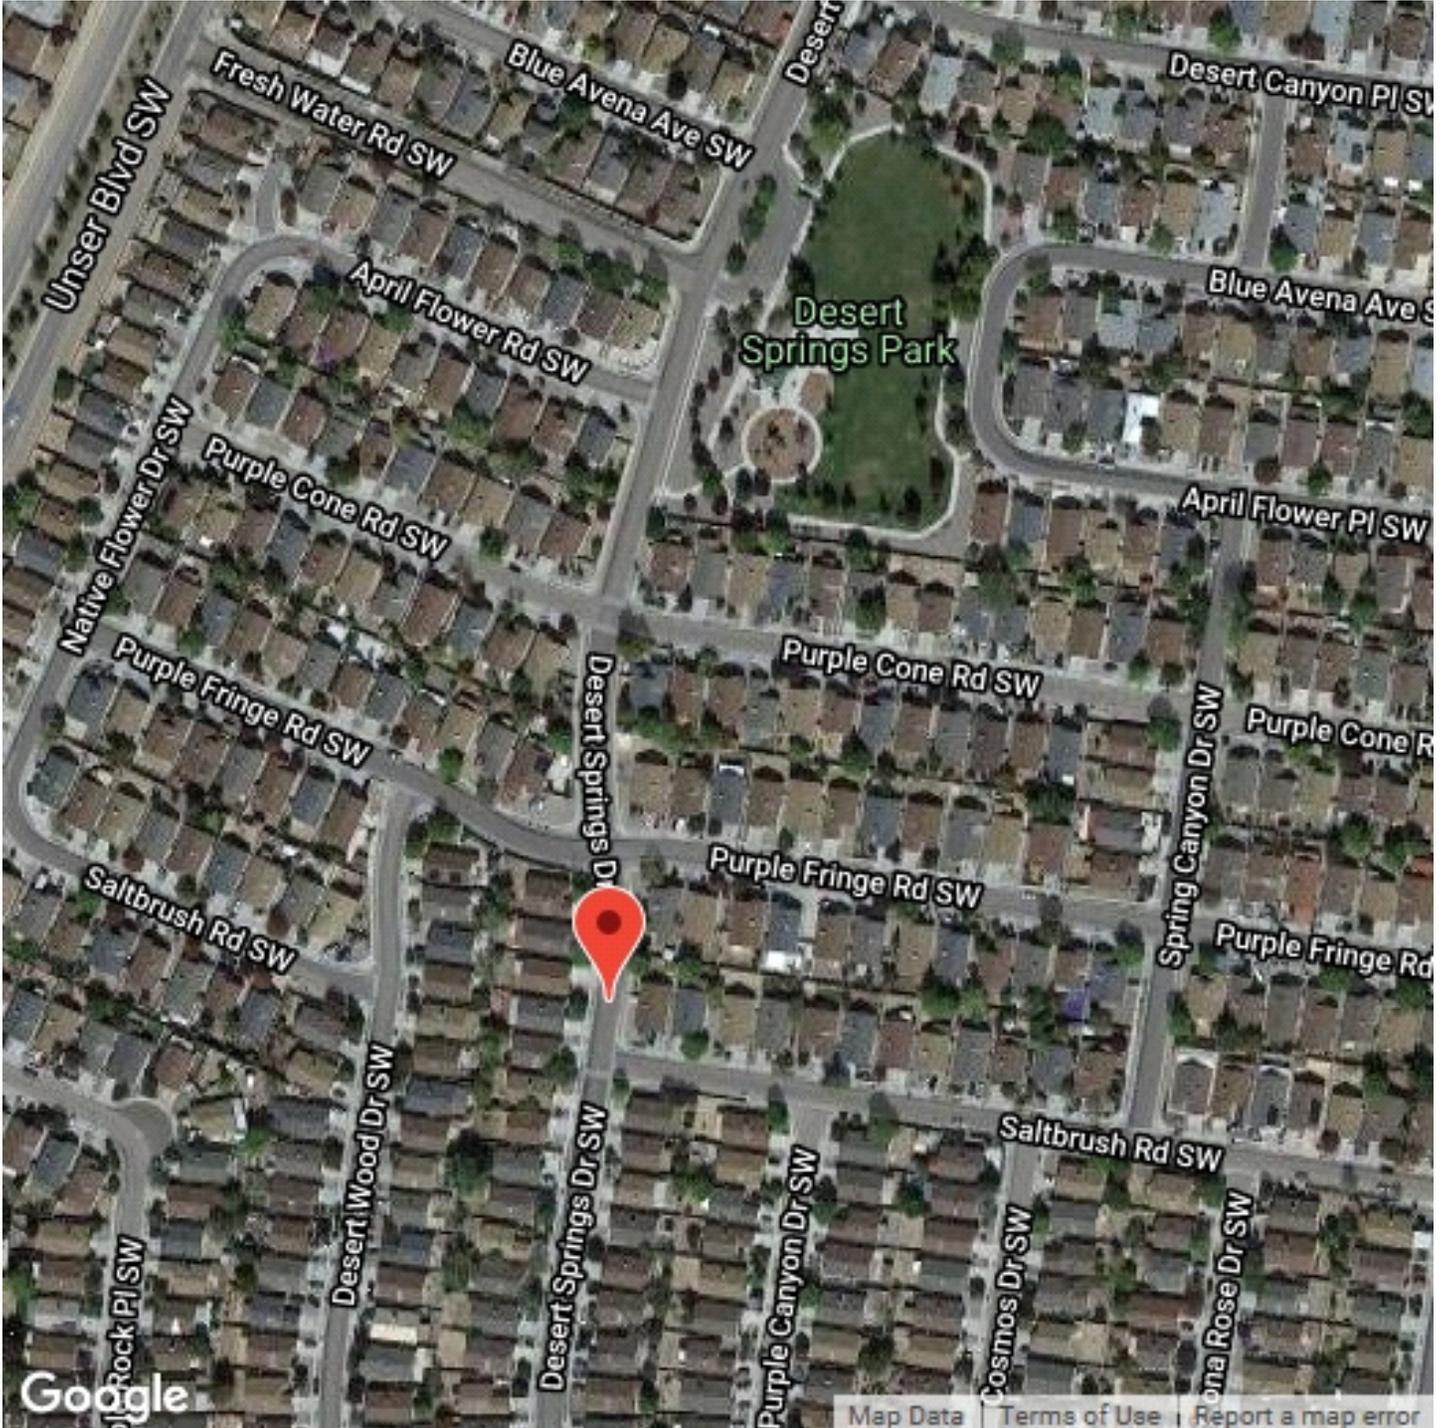



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Desert Springs Counter
#2 11-3-2020

Date Printed: 11/9/2020

Start Date: 11/4/2020

End Date: 11/5/2020

GPS Accuracy: 0 ft

Location Verified: No

Location 1:
Location 2:
Latitude: 35.048308
Longitude: -106.721471

11/4/2020 North, A to B South, B to A			
Time			Total
12:00 AM	6	13	19
1:00	3	3	6
2:00	2	5	7
3:00	4	5	9
4:00	10	3	13
5:00	23	5	28
6:00	43	19	62
7:00	50	39	89
8:00	60	38	98
9:00	35	29	64
10:00	43	33	76
11:00	49	52	101
12:00 PM	51	61	112
1:00	36	63	99
2:00	36	68	104
3:00	53	86	139
4:00	66	141	207
5:00	79	142	221
6:00	61	128	189
7:00	44	72	116
8:00	33	72	105
9:00	31	50	81
10:00	14	32	46
11:00	10	19	29
Total	842	1178	2020
Percent	41.7%	58.3%	
AM Peak	8:00	12:00 PM	12:00 PM
Volume	60	61	112
PM Peak	5:00	5:00	5:00
Volume	79	142	221



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Desert Springs Counter

#2 11-3-2020

Date Printed: 11/9/2020

Start Date: 11/4/2020

End Date: 11/5/2020

GPS Accuracy: 0 ft

Location Verified: No

Location 1:
Location 2:
Latitude: 35.048308
Longitude: -106.721471

11/5/2020 North, A to B South, B to A			
Time			Total
12:00 AM	3	6	9
1:00	1	4	5
2:00	11	3	14
3:00	4	8	12
4:00	7	3	10
5:00	24	6	30
6:00	37	24	61
7:00	59	38	97
8:00	50	38	88
9:00	27	33	60
10:00	32	41	73
11:00	34	51	85
12:00 PM	57	68	125
1:00	47	61	108
2:00	57	83	140
3:00	55	111	166
4:00	70	132	202
5:00	78	140	218
6:00	76	119	195
7:00	67	94	161
8:00	36	71	107
9:00	29	44	73
10:00	20	30	50
11:00	11	15	26
Total	892	1223	2115
Percent	42.2%	57.8%	
AM Peak	7:00	12:00 PM	12:00 PM
Volume	59	68	125
PM Peak	5:00	5:00	5:00
Volume	78	140	218
Grand Total	1734	2401	4135
Percent	41.9%	58.1%	
ADT		ADT: 2,068	AADT: 2,068




WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Desert Springs Counter
#2 11-3-2020
Date Printed: 11/9/2020
Start Date: 11/4/2020
End Date: 11/5/2020
GPS Accuracy: 0 ft
Location Verified: No

Location 1:
Location 2:
Latitude: 35.048308
Longitude: -106.721471

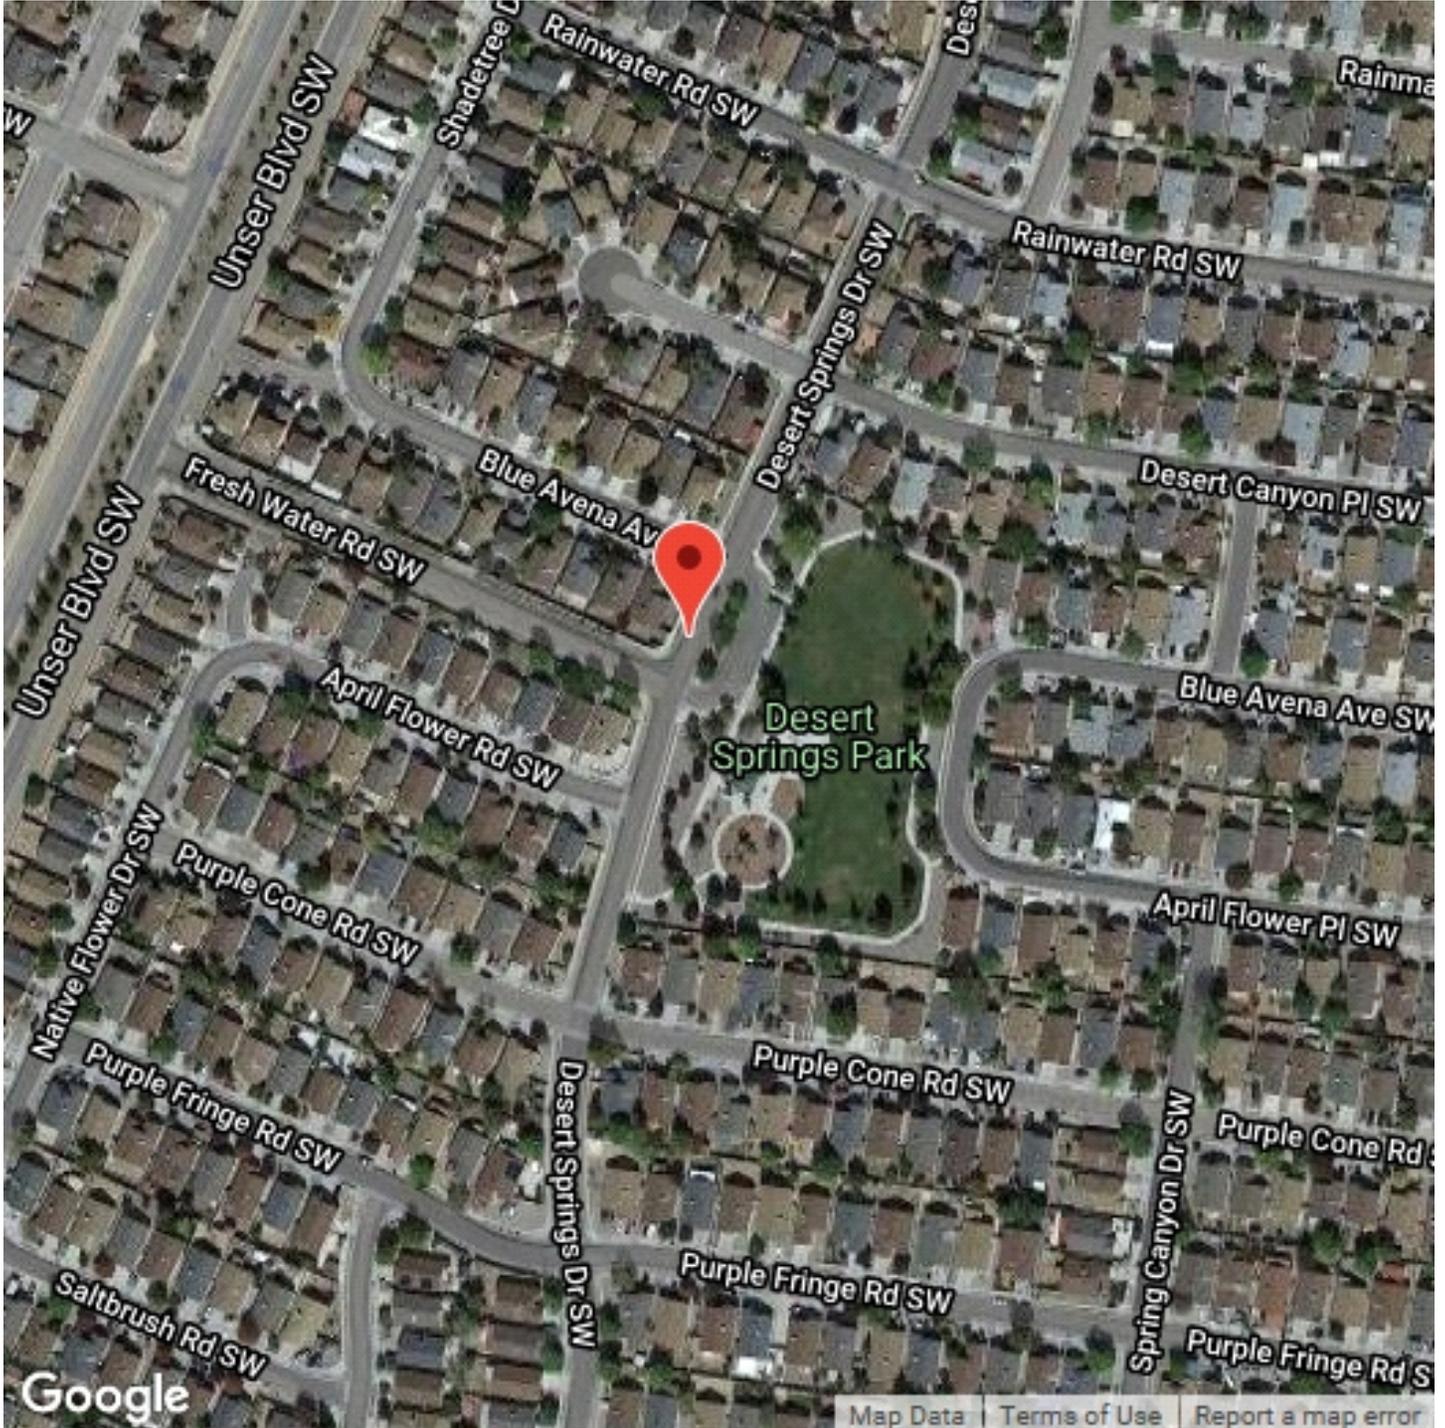



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Desert Springs Counter

#2 11-3-2020

Date Printed: 11/9/2020

Start Date: 11/4/2020

End Date: 11/5/2020

GPS Accuracy: 0 ft

Location Verified: No

Latitude: 35.048308

Longitude: -106.721471

Direction: North, A to B

11/4/2020	0 - 15	> 15 -	> 20 -	> 25 -	> 30 -	> 35 -	> 40 -	> 45 -	> 50 -	> 55 -	> 60 -	> 65 -	> 70	Total
Time	MPH	20 MPH	25 MPH	30 MPH	35 MPH	40 MPH	45 MPH	50 MPH	55 MPH	60 MPH	65 MPH	70 MPH	MPH	
12:00 AM	0	0	2	2	2	0	0	0	0	0	0	0	0	6
1:00	0	0	1	1	1	0	0	0	0	0	0	0	0	3
2:00	0	0	0	0	1	1	0	0	0	0	0	0	0	2
3:00	0	0	2	1	1	0	0	0	0	0	0	0	0	4
4:00	1	1	1	3	2	1	1	0	0	0	0	0	0	10
5:00	0	0	1	10	9	3	0	0	0	0	0	0	0	23
6:00	0	3	3	16	13	7	0	1	0	0	0	0	0	43
7:00	0	2	11	22	13	1	1	0	0	0	0	0	0	50
8:00	1	5	7	21	21	4	1	0	0	0	0	0	0	60
9:00	1	1	4	14	12	3	0	0	0	0	0	0	0	35
10:00	2	6	9	12	11	3	0	0	0	0	0	0	0	43
11:00	1	3	5	19	17	3	1	0	0	0	0	0	0	49
12:00 PM	2	1	11	15	15	5	2	0	0	0	0	0	0	51
1:00	0	3	8	9	10	5	1	0	0	0	0	0	0	36
2:00	1	7	3	14	9	2	0	0	0	0	0	0	0	36
3:00	1	6	10	19	10	5	2	0	0	0	0	0	0	53
4:00	2	8	10	29	14	3	0	0	0	0	0	0	0	66
5:00	4	10	16	30	15	4	0	0	0	0	0	0	0	79
6:00	3	11	11	16	16	4	0	0	0	0	0	0	0	61
7:00	1	4	6	21	10	2	0	0	0	0	0	0	0	44
8:00	0	6	7	12	6	2	0	0	0	0	0	0	0	33
9:00	5	3	5	11	5	1	0	0	1	0	0	0	0	31
10:00	0	3	4	2	3	2	0	0	0	0	0	0	0	14
11:00	0	1	3	3	1	2	0	0	0	0	0	0	0	10
Total	25	84	140	302	217	63	9	1	1	0	0	0	0	842



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Desert Springs Counter

#2 11-3-2020

Date Printed: 11/9/2020

Start Date: 11/4/2020

End Date: 11/5/2020

GPS Accuracy: 0 ft

Location Verified: No

Latitude: 35.048308
Longitude: -106.721471
Direction: North, A to B

11/5/2020	0 - 15	> 15 -	> 20 -	> 25 -	> 30 -	> 35 -	> 40 -	> 45 -	> 50 -	> 55 -	> 60 -	> 65 -	> 70	Total
Time	MPH	20 MPH	25 MPH	30 MPH	35 MPH	40 MPH	45 MPH	50 MPH	55 MPH	60 MPH	65 MPH	70 MPH	MPH	
12:00 AM	0	1	0	0	1	1	0	0	0	0	0	0	0	3
1:00	0	0	0	1	0	0	0	0	0	0	0	0	0	1
2:00	0	1	2	4	4	0	0	0	0	0	0	0	0	11
3:00	0	1	1	2	0	0	0	0	0	0	0	0	0	4
4:00	0	0	2	3	1	0	1	0	0	0	0	0	0	7
5:00	0	1	5	8	9	1	0	0	0	0	0	0	0	24
6:00	0	1	7	16	5	6	2	0	0	0	0	0	0	37
7:00	1	6	8	26	16	2	0	0	0	0	0	0	0	59
8:00	0	1	9	16	19	4	1	0	0	0	0	0	0	50
9:00	1	2	5	10	6	3	0	0	0	0	0	0	0	27
10:00	1	1	9	5	11	2	2	0	1	0	0	0	0	32
11:00	0	6	2	12	10	3	1	0	0	0	0	0	0	34
12:00 PM	4	5	11	13	17	7	0	0	0	0	0	0	0	57
1:00	0	2	11	16	12	4	2	0	0	0	0	0	0	47
2:00	4	5	9	23	13	2	1	0	0	0	0	0	0	57
3:00	3	9	9	16	13	4	1	0	0	0	0	0	0	55
4:00	4	7	12	24	15	7	1	0	0	0	0	0	0	70
5:00	7	16	19	26	7	3	0	0	0	0	0	0	0	78
6:00	3	10	20	26	14	2	1	0	0	0	0	0	0	76
7:00	2	7	18	27	11	0	2	0	0	0	0	0	0	67
8:00	1	6	10	14	5	0	0	0	0	0	0	0	0	36
9:00	1	5	6	7	8	2	0	0	0	0	0	0	0	29
10:00	0	4	2	10	4	0	0	0	0	0	0	0	0	20
11:00	4	1	2	0	4	0	0	0	0	0	0	0	0	11
Total	36	98	179	305	205	53	15	0	1	0	0	0	0	892
Grand Total	61	182	319	607	422	116	24	1	2	0	0	0	0	1734

Stats	Percentile	15th	50th	85th	95th
Speed		20.3	27.7	32.7	36.3
Mean Speed (Average)		27.7			
10 MPH Pace Speed		25-34			
Number in Pace		1027			
Percent in Pace		61.0%			
Number > 25 MPH		1172			
Percent > 25 MPH		70.1%			



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Desert Springs Counter

#2 11-3-2020

Date Printed: 11/9/2020

Start Date: 11/4/2020

End Date: 11/5/2020

GPS Accuracy: 0 ft

Location Verified: No

Latitude: 35.048308
Longitude: -106.721471
Direction: South, B to A

11/4/2020	0 - 15	> 15 -	> 20 -	> 25 -	> 30 -	> 35 -	> 40 -	> 45 -	> 50 -	> 55 -	> 60 -	> 65 -	> 70	Total
Time	MPH	20 MPH	25 MPH	30 MPH	35 MPH	40 MPH	45 MPH	50 MPH	55 MPH	60 MPH	65 MPH	70 MPH	MPH	
12:00 AM	1	0	4	5	3	0	0	0	0	0	0	0	0	13
1:00	0	0	1	2	0	0	0	0	0	0	0	0	0	3
2:00	0	0	2	3	0	0	0	0	0	0	0	0	0	5
3:00	1	0	2	2	0	0	0	0	0	0	0	0	0	5
4:00	0	1	2	0	0	0	0	0	0	0	0	0	0	3
5:00	0	1	2	0	1	1	0	0	0	0	0	0	0	5
6:00	2	1	4	9	2	1	0	0	0	0	0	0	0	19
7:00	3	5	3	16	9	3	0	0	0	0	0	0	0	39
8:00	3	7	2	15	8	3	0	0	0	0	0	0	0	38
9:00	3	2	5	8	6	5	0	0	0	0	0	0	0	29
10:00	2	4	9	9	8	1	0	0	0	0	0	0	0	33
11:00	2	3	8	23	16	0	0	0	0	0	0	0	0	52
12:00 PM	3	5	11	21	19	2	0	0	0	0	0	0	0	61
1:00	1	8	18	26	8	2	0	0	0	0	0	0	0	63
2:00	3	4	12	35	13	1	0	0	0	0	0	0	0	68
3:00	0	3	19	45	17	2	0	0	0	0	0	0	0	86
4:00	3	9	35	61	30	3	0	0	0	0	0	0	0	141
5:00	4	12	38	63	24	1	0	0	0	0	0	0	0	142
6:00	2	11	48	49	16	2	0	0	0	0	0	0	0	128
7:00	4	7	20	25	15	1	0	0	0	0	0	0	0	72
8:00	3	5	25	27	9	3	0	0	0	0	0	0	0	72
9:00	0	5	12	28	4	0	1	0	0	0	0	0	0	50
10:00	1	5	6	9	10	1	0	0	0	0	0	0	0	32
11:00	2	4	5	6	2	0	0	0	0	0	0	0	0	19
Total	43	102	293	487	220	32	1	0	0	0	0	0	0	1178



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Desert Springs Counter

#2 11-3-2020

Date Printed: 11/9/2020

Start Date: 11/4/2020

End Date: 11/5/2020

GPS Accuracy: 0 ft

Location Verified: No

Latitude: 35.048308
Longitude: -106.721471
Direction: South, B to A

11/5/2020	0 - 15	> 15 -	> 20 -	> 25 -	> 30 -	> 35 -	> 40 -	> 45 -	> 50 -	> 55 -	> 60 -	> 65 -	> 70	Total
Time	MPH	20 MPH	25 MPH	30 MPH	35 MPH	40 MPH	45 MPH	50 MPH	55 MPH	60 MPH	65 MPH	70 MPH	MPH	
12:00 AM	0	0	2	2	2	0	0	0	0	0	0	0	0	6
1:00	1	2	0	1	0	0	0	0	0	0	0	0	0	4
2:00	0	1	0	2	0	0	0	0	0	0	0	0	0	3
3:00	1	2	1	4	0	0	0	0	0	0	0	0	0	8
4:00	0	1	0	2	0	0	0	0	0	0	0	0	0	3
5:00	0	1	2	1	1	0	1	0	0	0	0	0	0	6
6:00	3	3	2	10	5	1	0	0	0	0	0	0	0	24
7:00	4	5	5	18	5	0	1	0	0	0	0	0	0	38
8:00	4	9	4	11	8	1	1	0	0	0	0	0	0	38
9:00	0	3	4	16	7	2	1	0	0	0	0	0	0	33
10:00	3	4	11	15	5	2	1	0	0	0	0	0	0	41
11:00	0	4	16	15	15	1	0	0	0	0	0	0	0	51
12:00 PM	4	5	8	25	21	5	0	0	0	0	0	0	0	68
1:00	1	5	17	27	10	1	0	0	0	0	0	0	0	61
2:00	4	10	16	36	14	3	0	0	0	0	0	0	0	83
3:00	6	5	23	53	19	3	1	1	0	0	0	0	0	111
4:00	6	12	32	55	20	6	1	0	0	0	0	0	0	132
5:00	0	21	36	61	19	3	0	0	0	0	0	0	0	140
6:00	4	8	36	54	14	3	0	0	0	0	0	0	0	119
7:00	4	7	32	39	11	1	0	0	0	0	0	0	0	94
8:00	2	8	14	30	14	3	0	0	0	0	0	0	0	71
9:00	0	5	17	17	5	0	0	0	0	0	0	0	0	44
10:00	2	5	6	9	7	1	0	0	0	0	0	0	0	30
11:00	0	2	2	8	3	0	0	0	0	0	0	0	0	15
Total	49	128	286	511	205	36	7	1	0	0	0	0	0	1223
Grand Total	92	230	579	998	425	68	8	1	0	0	0	0	0	2401

Stats	Percentile	15th	50th	85th	95th
Speed		20.7	26.4	31	33.9
Mean Speed (Average)		26.6			
10 MPH Pace Speed		20-29			
Number in Pace		1562			
Percent in Pace		68.0%			
Number > 25 MPH		1500			
Percent > 25 MPH		65.0%			




WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Desert Springs Counter
#2 11-3-2020
Date Printed: 11/9/2020
Start Date: 11/4/2020
End Date: 11/5/2020
GPS Accuracy: 0 ft
Location Verified: No

Latitude: 35.048308
Longitude: -106.721471

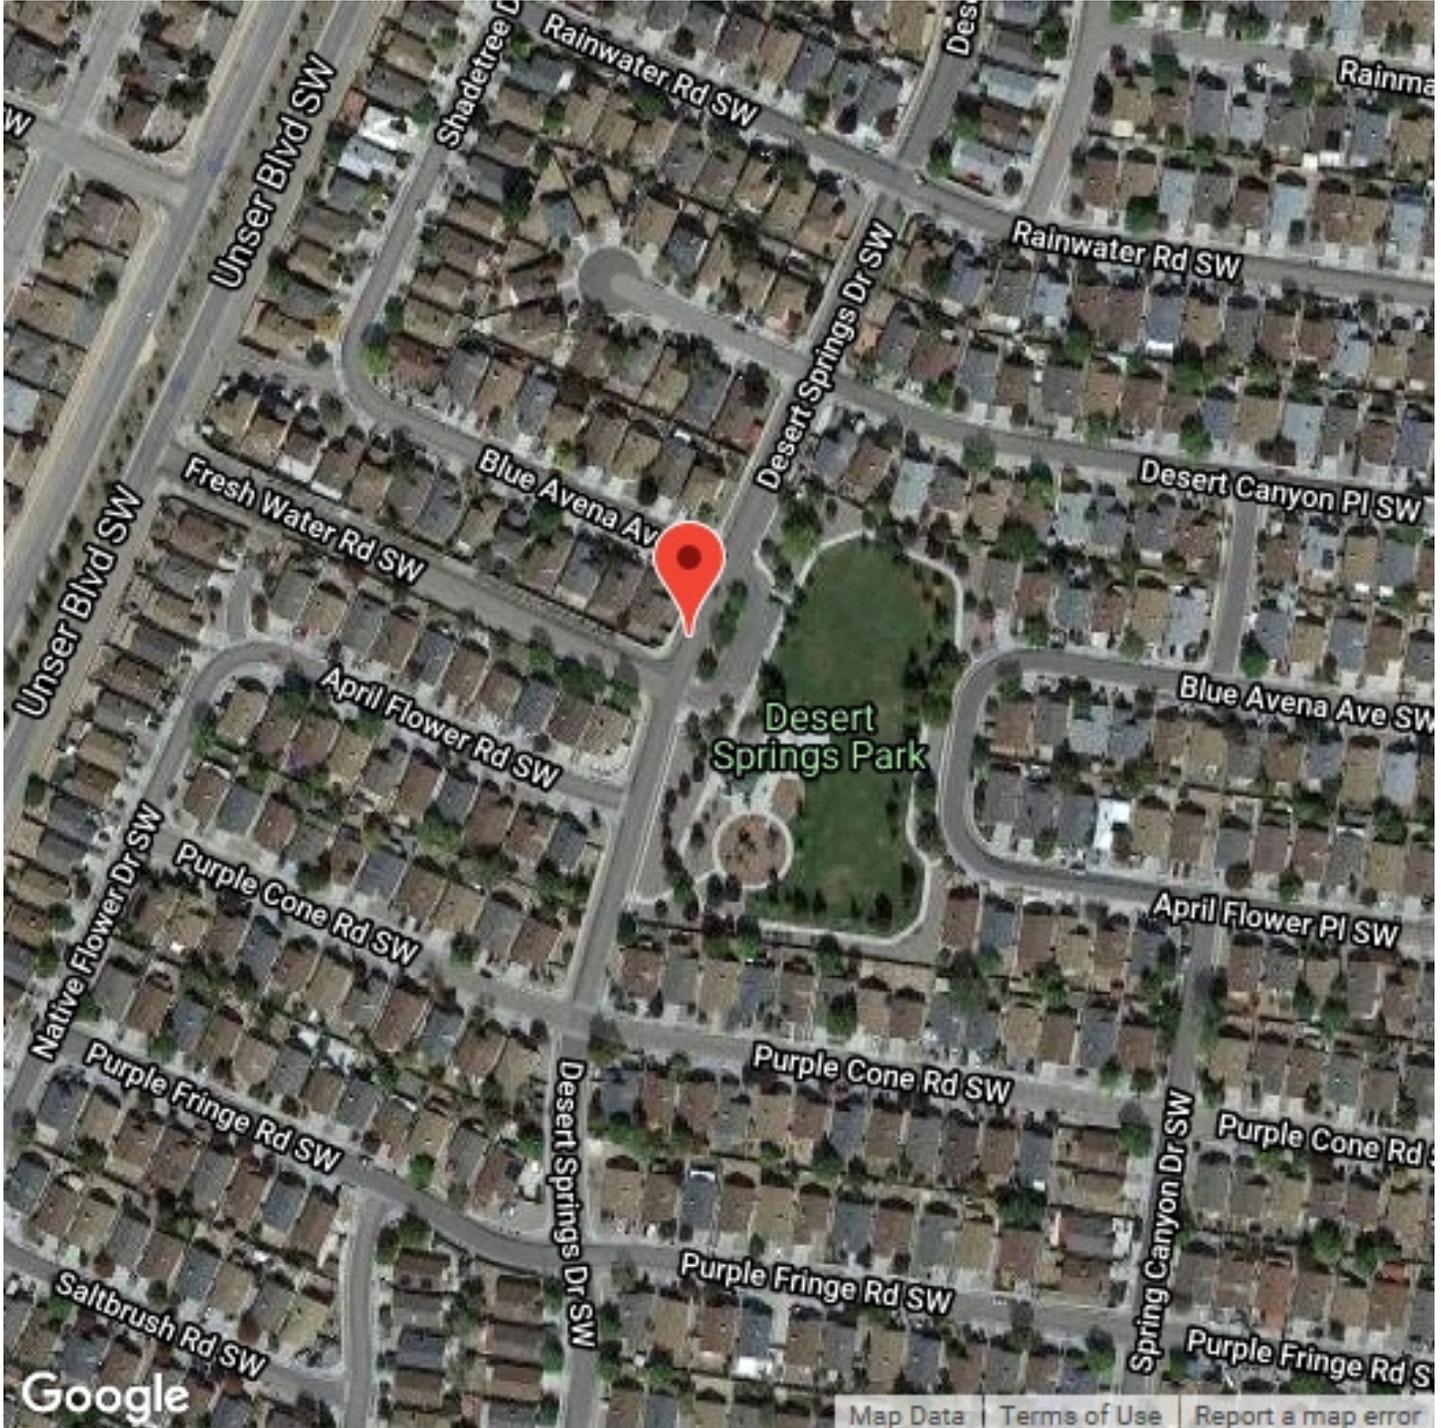



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109


Speed Enforcement Evaluator

Analysis Dates


Start: 11/4/2020
End: 11/4/2020

Total Percentage of Enforceable Violations


Posted Speed Limit 25 MPH
Enforcement Tolerance 5 MPH

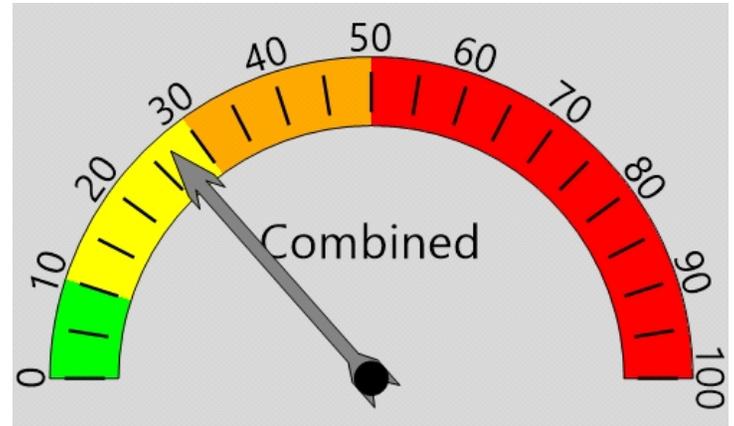

Percent Speeding: 27%
Rating: Medium Low

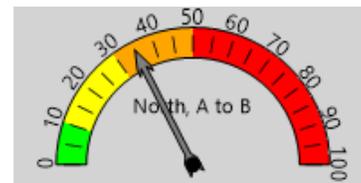

Percent Speeding: 35%
Rating: Medium

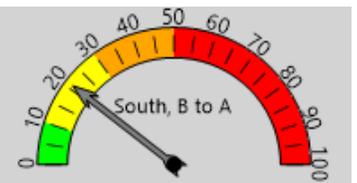

Percent Speeding: 21%
Rating: Medium Low

Vehicle Totals - Combined

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
68	186	433	789	437	95	10	1	1	0	0	0	0
85th Percentile: 32												

Vehicle Totals - North, A to B

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
25	84	140	302	217	63	9	1	1	0	0	0	0
85th Percentile: 33												

Vehicle Totals - South, B to A

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
43	102	293	487	220	32	1	0	0	0	0	0	0
85th Percentile: 30.9												



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109


Speed Enforcement Evaluator

Analysis Dates


Start: 11/5/2020
End: 11/5/2020

Total Percentage of Enforceable Violations


Posted Speed Limit 25 MPH
Enforcement Tolerance 5 MPH

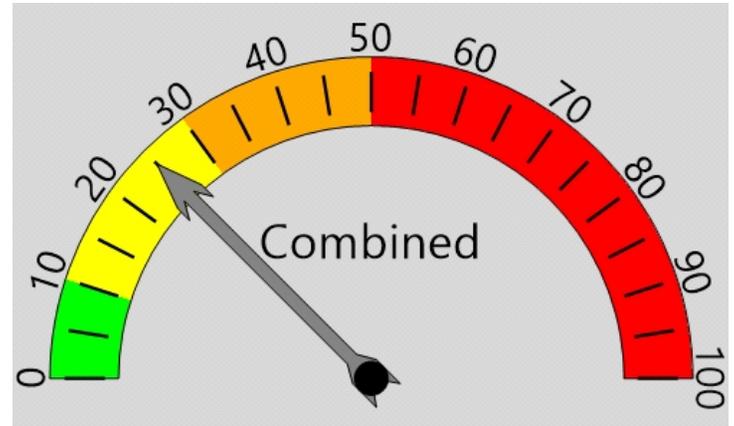

Percent Speeding: 25%
Rating: Medium Low

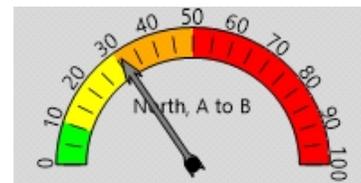

Percent Speeding: 31%
Rating: Medium

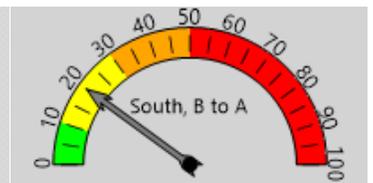

Percent Speeding: 20%
Rating: Medium Low

Vehicle Totals - Combined

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
85	226	465	816	410	89	22	1	1	0	0	0	0
85th Percentile: 31.7												

Vehicle Totals - North, A to B

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
36	98	179	305	205	53	15	0	1	0	0	0	0
85th Percentile: 32.5												

Vehicle Totals - South, B to A

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
49	128	286	511	205	36	7	1	0	0	0	0	0
85th Percentile: 31.1												



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109


Speed Enforcement Evaluator

Analysis Dates


Start: 11/4/2020
End: 11/4/2020

Total Percentage of Enforceable Violations


Posted Speed Limit 25 MPH
Enforcement Tolerance 7 MPH

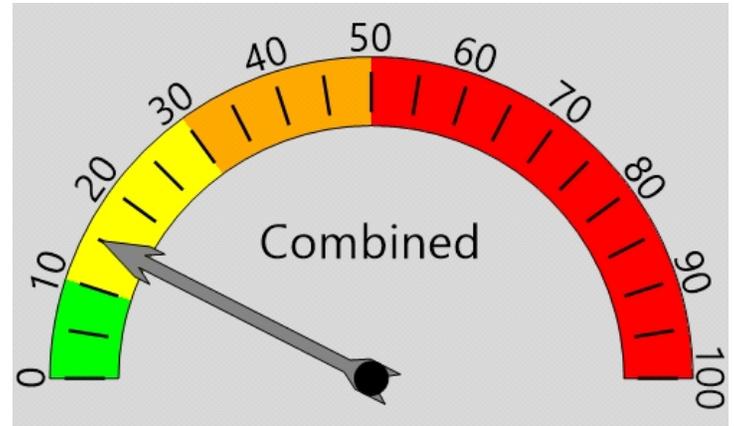

Percent Speeding: 15%
Rating: Medium Low

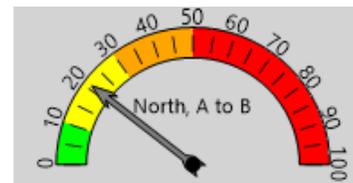

Percent Speeding: 21%
Rating: Medium Low

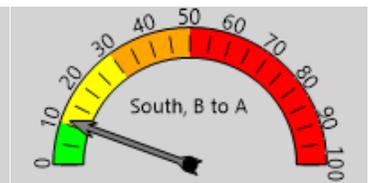

Percent Speeding: 11%
Rating: Medium Low

Vehicle Totals - Combined

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
68	186	433	789	437	95	10	1	1	0	0	0	0
85th Percentile: 32												

Vehicle Totals - North, A to B

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
25	84	140	302	217	63	9	1	1	0	0	0	0
85th Percentile: 33												

Vehicle Totals - South, B to A

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
43	102	293	487	220	32	1	0	0	0	0	0	0
85th Percentile: 30.9												



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

Speed Enforcement Evaluator

Analysis Dates


Start: 11/5/2020

End: 11/5/2020

Total Percentage of Enforceable Violations


Posted Speed Limit 25 MPH

Enforcement Tolerance 7 MPH

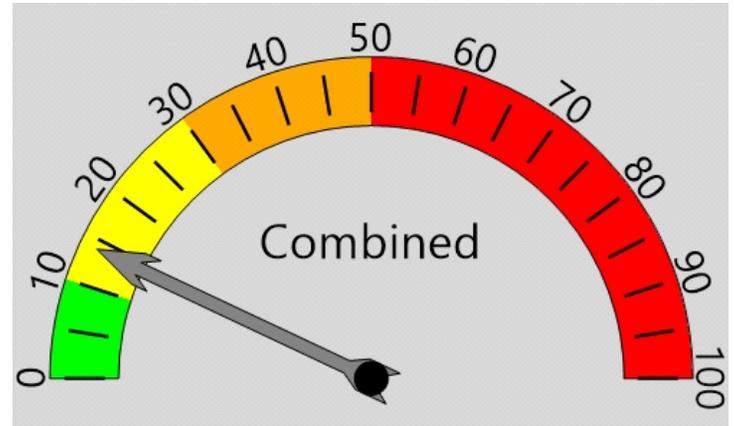

Percent Speeding: 14%

Rating: Medium Low

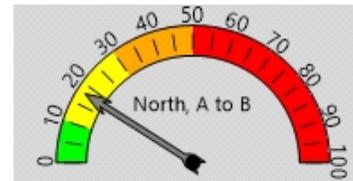

Percent Speeding: 18%

Rating: Medium Low



Percent Speeding: 12%

Rating: Medium Low

Vehicle Totals - Combined

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
85	226	465	816	410	89	22	1	1	0	0	0	0

85th Percentile: 31.7

Vehicle Totals - North, A to B

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
36	98	179	305	205	53	15	0	1	0	0	0	0

85th Percentile: 32.5

Vehicle Totals - South, B to A

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
49	128	286	511	205	36	7	1	0	0	0	0	0

85th Percentile: 31.1



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Desert Springs Counter

#2 11-3-2020

Date Printed: 11/9/2020

Start Date: 11/4/2020

End Date: 11/5/2020

GPS Accuracy: 0 ft

Location Verified: No

Latitude: 35.048308

Longitude: -106.721471

Direction: North, A to B

11/4/2020 Time	Motor Cycles	Cars & Trailers	2 Axle Long	Buses	2 Axle 6 Tire	3 Axle Single	4 Axle Single	<5 Axl Double	5 Axle Double	>6 Axl Double	<6 Axl Multi	6 Axle Multi	>6 Axl Multi	No Class	Total
12:00 AM	0	6	0	0	0	0	0	0	0	0	0	0	0	0	6
1:00	0	3	0	0	0	0	0	0	0	0	0	0	0	0	3
2:00	0	1	1	0	0	0	0	0	0	0	0	0	0	0	2
3:00	0	3	1	0	0	0	0	0	0	0	0	0	0	0	4
4:00	0	3	1	0	5	0	0	0	0	0	0	0	0	1	10
5:00	0	17	5	0	1	0	0	0	0	0	0	0	0	0	23
6:00	0	25	10	0	8	0	0	0	0	0	0	0	0	0	43
7:00	0	27	17	0	5	1	0	0	0	0	0	0	0	0	50
8:00	0	45	11	0	3	0	0	1	0	0	0	0	0	0	60
9:00	0	22	9	0	4	0	0	0	0	0	0	0	0	0	35
10:00	0	24	10	0	9	0	0	0	0	0	0	0	0	0	43
11:00	0	27	14	0	8	0	0	0	0	0	0	0	0	0	49
12:00 PM	0	30	12	0	9	0	0	0	0	0	0	0	0	0	51
1:00	0	24	9	0	2	0	0	1	0	0	0	0	0	0	36
2:00	0	21	10	0	5	0	0	0	0	0	0	0	0	0	36
3:00	0	34	12	1	6	0	0	0	0	0	0	0	0	0	53
4:00	1	43	14	0	8	0	0	0	0	0	0	0	0	0	66
5:00	1	55	13	0	9	0	0	0	0	0	0	0	0	1	79
6:00	0	36	18	0	7	0	0	0	0	0	0	0	0	0	61
7:00	0	27	12	0	5	0	0	0	0	0	0	0	0	0	44
8:00	0	27	5	0	1	0	0	0	0	0	0	0	0	0	33
9:00	0	19	7	0	5	0	0	0	0	0	0	0	0	0	31
10:00	0	11	1	0	2	0	0	0	0	0	0	0	0	0	14
11:00	0	6	4	0	0	0	0	0	0	0	0	0	0	0	10
Total	2	536	196	1	102	1	0	2	0	0	0	0	0	2	842
Percent	0.2%	63.7%	23.3%	0.1%	12.1%	0.1%	0.0%	0.2%	0.0%	0.0%	0.0%	0.0%	0.0%	0.2%	
AM Peak		8:00	7:00		10:00	7:00		8:00						4:00	8:00
	*	45	17	*	9	1	*	1	*	*	*	*	*	1	60
PM Peak	4:00	5:00	6:00	3:00	12:00			1:00						5:00	5:00
					PM										
	1	55	18	1	9	*	*	1	*	*	*	*	*	1	79



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Desert Springs Counter

#2 11-3-2020

Date Printed: 11/9/2020

Start Date: 11/4/2020

End Date: 11/5/2020

GPS Accuracy: 0 ft

Location Verified: No

Latitude: 35.048308

Longitude: -106.721471

Direction: North, A to B

11/5/2020 Time	Motor Cycles	Cars & Trailers	2 Axle Long	Buses	2 Axle 6 Tire	3 Axle Single	4 Axle Single	<5 Axl Double	5 Axle Double	>6 Axl Double	<6 Axl Multi	6 Axle Multi	>6 Axl Multi	No Class	Total
12:00 AM	0	3	0	0	0	0	0	0	0	0	0	0	0	0	3
1:00	0	1	0	0	0	0	0	0	0	0	0	0	0	0	1
2:00	0	9	2	0	0	0	0	0	0	0	0	0	0	0	11
3:00	0	4	0	0	0	0	0	0	0	0	0	0	0	0	4
4:00	0	1	3	0	3	0	0	0	0	0	0	0	0	0	7
5:00	0	15	5	0	4	0	0	0	0	0	0	0	0	0	24
6:00	0	19	9	0	9	0	0	0	0	0	0	0	0	0	37
7:00	0	34	17	0	7	1	0	0	0	0	0	0	0	0	59
8:00	0	32	12	0	5	0	0	1	0	0	0	0	0	0	50
9:00	0	16	9	0	2	0	0	0	0	0	0	0	0	0	27
10:00	0	20	9	0	3	0	0	0	0	0	0	0	0	0	32
11:00	0	24	6	0	4	0	0	0	0	0	0	0	0	0	34
12:00 PM	0	39	14	0	4	0	0	0	0	0	0	0	0	0	57
1:00	1	24	12	0	7	1	0	1	0	0	0	0	0	1	47
2:00	0	37	10	0	9	0	0	0	0	0	0	0	0	1	57
3:00	0	27	16	1	10	0	0	0	0	0	0	0	0	1	55
4:00	0	45	16	0	8	0	0	1	0	0	0	0	0	0	70
5:00	0	48	17	0	12	0	0	1	0	0	0	0	0	0	78
6:00	0	40	24	0	12	0	0	0	0	0	0	0	0	0	76
7:00	0	39	17	0	10	0	0	1	0	0	0	0	0	0	67
8:00	1	21	10	0	4	0	0	0	0	0	0	0	0	0	36
9:00	0	23	4	0	2	0	0	0	0	0	0	0	0	0	29
10:00	1	12	6	0	1	0	0	0	0	0	0	0	0	0	20
11:00	0	7	3	0	1	0	0	0	0	0	0	0	0	0	11
Total	3	540	221	1	117	2	0	5	0	0	0	0	0	3	892
Percent	0.3%	60.5%	24.8%	0.1%	13.1%	0.2%	0.0%	0.6%	0.0%	0.0%	0.0%	0.0%	0.0%	0.3%	
AM Peak		7:00	7:00		6:00	7:00		8:00							7:00
	*	34	17	*	9	1	*	1	*	*	*	*	*	*	59
PM Peak	1:00	5:00	6:00	3:00	5:00	1:00		1:00						1:00	5:00
	1	48	24	1	12	1	*	1	*	*	*	*	*	1	78
Grand Total	5	1076	417	2	219	3	0	7	0	0	0	0	0	5	1734
Percent	0.3%	62.1%	24.0%	0.1%	12.6%	0.2%	0.0%	0.4%	0.0%	0.0%	0.0%	0.0%	0.0%	0.3%	



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Desert Springs Counter

#2 11-3-2020

Date Printed: 11/9/2020

Start Date: 11/4/2020

End Date: 11/5/2020

GPS Accuracy: 0 ft

Location Verified: No

Latitude: 35.048308

Longitude: -106.721471

Direction: South, B to A

11/4/2020 Time	Motor Cycles	Cars & Trailers	2 Axle Long	Buses	2 Axle 6 Tire	3 Axle Single	4 Axle Single	<5 Axl Double	5 Axle Double	>6 Axl Double	<6 Axl Multi	6 Axle Multi	>6 Axl Multi	No Class	Total
12:00 AM	0	7	6	0	0	0	0	0	0	0	0	0	0	0	13
1:00	0	2	1	0	0	0	0	0	0	0	0	0	0	0	3
2:00	0	5	0	0	0	0	0	0	0	0	0	0	0	0	5
3:00	0	5	0	0	0	0	0	0	0	0	0	0	0	0	5
4:00	0	2	0	1	0	0	0	0	0	0	0	0	0	0	3
5:00	0	3	2	0	0	0	0	0	0	0	0	0	0	0	5
6:00	0	14	5	0	0	0	0	0	0	0	0	0	0	0	19
7:00	0	24	11	0	3	1	0	0	0	0	0	0	0	0	39
8:00	0	25	12	0	1	0	0	0	0	0	0	0	0	0	38
9:00	0	27	0	0	2	0	0	0	0	0	0	0	0	0	29
10:00	0	22	6	0	5	0	0	0	0	0	0	0	0	0	33
11:00	0	39	9	0	3	0	0	0	0	0	0	0	0	1	52
12:00 PM	0	45	11	3	2	0	0	0	0	0	0	0	0	0	61
1:00	0	51	10	0	2	0	0	0	0	0	0	0	0	0	63
2:00	0	45	15	0	7	0	0	0	0	0	0	0	0	1	68
3:00	1	56	21	0	7	0	0	0	0	0	0	0	0	1	86
4:00	0	98	36	0	6	0	0	1	0	0	0	0	0	0	141
5:00	0	98	38	0	6	0	0	0	0	0	0	0	0	0	142
6:00	0	86	35	0	4	0	0	0	0	0	0	0	0	3	128
7:00	0	55	13	0	2	0	0	1	0	0	0	0	0	1	72
8:00	0	46	17	0	8	0	0	1	0	0	0	0	0	0	72
9:00	0	34	15	0	1	0	0	0	0	0	0	0	0	0	50
10:00	0	24	8	0	0	0	0	0	0	0	0	0	0	0	32
11:00	0	16	3	0	0	0	0	0	0	0	0	0	0	0	19
Total	1	829	274	4	59	1	0	3	0	0	0	0	0	7	1178
Percent	0.1%	70.4%	23.3%	0.3%	5.0%	0.1%	0.0%	0.3%	0.0%	0.0%	0.0%	0.0%	0.0%	0.6%	
AM Peak		11:00	8:00	4:00	10:00	7:00								11:00	11:00
	*	39	12	1	5	1	*	*	*	*	*	*	*	1	52
PM Peak	3:00	4:00	5:00	12:00	8:00			4:00						6:00	5:00
	1	98	38	3	8	*	*	1	*	*	*	*	*	3	142



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Desert Springs Counter

#2 11-3-2020

Date Printed: 11/9/2020

Start Date: 11/4/2020

End Date: 11/5/2020

GPS Accuracy: 0 ft

Location Verified: No

Latitude: 35.048308

Longitude: -106.721471

Direction: South, B to A

11/5/2020 Time	Motor Cycles	Cars & Trailers	2 Axle Long	Buses	2 Axle 6 Tire	3 Axle Single	4 Axle Single	<5 Axl Double	5 Axle Double	>6 Axl Double	<6 Axl Multi	6 Axle Multi	>6 Axl Multi	No Class	Total
12:00 AM	0	5	1	0	0	0	0	0	0	0	0	0	0	0	6
1:00	0	4	0	0	0	0	0	0	0	0	0	0	0	0	4
2:00	0	3	0	0	0	0	0	0	0	0	0	0	0	0	3
3:00	0	8	0	0	0	0	0	0	0	0	0	0	0	0	8
4:00	0	2	1	0	0	0	0	0	0	0	0	0	0	0	3
5:00	0	5	1	0	0	0	0	0	0	0	0	0	0	0	6
6:00	0	12	9	0	3	0	0	0	0	0	0	0	0	0	24
7:00	0	25	11	0	0	2	0	0	0	0	0	0	0	0	38
8:00	0	19	12	0	7	0	0	0	0	0	0	0	0	0	38
9:00	0	24	7	0	1	0	0	0	0	0	0	0	0	1	33
10:00	0	26	8	0	6	1	0	0	0	0	0	0	0	0	41
11:00	0	32	15	0	3	0	0	1	0	0	0	0	0	0	51
12:00 PM	1	51	13	0	2	1	0	0	0	0	0	0	0	0	68
1:00	0	35	19	0	5	1	0	0	0	0	0	0	0	1	61
2:00	0	55	19	1	7	0	0	0	0	0	0	0	0	1	83
3:00	0	68	37	0	6	0	0	0	0	0	0	0	0	0	111
4:00	1	94	28	0	7	0	0	0	0	0	0	0	0	2	132
5:00	0	91	41	0	6	0	0	0	0	0	0	0	0	2	140
6:00	0	85	23	1	9	0	0	1	0	0	0	0	0	0	119
7:00	0	57	30	0	7	0	0	0	0	0	0	0	0	0	94
8:00	0	46	18	0	6	1	0	0	0	0	0	0	0	0	71
9:00	0	34	7	0	3	0	0	0	0	0	0	0	0	0	44
10:00	0	24	6	0	0	0	0	0	0	0	0	0	0	0	30
11:00	0	10	5	0	0	0	0	0	0	0	0	0	0	0	15
Total	2	815	311	2	78	6	0	2	0	0	0	0	0	7	1223
Percent	0.2%	66.6%	25.4%	0.2%	6.4%	0.5%	0.0%	0.2%	0.0%	0.0%	0.0%	0.0%	0.0%	0.6%	
AM Peak		11:00	11:00		8:00	7:00		11:00						9:00	11:00
	*	32	15	*	7	2	*	1	*	*	*	*	*	1	51
PM Peak	12:00	4:00	5:00	2:00	6:00	12:00		6:00						4:00	5:00
	PM					PM									
	1	94	41	1	9	1	*	1	*	*	*	*	*	2	140
Grand Total	3	1644	585	6	137	7	0	5	0	0	0	0	0	14	2401
Percent	0.1%	68.5%	24.4%	0.2%	5.7%	0.3%	0.0%	0.2%	0.0%	0.0%	0.0%	0.0%	0.0%	0.6%	




WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Desert Springs Counter
#2 11-3-2020
Date Printed: 11/9/2020
Start Date: 11/4/2020
End Date: 11/5/2020
GPS Accuracy: 0 ft
Location Verified: No

Latitude: 35.048308
Longitude: -106.721471

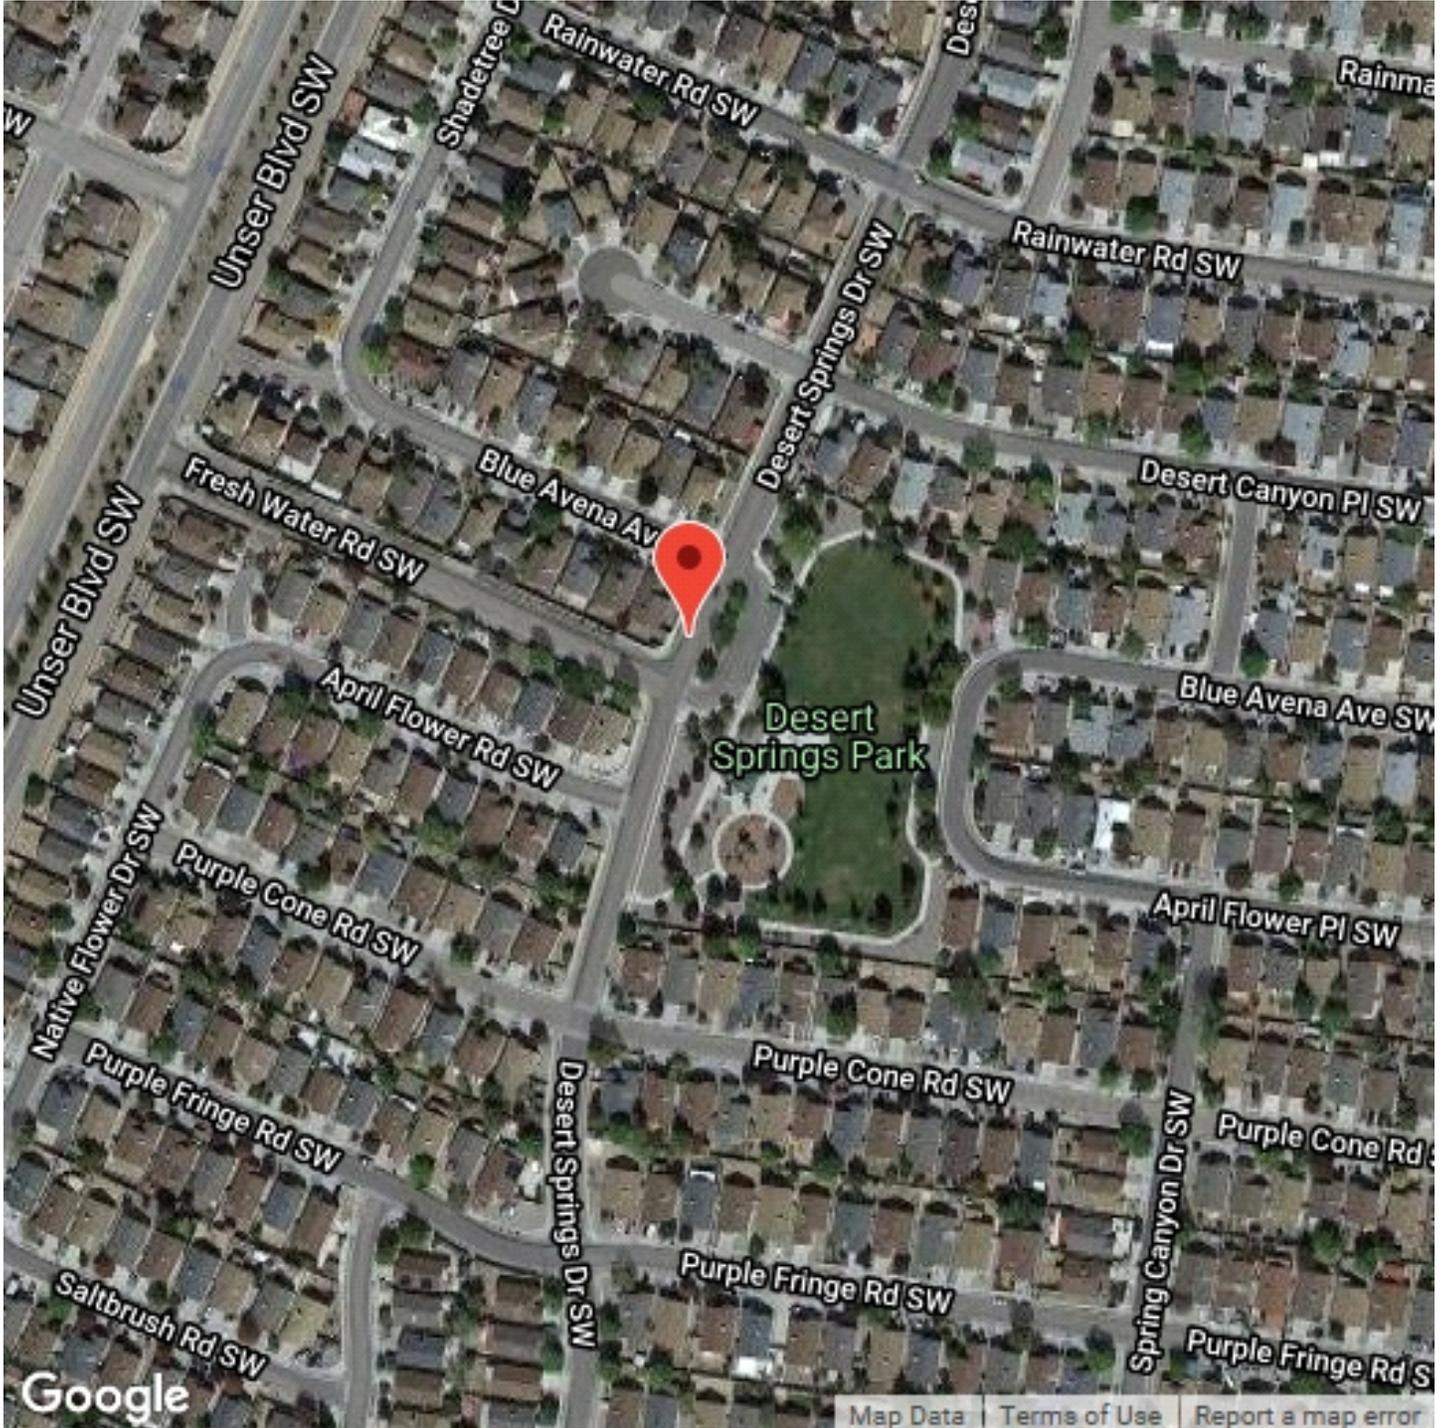


Appendix B – Crash Data

REPORT	DATE	TIME	DAY	AGENCY	CITY	A_STREET	B_STREET	CRASH_DIR	PEC_INV	N_VEH	SEVERITY	CLASSIFICA	ANALYSIS	HIGH_C_FAC	WEATHER	LIGHTING	HIT_RUN	ALC_INV	DRUG_INV	PED_INV	MC_INV	PC_INV	TRK_INV	HZ_INV	MAX_DAMAGE	OCCURRENCE	RD_CHARACT	RD_GRADE	GIS_UTM_X	GIS_UTM_Y	GIS_LAT	GIS_LONG	
710363495	4/16/2017 0:00		21:19 Sunday	ALBUQUERQUE POLICE DEPARTMENT	ALBUQUERQUE	DESERT SPRINGS DR SW	DESERT CANYON PL SW	S		1	1 Injury Crash	Fixed Object	Fixed Object - Median Raised Or Curb	Alcohol/Drug Involved	Clear	Dark-Lighted	No	Involved	Not Involved	Not Involved	Involved	Not Involved	Not Involved	Not Involved	Appearance	On Roadway	Straight	Dip	343044.6949	3879847.769	35.049152	-106.720968	
23453943	8/14/2017 0:00		6:50 Monday	STATION REPORT	ALBUQUERQUE	DESERT SPRINGS	APRIL FLOWER	S		2	2 Property Damage Only Crash	Other Vehicle	Other Vehicle - From Opposite Direction	Passed Stop Sign	Clear	Daylight	No	Not Involved	Not Involved	Not Involved	Not Involved	Not Involved	Not Involved	Not Involved	Functional	On Roadway	Straight	Level	342976.9328	3879694.727	35.047762	-106.721682	
710401871	8/20/2017 0:00		12:52 Sunday	ALBUQUERQUE POLICE DEPARTMENT	ALBUQUERQUE	DESERT SPRINGS DR SW	SALTBRUSH RD SW	N		2	2 Injury Crash	Parked Vehicle	Vehicle Parked in Proper Location	Excessive Speed	Clear	Daylight	No	Not Involved	Not Involved	Not Involved	Not Involved	Not Involved	Not Involved	Not Involved	Disabling	On Roadway	Straight	Level	342949.2682	3879460.172	35.045643	-106.721194	
710189411	4/8/2014 0:00		18:52	ALBUQUERQUE POLICE DEPARTMENT	ALBUQUERQUE	SPRING FLOWER RD SW	DESERT SPRINGS DR SW	E	Not Involved	2	2 Property Damage Only Crash	Other Vehicle	Other Vehicle - From Same Direction/Rear-End Collision	Driver Inattention	Clear	Daylight	Yes	Not Involved	Not Involved	Not Involved	Not Involved	Not Involved	Not Involved	Not Involved	Disabling	On Roadway	Straight	Level	342921.532	3879284.218	35.04405324	-106.722111	
23414128	4/2/2014 0:00		12:00	STATION REPORT	ALBUQUERQUE	7728 PURPLE CONE SW	-		99 Not Involved	2	2 Property Damage Only Crash	Parked Vehicle	Parked Vehicle - Unknown/Not Stated	Missing Data	Left Blank	Left Blank	No	Not Involved	Not Involved	Not Involved	Not Involved	Not Involved	Not Involved	Not Involved	Functional	On Roadway	Left Blank	Left Blank	342969.959	3879614.55	35.04702815	-106.7217429	
23392298	2/18/2014 0:00	Invalid Code		STATION REPORT	ALBUQUERQUE	2408 DESERT SPGS SW	-		Left Blank	Not Involved	2	2 Property Damage Only Crash	Parked Vehicle	Parked Vehicle - Unknown/Not Stated	Missing Data	Left Blank	Left Blank	No	Not Involved	Not Involved	Not Involved	Not Involved	Not Involved	Not Involved	Missing Data	On Roadway	Left Blank	Left Blank	342936.4548	3879383.415	35.04494965	-106.7220664	
710215456	12/8/2014 0:00		18:44	ALBUQUERQUE POLICE DEPARTMENT	ALBUQUERQUE	7809 DESERT CANYON PL	-		Left Blank	Not Involved	2	2 Property Damage Only Crash	Other Vehicle	Non-Intersection - One Vehicle/Enter Parked Position	Alcohol/Drug Involved	Clear	Daylight	Yes	Not Involved	Involved	Not Involved	Not Involved	Not Involved	Not Involved	Not Involved	Appearance	On Roadway	Straight	Level	343025.0888	3879857.32	35.04923523	-106.7211846
710084950	1/13/2013 0:00		17:01	ALBUQUERQUE POLICE DEPARTMENT	ALBUQUERQUE	DESERT SPRINGS DR SW	PURPLE CONE RD SW	Left Blank	Not Involved	2	2 Injury Crash	Other Vehicle	Intersection - From Same Direction/One Left Turn	Failed to Yield Right of Way	Clear	Dawn	No	Not Involved	Not Involved	Not Involved	Not Involved	Not Involved	Not Involved	Not Involved	Disabling	On Roadway	Straight	Level	342955.1	3879618.84	35.0470745	-106.7219066	
710120879	9/29/2012 0:00		15:05	ALBUQUERQUE POLICE DEPARTMENT	ALBUQUERQUE	DESERT SPRINGS DR SW	APRIL FLOWER DR SW	Left Blank	Not Involved	1	1 Property Damage Only Crash	Fixed Object	Fixed Object - Light Standard (Light Pole)	Other Mechanical Defect	Clear	Daylight	No	Not Involved	Not Involved	Not Involved	Not Involved	Not Involved	Not Involved	Not Involved	Disabling	Off Roadway	Straight	Level	342976.9522	3879694.729	35.04776191	-106.7216616	
710002222	6/7/2013 0:00		21:12 Tuesday	Albuquerque-Pd	Albuquerque	DESERT CANYON PL	DESERT SPRINGS DR	W	Not Involved	2	2 Property Damage Only Crash	Parked Vehicle	Draper Park	Excessive Speed	Clear	Dark-Lighted	Yes	None Indicated	None Indicated	Not Involved	Not Involved	Not Involved	Not Involved	Not Involved	Functional	Straight	Level	343044.6909	3879847.775	35.049152	-106.720968		
23163942	9/24/2010 0:00		21 Friday	Albuquerque-Pd	Albuquerque	SPRING FLOWER	DESERT SPRINGS	E	Not Involved	1	1 Property Damage Only Crash	Fixed Object	Median Or Curb	Excessive Speed	Clear	Dark-Lighted	-	None Indicated	None Indicated	Not Involved	Not Involved	Not Involved	Not Involved	Not Involved	Disabling	Curve	Level	342921.5204	3879284.222	-106.722	35.0441		
23220067	10/15/2010 0:00		11 Friday	Driver Report	Albuquerque	7811 APRIL FLOWER	-		-	Not Involved	2	2 Property Damage Only Crash	Parked Vehicle	Parked Veh-Link	None	Clear	Dark-Not Lighted	Yes	None Indicated	None Indicated	Not Involved	Functional	Straight	Level	342961.8972	3879675.084	-106.722	35.0476					

XXX Not on primary street or not within the latest 5 years



WILSON
& COMPANY
ENGINEERS & ARCHITECTS

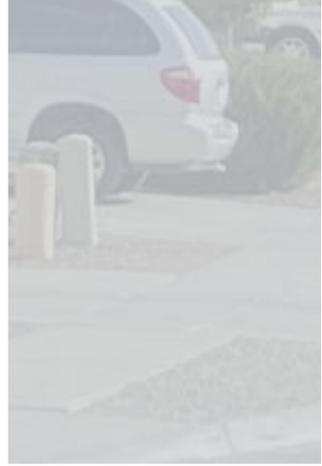

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109
phone: 505-348-4000
fax: 505-348-4055

www.wilsonco.com

