



March 2021

CITY OF ALBUQUERQUE
SUNRIDGE AVE - SUNBURST RD TO 90TH ST
SPEED STUDY

NTMP P803000

TASK 28.9

ONE
ALBUQUE
RQUE

City of Albuquerque

Sunridge Road

SPEED STUDY

NTMP P803000

NTP #28.9

WCI 1810002228

March 2021



Audra V. Gallegos
03.03.2021

ONE
ALBUQUE
RQUE
city of albuquerque

WILSON
& COMPANY

Table of Contents

Tables	1
Introduction	1
Project Area and Background	1
Existing Conditions	2
Traffic Conditions	2
Safety	2
Crash Data	2
Crash Analysis	2
Speed	2
Typical Sections	3
NTMP Traffic Calming Criteria	4
Summary of Results	5
Recommendations	5

Figures

Figure 1: Project Area and Existing Traffic Volumes	1
Figure 2: Sunridge Avenue Speed Limit	3
Figure 3: Sunridge Avenue looking South	3
Figure 4: Sunridge Avenue looking East	4
Figure 5: Sunridge Avenue Existing Typical Section	4

Tables

Table 1: Crash Summary	2
Table 2: Percentage of Vehicles Exceeding Speed Limit	2
Table 3: Summary of Results	5

Appendices

- Appendix A – Traffic Data
- Appendix B – Crash Reports

Introduction

This report documents the speed study analysis on Sunridge Avenue from Sunburst Road to 90th Street in Albuquerque, New Mexico. The purpose of this project is to collect and analyze the traffic volumes, speed, and safety of Sunridge Avenue, a two-way street, from Sunburst Road to 90th Street to determine if it meets the traffic calming criterion described in the *City of Albuquerque (COA) Neighborhood Traffic Management Program (NTMP)*, October 2020, and the *Institute of Transportation Engineers (ITE) Traffic Engineering Handbook*, 6th Edition.

Project Area and Background

The Sunridge Avenue project is located in Albuquerque, New Mexico and is a two-lane, undivided local road that runs east-west and north-south between Sunburst Road and 90th Street. Sunburst Road is a two-lane, undivided local road that runs east-west and intersects the south end of Sunridge Road at a T-intersection. 90th Street is a two-lane, undivided local road that runs north-south and intersects the east end of Sunridge Avenue at a T-intersection. See [Figure 1](#) for a map of the project area.



Figure 1: Project Area and Existing Traffic Volumes

A request has been made to the City of Albuquerque to determine if traffic calming is appropriate for this location. Wilson & Company was tasked by the City of Albuquerque to determine if Sunridge Avenue warrants traffic calming measures.

Existing Conditions

Traffic Conditions

Sunridge Avenue is an urban local road with an Average Daily Traffic (ADT) of 173 vehicles and an existing speed limit of 25 mph. Existing tube count data (volume, speed, and class) was collected for 48-hours on Wednesday, September 23, 2020 and Thursday, September 24, 2020. The full traffic count data can be found in [Appendix A](#).

Safety

Crash Data

Historical crash data was provided by the City of Albuquerque. Five years of crash data (2019, 2018, 2017, 2016, and 2015) were obtained to evaluate the existing safety condition of Sunridge Avenue. See [Table 1](#) for crash summary.

Table 1: Crash Summary

Crash Date	Crash Intersecting Street	Crash Primary Street	Crash Analysis	Severity	Contributing Factors	Crash Correct with Traffic Calming
6/18/2018	Sunburst Rd.	Sunridge Rd.	Vehicle going straight	Injury	Driver inattention	No

Crash Analysis

The following observations were concluded from the review of the five years (2019, 2018, 2017, 2016, and 2015) of crash data (one total crash). See [Appendix B](#) for crash reports.

- The crash occurred in clear conditions;
- The crash resulted in injury;
- The crash occurred during the day.
- None of the crashes reported involved excessive speeding.

Speed

Speed data was collected on Sunridge Avenue for a 48-hour period on Wednesday, September 23, 2020 and Thursday, September 24, 2020. See [Table 2](#) for the percentage of vehicles exceeding the speed limit by 5 mph and 7 mph.

Table 2: Percentage of Vehicles Exceeding Speed Limit

Location	Percentage of Vehicles Exceeding Speed Limit			
	September 23, 2020		September 24, 2020	
	Counter 1	Counter 2	Counter 1	Counter 2
5 mph	2%	21%	2%	11%
7 mph	1%	11%	0%	8%

Speed data can be found in the traffic counts located in [Appendix A](#). At least 2% of vehicle speeds exceed the posted speed limit (25 mph) by 5 mph or more at Counter 1 and 21% at Counter 2. For Counter 1, 1% of vehicle speeds exceed the posted speed limit (25 mph) by 7 mph or more and 11% at Counter 2.

Typical Sections

Sunridge Avenue is a 28-ft wide roadway with curb and gutter, and 4-ft wide sidewalks. See [Figure 3](#) and [Figure 4](#) for photos of the existing roadway, and [Figure 5](#) for the existing Sunridge Avenue typical section.



Figure 2: Sunridge Avenue Speed Limit



Figure 3: Sunridge Avenue looking South



Figure 4: Sunridge Avenue looking East

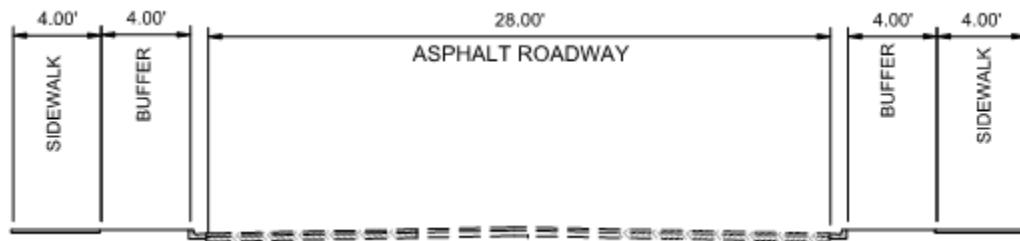


Figure 5: Sunridge Avenue Existing Typical Section

NTMP Traffic Calming Criteria

In order to meet the traffic calming criterion described in the COA NTMP, one or more of the following threshold criteria must be met:

1. Over a twenty-four-hour period, 15% of the vehicles traveling in the study area exceeded 7 miles per hour over the speed limit.
2. Three reported crashes in a 5-year period where the police report identified speed as either a primary or contributing cause of the crash.
3. A crash involving a pedestrian or cyclist in a school zone in a five-year period.
4. Over a twenty-four-hour period more than 800 vehicles were counted traveling through the study area and 15% of the vehicles traveling in the study area exceeded 5 miles per hour over the speed limit.
5. Over a twenty-four-hour period, 15% of the vehicles traveling in the study area exceeded 5 miles per hour over the speed limit and there was at least one reported crash in a 5-year

- period where the police report identified speed as either a primary or contributing cause of the crash.
6. Over a twenty-four-hour period, 15% of the vehicles traveling in the study area exceeded 5 miles per hour over the speed limit and a field survey conducted by the Traffic Engineering Division determined that 25% of the peak hour traffic was cut-through traffic.
 7. Over a twenty-four-hour period more than 800 vehicles were counted traveling through the study area and there was at least one reported crash in a 5-year period where the police report identified speed as either a primary or contributing cause of the crash.
 8. Over a twenty-four-hour period more than 800 vehicles were counted traveling through the study area and a field survey conducted by the Traffic Engineering Division determined that 25% of the peak hour traffic was cut-through traffic.
 9. A field survey conducted by the Traffic Engineering Division determined that 25% of the peak hour traffic was cut-through traffic and there was at least one reported crash in 5 years where the police report identified speed as either a primary or contributing cause of the crash.

Summary of Results

The crash that was reported could not have been corrected with traffic calming. The daily traffic volumes for Sunridge Avenue were less than 800 vehicles. More than 15% of vehicle speeds exceeded the posted speed limit by 5 mph, but not by 7 mph. See **Table 3** for the summary of results for Sunridge Avenue.

Table 3: Summary of Results

Criteria	Threshold								
	1	2	3	4	5	6	7	8	9
15% of vehicles speeds > 7 mph over posted speed limit									
15% of vehicles speeds > 5 mph over posted speed limit				X	X	X			
3 reported crashes with speed as primary or contributing factor									
1 reported crashes with speed as primary or contributing factor									
Pedestrian or cyclist involved crash									
More than 800 vehicles daily									
25% cut-through traffic									
Meets Threshold	No	No	No	No	No	No	No	No	No

 Threshold Criteria
 Meets Criteria

Recommendations

After analyzing the crash, volume, and speed data, it was determined that Sunridge Ave does not meet any of the nine (9) thresholds and, therefore, **does not** meet the minimum traffic calming criterion as described in the *COA NTMP*.

Appendix A – Traffic Data



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Sunridge _Counter #1

data file 09 27 2020

Date Printed: 10/2/2020

Start Date: 9/23/2020

End Date: 9/24/2020

GPS Accuracy: 0 ft

Location Verified: No

Station ID:

Location 1:

Location 2:

Latitude: 35.058628

Longitude: -106.736169

9/23/2020 South, A to B North, B to A

Time	South, A to B	North, B to A	Total
12:00 AM	0	0	0
1:00	0	0	0
2:00	0	0	0
3:00	0	0	0
4:00	0	0	0
5:00	2	0	2
6:00	4	1	5
7:00	1	1	2
8:00	2	2	4
9:00	5	0	5
10:00	1	1	2
11:00	4	2	6
12:00 PM	4	4	8
1:00	5	4	9
2:00	3	2	5
3:00	8	5	13
4:00	5	5	10
5:00	2	4	6
6:00	4	4	8
7:00	2	3	5
8:00	2	5	7
9:00	2	0	2
10:00	0	2	2
11:00	1	0	1
Total	57	45	102
Percent	55.9%	44.1%	
AM Peak	9:00	12:00 PM	12:00 PM
Volume	5	4	8
PM Peak	3:00	3:00	3:00
Volume	8	5	13



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Sunridge _Counter #1

data file 09 27 2020

Date Printed: 10/2/2020

Start Date: 9/23/2020

End Date: 9/24/2020

GPS Accuracy: 0 ft

Location Verified: No

Station ID:

Location 1:

Location 2:

Latitude: 35.058628

Longitude: -106.736169

9/24/2020 South, A to B North, B to A

Time	South, A to B	North, B to A	Total
12:00 AM	0	0	0
1:00	0	1	1
2:00	0	0	0
3:00	0	0	0
4:00	0	0	0
5:00	0	0	0
6:00	3	2	5
7:00	4	3	7
8:00	6	5	11
9:00	5	4	9
10:00	4	3	7
11:00	1	4	5
12:00 PM	1	0	1
1:00	1	7	8
2:00	3	8	11
3:00	6	5	11
4:00	4	3	7
5:00	1	8	9
6:00	6	2	8
7:00	8	1	9
8:00	3	3	6
9:00	1	2	3
10:00	1	1	2
11:00	0	0	0
Total	58	62	120
Percent	48.3%	51.7%	
AM Peak	8:00	8:00	8:00
Volume	6	5	11
PM Peak	7:00	2:00	2:00
Volume	8	8	11
Grand Total	115	107	222
Percent	51.8%	48.2%	
ADT		ADT: 111	AADT: 111




WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Sunridge _Counter #1
data file 09 27 2020
Date Printed: 10/2/2020
Start Date: 9/23/2020
End Date: 9/24/2020
GPS Accuracy: 0 ft
Location Verified: No

Station ID:
Location 1:
Location 2:
Latitude: 35.058628
Longitude: -106.736169

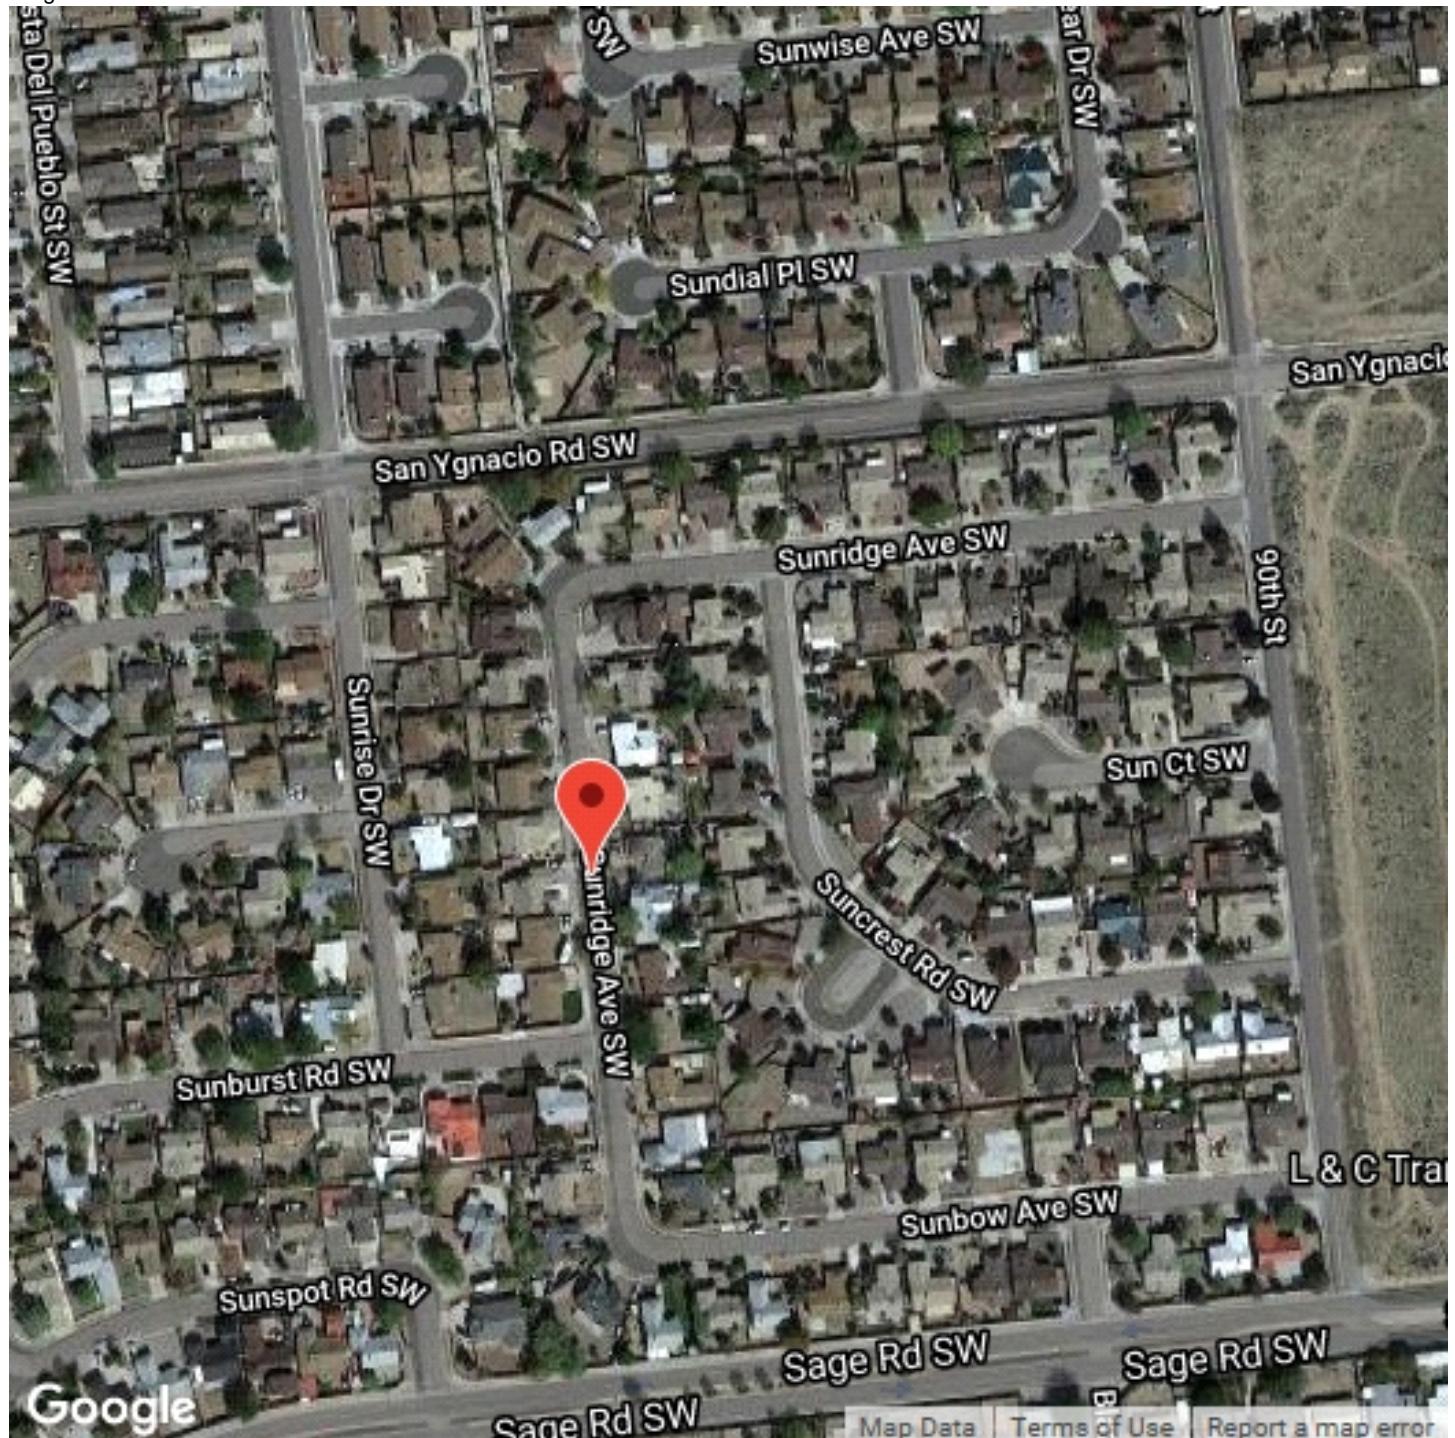

Google

[Map Data](#) | [Terms of Use](#) | [Report a map error](#)



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Sunridge _Counter #1
data file 09 27 2020
Date Printed: 10/2/2020
Start Date: 9/23/2020
End Date: 9/24/2020
GPS Accuracy: 0 ft
Location Verified: No

Latitude: 35.058628
Longitude: -106.736169
Direction: South, A to B

9/23/2020	0 - 15	> 15 - 20 MPH	> 20 - 25 MPH	> 25 - 30 MPH	> 30 - 35 MPH	> 35 - 40 MPH	> 40 - 45 MPH	> 45 - 50 MPH	> 50 - 55 MPH	> 55 - 60 MPH	> 60 - 65 MPH	> 65 - 70 MPH	> 70 MPH	Total
Time	MPH	20 MPH	25 MPH	30 MPH	35 MPH	40 MPH	45 MPH	50 MPH	55 MPH	60 MPH	65 MPH	70 MPH	MPH	
12:00 AM	0	0	0	0	0	0	0	0	0	0	0	0	0	0
1:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
2:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
3:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
4:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
5:00	1	0	1	0	0	0	0	0	0	0	0	0	0	2
6:00	1	2	1	0	0	0	0	0	0	0	0	0	0	4
7:00	0	0	0	1	0	0	0	0	0	0	0	0	0	1
8:00	1	0	1	0	0	0	0	0	0	0	0	0	0	2
9:00	2	1	2	0	0	0	0	0	0	0	0	0	0	5
10:00	0	1	0	0	0	0	0	0	0	0	0	0	0	1
11:00	2	0	2	0	0	0	0	0	0	0	0	0	0	4
12:00 PM	1	2	0	1	0	0	0	0	0	0	0	0	0	4
1:00	3	0	1	1	0	0	0	0	0	0	0	0	0	5
2:00	1	0	0	1	1	0	0	0	0	0	0	0	0	3
3:00	2	1	3	2	0	0	0	0	0	0	0	0	0	8
4:00	2	1	1	1	0	0	0	0	0	0	0	0	0	5
5:00	1	1	0	0	0	0	0	0	0	0	0	0	0	2
6:00	2	2	0	0	0	0	0	0	0	0	0	0	0	4
7:00	2	0	0	0	0	0	0	0	0	0	0	0	0	2
8:00	0	2	0	0	0	0	0	0	0	0	0	0	0	2
9:00	0	1	1	0	0	0	0	0	0	0	0	0	0	2
10:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
11:00	1	0	0	0	0	0	0	0	0	0	0	0	0	1
Total	22	14	13	7	1	0	0	0	0	0	0	0	0	57



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Sunridge _Counter #1
data file 09 27 2020
Date Printed: 10/2/2020
Start Date: 9/23/2020
End Date: 9/24/2020
GPS Accuracy: 0 ft
Location Verified: No

Latitude: 35.058628
Longitude: -106.736169
Direction: South, A to B

9/24/2020	0 - 15 MPH	> 15 - 20 MPH	> 20 - 25 MPH	> 25 - 30 MPH	> 30 - 35 MPH	> 35 - 40 MPH	> 40 - 45 MPH	> 45 - 50 MPH	> 50 - 55 MPH	> 55 - 60 MPH	> 60 - 65 MPH	> 65 - 70 MPH	> 70 MPH	Total
12:00 AM	0	0	0	0	0	0	0	0	0	0	0	0	0	0
1:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
2:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
3:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
4:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
5:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
6:00	2	0	0	0	1	0	0	0	0	0	0	0	0	3
7:00	0	1	2	1	0	0	0	0	0	0	0	0	0	4
8:00	3	0	2	1	0	0	0	0	0	0	0	0	0	6
9:00	3	0	1	1	0	0	0	0	0	0	0	0	0	5
10:00	3	1	0	0	0	0	0	0	0	0	0	0	0	4
11:00	0	1	0	0	0	0	0	0	0	0	0	0	0	1
12:00 PM	0	0	1	0	0	0	0	0	0	0	0	0	0	1
1:00	0	1	0	0	0	0	0	0	0	0	0	0	0	1
2:00	2	0	1	0	0	0	0	0	0	0	0	0	0	3
3:00	3	2	0	1	0	0	0	0	0	0	0	0	0	6
4:00	0	3	1	0	0	0	0	0	0	0	0	0	0	4
5:00	0	1	0	0	0	0	0	0	0	0	0	0	0	1
6:00	3	2	1	0	0	0	0	0	0	0	0	0	0	6
7:00	3	4	1	0	0	0	0	0	0	0	0	0	0	8
8:00	0	2	0	1	0	0	0	0	0	0	0	0	0	3
9:00	1	0	0	0	0	0	0	0	0	0	0	0	0	1
10:00	1	0	0	0	0	0	0	0	0	0	0	0	0	1
11:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
Total	24	18	10	5	1	0	0	0	0	0	0	0	0	58
Grand Total	46	32	23	12	2	0	0	0	0	0	0	0	0	115
Stats	Percentile Speed	15th	50th	85th	95th									
	Mean Speed (Average)	21.4	10.9	16.8	24.1	27.7								
	10 MPH Pace Speed	15-24												
	Number in Pace	55												
	Percent in Pace	79.0%												
	Number > 25 MPH	14												
	Percent > 25 MPH	20.3%												



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Sunridge _Counter #1
data file 09 27 2020
Date Printed: 10/2/2020
Start Date: 9/23/2020
End Date: 9/24/2020
GPS Accuracy: 0 ft
Location Verified: No

Latitude: 35.058628
Longitude: -106.736169
Direction: North, B to A

9/23/2020	0 - 15 MPH	> 15 - 20 MPH	> 20 - 25 MPH	> 25 - 30 MPH	> 30 - 35 MPH	> 35 - 40 MPH	> 40 - 45 MPH	> 45 - 50 MPH	> 50 - 55 MPH	> 55 - 60 MPH	> 60 - 65 MPH	> 65 - 70 MPH	> 70 MPH	Total
12:00 AM	0	0	0	0	0	0	0	0	0	0	0	0	0	0
1:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
2:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
3:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
4:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
5:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
6:00	0	1	0	0	0	0	0	0	0	0	0	0	0	1
7:00	0	0	1	0	0	0	0	0	0	0	0	0	0	1
8:00	0	1	1	0	0	0	0	0	0	0	0	0	0	2
9:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
10:00	0	0	1	0	0	0	0	0	0	0	0	0	0	1
11:00	1	1	0	0	0	0	0	0	0	0	0	0	0	2
12:00 PM	0	2	2	0	0	0	0	0	0	0	0	0	0	4
1:00	2	1	0	1	0	0	0	0	0	0	0	0	0	4
2:00	0	0	1	1	0	0	0	0	0	0	0	0	0	2
3:00	2	1	2	0	0	0	0	0	0	0	0	0	0	5
4:00	4	0	0	1	0	0	0	0	0	0	0	0	0	5
5:00	1	0	2	1	0	0	0	0	0	0	0	0	0	4
6:00	2	1	1	0	0	0	0	0	0	0	0	0	0	4
7:00	1	1	1	0	0	0	0	0	0	0	0	0	0	3
8:00	2	1	1	0	0	1	0	0	0	0	0	0	0	5
9:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
10:00	1	1	0	0	0	0	0	0	0	0	0	0	0	2
11:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
Total	16	11	13	4	0	1	0	0	0	0	0	0	0	45



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Sunridge _Counter #1
data file 09 27 2020
Date Printed: 10/2/2020
Start Date: 9/23/2020
End Date: 9/24/2020
GPS Accuracy: 0 ft
Location Verified: No

Latitude: 35.058628
Longitude: -106.736169
Direction: North, B to A

9/24/2020	0 - 15 MPH	> 15 - 20 MPH	> 20 - 25 MPH	> 25 - 30 MPH	> 30 - 35 MPH	> 35 - 40 MPH	> 40 - 45 MPH	> 45 - 50 MPH	> 50 - 55 MPH	> 55 - 60 MPH	> 60 - 65 MPH	> 65 - 70 MPH	> 70 MPH	Total
Time														
12:00 AM	0	0	0	0	0	0	0	0	0	0	0	0	0	0
1:00	0	0	1	0	0	0	0	0	0	0	0	0	0	1
2:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
3:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
4:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
5:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
6:00	1	1	0	0	0	0	0	0	0	0	0	0	0	2
7:00	1	1	1	0	0	0	0	0	0	0	0	0	0	3
8:00	1	1	2	1	0	0	0	0	0	0	0	0	0	5
9:00	4	0	0	0	0	0	0	0	0	0	0	0	0	4
10:00	0	1	1	1	0	0	0	0	0	0	0	0	0	3
11:00	2	1	1	0	0	0	0	0	0	0	0	0	0	4
12:00 PM	0	0	0	0	0	0	0	0	0	0	0	0	0	0
1:00	1	3	2	1	0	0	0	0	0	0	0	0	0	7
2:00	1	4	2	1	0	0	0	0	0	0	0	0	0	8
3:00	3	2	0	0	0	0	0	0	0	0	0	0	0	5
4:00	3	0	0	0	0	0	0	0	0	0	0	0	0	3
5:00	0	1	7	0	0	0	0	0	0	0	0	0	0	8
6:00	0	0	2	0	0	0	0	0	0	0	0	0	0	2
7:00	1	0	0	0	0	0	0	0	0	0	0	0	0	1
8:00	2	0	1	0	0	0	0	0	0	0	0	0	0	3
9:00	1	0	1	0	0	0	0	0	0	0	0	0	0	2
10:00	0	0	0	0	1	0	0	0	0	0	0	0	0	1
11:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
Total	21	15	21	4	1	0	0	0	0	0	0	0	0	62
Grand Total	37	26	34	8	1	1	0	0	0	0	0	0	0	107
Stats	Percentile Speed	15th	50th	85th	95th									
	Mean Speed (Average)	21.6	0.9	17.6	23.8	26.4								
	10 MPH Pace Speed	15-24												
	Number in Pace	59												
	Percent in Pace	85.0%												
	Number > 25 MPH	10												
	Percent > 25 MPH	14.3%												




WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Sunridge _Counter #1
data file 09 27 2020
Date Printed: 10/2/2020
Start Date: 9/23/2020
End Date: 9/24/2020
GPS Accuracy: 0 ft
Location Verified: No

Latitude: 35.058628
Longitude: -106.736169

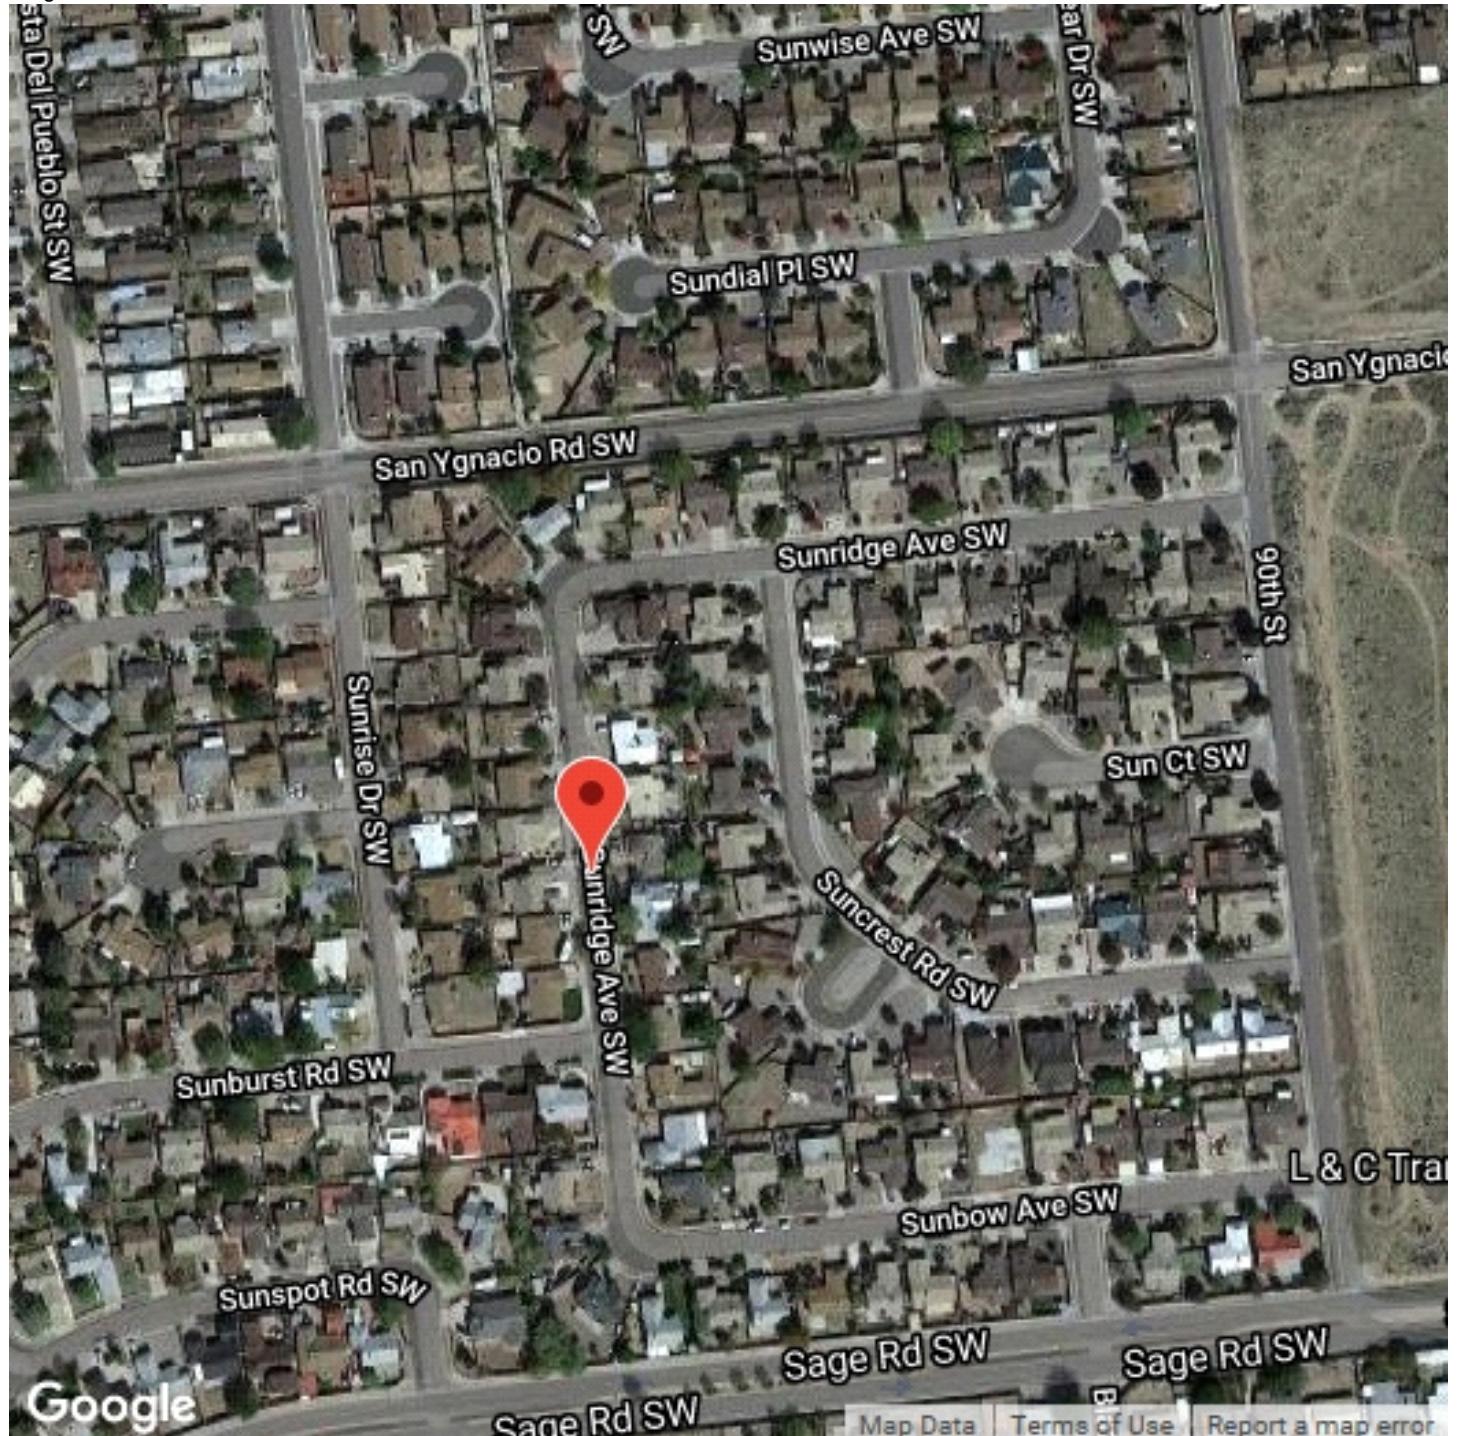



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

Speed Enforcement Evaluator



Analysis Dates

Start: 9/23/2020

End: 9/23/2020

Total Percentage of Enforceable Violations

Posted Speed Limit 25 MPH
Enforcement Tolerance 5 MPH

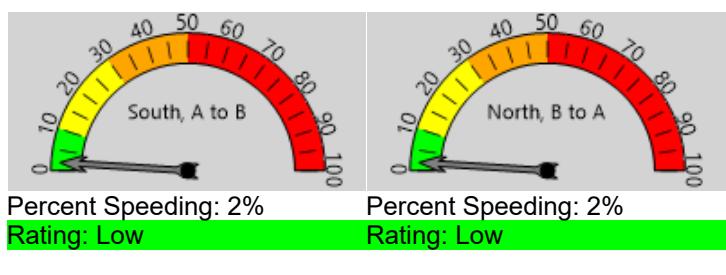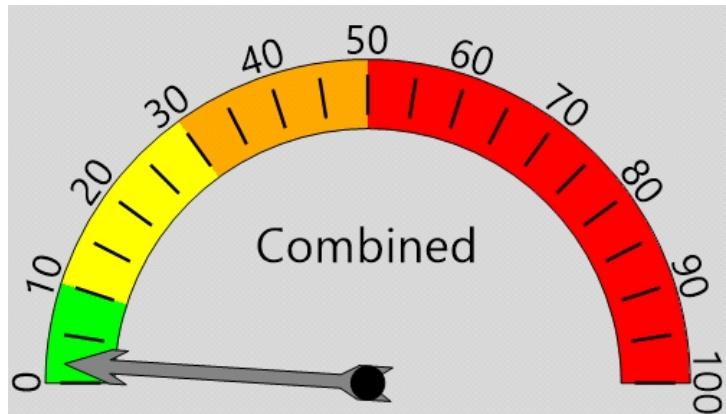

Vehicle Totals - Combined

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
38	25	26	11	1	1	0	0	0	0	0	0	0

85th Percentile: 26.1

Vehicle Totals - South, A to B

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
22	14	13	7	1	0	0	0	0	0	0	0	0

85th Percentile: 24.8

Vehicle Totals - North, B to A

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
16	11	13	4	0	1	0	0	0	0	0	0	0

85th Percentile: 27.2



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

Speed Enforcement Evaluator



Analysis Dates

Start: 9/24/2020

End: 9/24/2020

Total Percentage of Enforceable Violations

Posted Speed Limit 25 MPH
Enforcement Tolerance 5 MPH

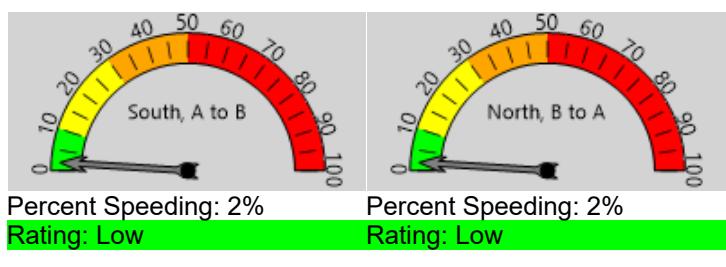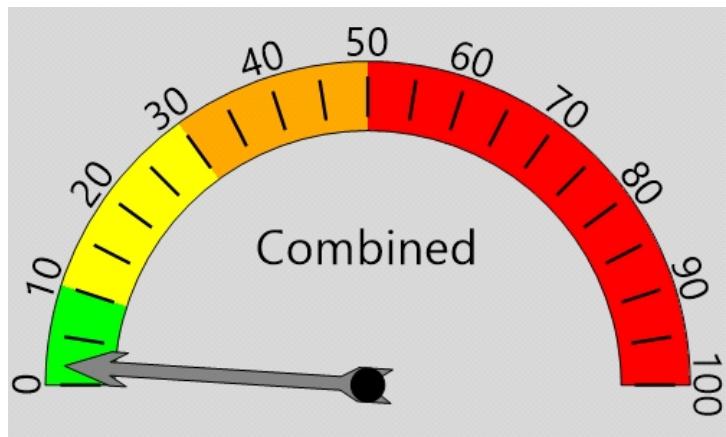

Vehicle Totals - Combined

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
45	33	31	9	2	0	0	0	0	0	0	0	0

85th Percentile: 28.7

Vehicle Totals - South, A to B

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
24	18	10	5	1	0	0	0	0	0	0	0	0

85th Percentile: 26.8

Vehicle Totals - North, B to A

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
21	15	21	4	1	0	0	0	0	0	0	0	0

85th Percentile: 27.2



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

Speed Enforcement Evaluator



Analysis Dates

Start: 9/23/2020

End: 9/23/2020

Total Percentage of Enforceable Violations

Posted Speed Limit 25 MPH
Enforcement Tolerance 7 MPH

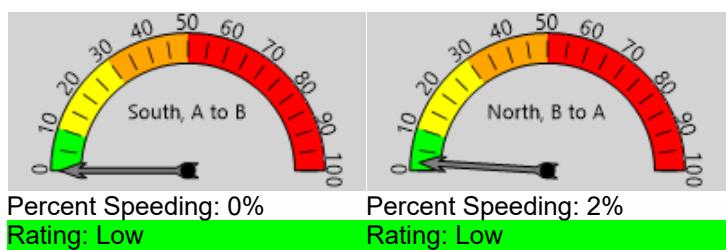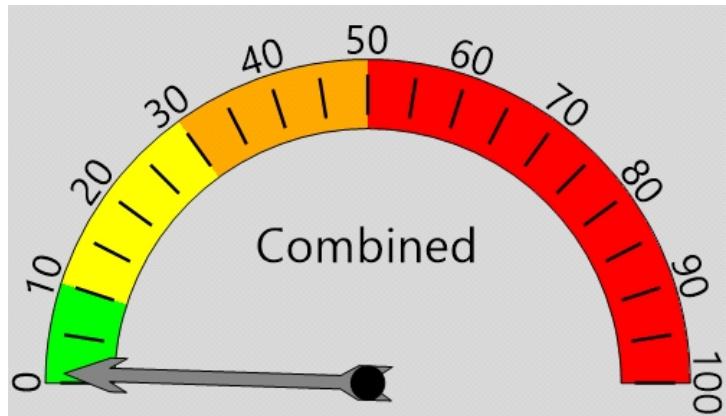

Vehicle Totals - Combined

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
38	25	26	11	1	1	0	0	0	0	0	0	0

85th Percentile: 26.1

Vehicle Totals - South, A to B

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
22	14	13	7	1	0	0	0	0	0	0	0	0

85th Percentile: 24.8

Vehicle Totals - North, B to A

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
16	11	13	4	0	1	0	0	0	0	0	0	0

85th Percentile: 27.2



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

Speed Enforcement Evaluator



Analysis Dates

Start: 9/24/2020

End: 9/24/2020

Total Percentage of Enforceable Violations

Posted Speed Limit 25 MPH
Enforcement Tolerance 7 MPH

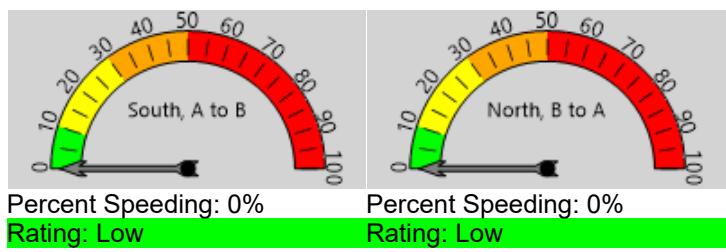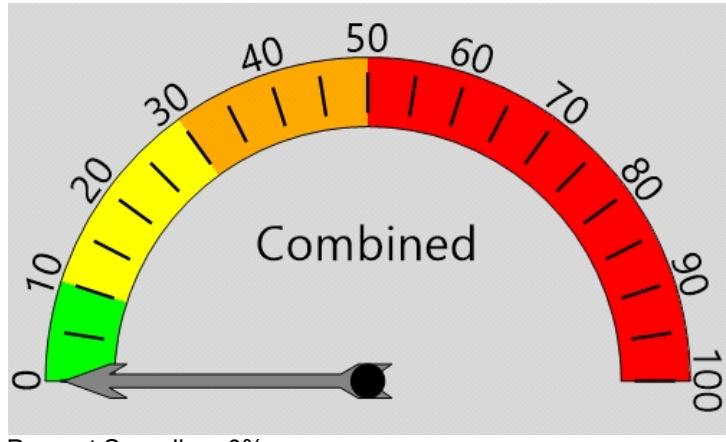

Vehicle Totals - Combined

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
45	33	31	9	2	0	0	0	0	0	0	0	0

85th Percentile: 28.7

Vehicle Totals - South, A to B

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
24	18	10	5	1	0	0	0	0	0	0	0	0

85th Percentile: 26.8

Vehicle Totals - North, B to A

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
21	15	21	4	1	0	0	0	0	0	0	0	0

85th Percentile: 27.2



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Sunridge _Counter #1

data file 09 27 2020

Date Printed: 10/2/2020

Start Date: 9/23/2020

End Date: 9/24/2020

GPS Accuracy: 0 ft

Location Verified: No

Latitude: 35.058628

Longitude: -106.736169

Direction: South, A to B

9/23/2020 Time	Motor Cycles	Cars & Trailers	2 Axle Long	Buses	2 Axle 6 Tire	3 Axle Single	4 Axle Single	<5 Axl Double	5 Axle Double	>6 Axl Double	<6 Axl Multi	6 Axle Multi	>6 Axl Multi	No Class	Total
12:00 AM	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
1:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
2:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
3:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
4:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
5:00	0	1	1	0	0	0	0	0	0	0	0	0	0	0	2
6:00	0	4	0	0	0	0	0	0	0	0	0	0	0	0	4
7:00	0	0	1	0	0	0	0	0	0	0	0	0	0	0	1
8:00	0	1	1	0	0	0	0	0	0	0	0	0	0	0	2
9:00	0	2	3	0	0	0	0	0	0	0	0	0	0	0	5
10:00	0	1	0	0	0	0	0	0	0	0	0	0	0	0	1
11:00	0	2	1	0	1	0	0	0	0	0	0	0	0	0	4
12:00 PM	0	2	1	0	1	0	0	0	0	0	0	0	0	0	4
1:00	0	2	1	0	2	0	0	0	0	0	0	0	0	0	5
2:00	0	2	1	0	0	0	0	0	0	0	0	0	0	0	3
3:00	0	4	4	0	0	0	0	0	0	0	0	0	0	0	8
4:00	0	3	1	0	1	0	0	0	0	0	0	0	0	0	5
5:00	0	1	1	0	0	0	0	0	0	0	0	0	0	0	2
6:00	1	1	2	0	0	0	0	0	0	0	0	0	0	0	4
7:00	0	1	0	0	1	0	0	0	0	0	0	0	0	0	2
8:00	0	1	1	0	0	0	0	0	0	0	0	0	0	0	2
9:00	0	2	0	0	0	0	0	0	0	0	0	0	0	0	2
10:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
11:00	0	1	0	0	0	0	0	0	0	0	0	0	0	0	1
Total	1	31	19	0	6	0	0	0	0	0	0	0	0	0	57
Percent	1.8%	54.4%	33.3%	0.0%	10.5%	0.0%	0.0%	0.0%	0.0%	0.0%	0.0%	0.0%	0.0%	0.0%	
AM Peak		6:00	9:00		11:00										9:00
	*	4	3	*	1	*	*	*	*	*	*	*	*	*	5
PM Peak	6:00	3:00	3:00		1:00										3:00
	1	4	4	*	2	*	*	*	*	*	*	*	*	*	8



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Sunridge _Counter #1

data file 09 27 2020

Date Printed: 10/2/2020

Start Date: 9/23/2020

End Date: 9/24/2020

GPS Accuracy: 0 ft

Location Verified: No

Latitude: 35.058628

Longitude: -106.736169

Direction: South, A to B

9/24/2020 Time	Motor Cycles	Cars & Trailers	2 Axle Long	Buses	2 Axle 6 Tire	3 Axle Single	4 Axle Single	<5 Axl Double	5 Axle Double	>6 Axl Double	<6 Axl Multi	6 Axle Multi	>6 Axl Multi	No Class	Total
12:00 AM	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
1:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
2:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
3:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
4:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
5:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
6:00	0	2	1	0	0	0	0	0	0	0	0	0	0	0	3
7:00	0	3	1	0	0	0	0	0	0	0	0	0	0	0	4
8:00	0	3	0	0	1	0	0	0	0	0	0	0	0	0	6
9:00	0	1	2	0	0	1	0	0	0	0	0	0	0	1	5
10:00	0	2	0	0	0	0	0	0	0	0	0	0	0	2	4
11:00	0	1	0	0	0	0	0	0	0	0	0	0	0	0	1
12:00 PM	0	0	0	0	1	0	0	0	0	0	0	0	0	0	1
1:00	0	0	0	0	1	0	0	0	0	0	0	0	0	0	1
2:00	0	2	0	0	1	0	0	0	0	0	0	0	0	0	3
3:00	0	1	2	0	0	1	0	0	0	0	0	0	0	2	6
4:00	0	1	2	0	1	0	0	0	0	0	0	0	0	0	4
5:00	0	1	0	0	0	0	0	0	0	0	0	0	0	0	1
6:00	0	3	1	0	1	0	0	1	0	0	0	0	0	0	6
7:00	0	3	5	0	0	0	0	0	0	0	0	0	0	0	8
8:00	0	3	0	0	0	0	0	0	0	0	0	0	0	0	3
9:00	0	1	0	0	0	0	0	0	0	0	0	0	0	0	1
10:00	1	0	0	0	0	0	0	0	0	0	0	0	0	0	1
11:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
Total	1	27	14	0	6	2	0	1	0	0	0	0	0	7	58
Percent	1.7%	46.6%	24.1%	0.0%	10.3%	3.4%	0.0%	1.7%	0.0%	0.0%	0.0%	0.0%	0.0%	12.1%	
AM Peak		7:00	9:00		8:00	9:00								8:00	8:00
	*	3	2	*	1	1	*	*	*	*	*	*	*	2	6
PM Peak	10:00	6:00	7:00		12:00	3:00		6:00						3:00	7:00
	1	3	5	*	1	1	*	1	*	*	*	*	*	2	8
Grand Total	2	58	33	0	12	2	0	1	0	0	0	0	0	7	115
Percent	1.7%	50.4%	28.7%	0.0%	10.4%	1.7%	0.0%	0.9%	0.0%	0.0%	0.0%	0.0%	0.0%	6.1%	



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Sunridge _Counter #1
data file 09 27 2020
Date Printed: 10/2/2020
Start Date: 9/23/2020
End Date: 9/24/2020
GPS Accuracy: 0 ft
Location Verified: No

Latitude: 35.058628
Longitude: -106.736169
Direction: North, B to A

9/23/2020 Time	Motor Cycles	Cars & Trailers	2 Axle Long	Buses	2 Axle 6 Tire	3 Axle Single	4 Axle Single	<5 Axl Double	5 Axle Double	>6 Axl Double	<6 Axl Multi	6 Axle Multi	>6 Axl Multi	No Class	Total
12:00 AM	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
1:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
2:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
3:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
4:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
5:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
6:00	0	1	0	0	0	0	0	0	0	0	0	0	0	0	1
7:00	0	0	1	0	0	0	0	0	0	0	0	0	0	0	1
8:00	0	1	1	0	0	0	0	0	0	0	0	0	0	0	2
9:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
10:00	0	1	0	0	0	0	0	0	0	0	0	0	0	0	1
11:00	0	0	1	0	1	0	0	0	0	0	0	0	0	0	2
12:00 PM	0	1	3	0	0	0	0	0	0	0	0	0	0	0	4
1:00	0	2	2	0	0	0	0	0	0	0	0	0	0	0	4
2:00	0	0	2	0	0	0	0	0	0	0	0	0	0	0	2
3:00	0	1	2	0	0	0	0	0	0	0	0	0	0	0	5
4:00	0	1	0	0	1	0	0	0	0	0	0	0	0	0	5
5:00	0	3	1	0	0	0	0	0	0	0	0	0	0	0	4
6:00	0	1	1	0	0	0	0	0	0	0	0	0	0	0	4
7:00	0	0	3	0	0	0	0	0	0	0	0	0	0	0	3
8:00	0	5	0	0	0	0	0	0	0	0	0	0	0	0	5
9:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
10:00	0	1	0	0	1	0	0	0	0	0	0	0	0	0	2
11:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
Total	0	18	17	0	3	0	0	0	0	0	0	0	0	7	45
Percent	0.0%	40.0%	37.8%	0.0%	6.7%	0.0%	0.0%	0.0%	0.0%	0.0%	0.0%	0.0%	0.0%	15.6%	
AM Peak		6:00	7:00		11:00										8:00
	*	1	1	*	1	*	*	*	*	*	*	*	*	*	2
PM Peak		8:00	12:00		4:00									4:00	3:00
	*	5	3	*	1	*	*	*	*	*	*	*	*	*	5



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Sunridge _Counter #1

data file 09 27 2020

Date Printed: 10/2/2020

Start Date: 9/23/2020

End Date: 9/24/2020

GPS Accuracy: 0 ft

Location Verified: No

Latitude: 35.058628

Longitude: -106.736169

Direction: North, B to A

9/24/2020 Time	Motor Cycles	Cars & Trailers	2 Axle Long	Buses	2 Axle 6 Tire	3 Axle Single	4 Axle Single	<5 Axl Double	5 Axle Double	>6 Axl Double	<6 Axl Multi	6 Axle Multi	>6 Axl Multi	No Class	Total
12:00 AM	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
1:00	0	0	1	0	0	0	0	0	0	0	0	0	0	0	1
2:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
3:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
4:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
5:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
6:00	0	0	1	0	0	0	0	0	0	0	0	0	0	1	2
7:00	0	0	2	0	0	0	0	0	0	0	0	0	0	1	3
8:00	0	1	2	0	1	0	0	0	0	0	0	0	0	1	5
9:00	0	0	0	0	1	1	0	0	0	0	0	0	0	2	4
10:00	0	1	1	1	0	0	0	0	0	0	0	0	0	0	3
11:00	0	2	1	0	0	0	0	0	0	0	0	0	0	1	4
12:00 PM	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
1:00	0	4	2	0	0	0	0	0	0	0	0	0	0	1	7
2:00	0	6	0	0	1	1	0	0	0	0	0	0	0	0	8
3:00	0	1	2	0	0	0	0	0	0	0	0	0	0	2	5
4:00	0	0	2	0	0	0	0	0	0	0	0	0	0	1	3
5:00	0	5	3	0	0	0	0	0	0	0	0	0	0	0	8
6:00	0	0	2	0	0	0	0	0	0	0	0	0	0	0	2
7:00	0	0	0	0	1	0	0	0	0	0	0	0	0	0	1
8:00	0	1	1	0	1	0	0	0	0	0	0	0	0	0	3
9:00	0	0	1	0	0	0	0	0	0	0	0	0	0	1	2
10:00	1	0	0	0	0	0	0	0	0	0	0	0	0	0	1
11:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
Total	1	21	21	1	5	2	0	0	0	0	0	0	0	11	62
Percent	1.6%	33.9%	33.9%	1.6%	8.1%	3.2%	0.0%	0.0%	0.0%	0.0%	0.0%	0.0%	0.0%	17.7%	
AM Peak		11:00	7:00	10:00	8:00	9:00								9:00	8:00
	*	2	2	1	1	1	*	*	*	*	*	*	*	2	5
PM Peak	10:00	2:00	5:00		2:00	2:00								3:00	2:00
	1	6	3	*	1	1	*	*	*	*	*	*	*	2	8
Grand Total	1	39	38	1	8	2	0	0	0	0	0	0	0	18	107
Percent	0.9%	36.4%	35.5%	0.9%	7.5%	1.9%	0.0%	0.0%	0.0%	0.0%	0.0%	0.0%	0.0%	16.8%	





WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Sunridge _Counter #1
data file 09 27 2020
Date Printed: 10/2/2020
Start Date: 9/23/2020
End Date: 9/24/2020
GPS Accuracy: 0 ft
Location Verified: No

Latitude: 35.058628
Longitude: -106.736169

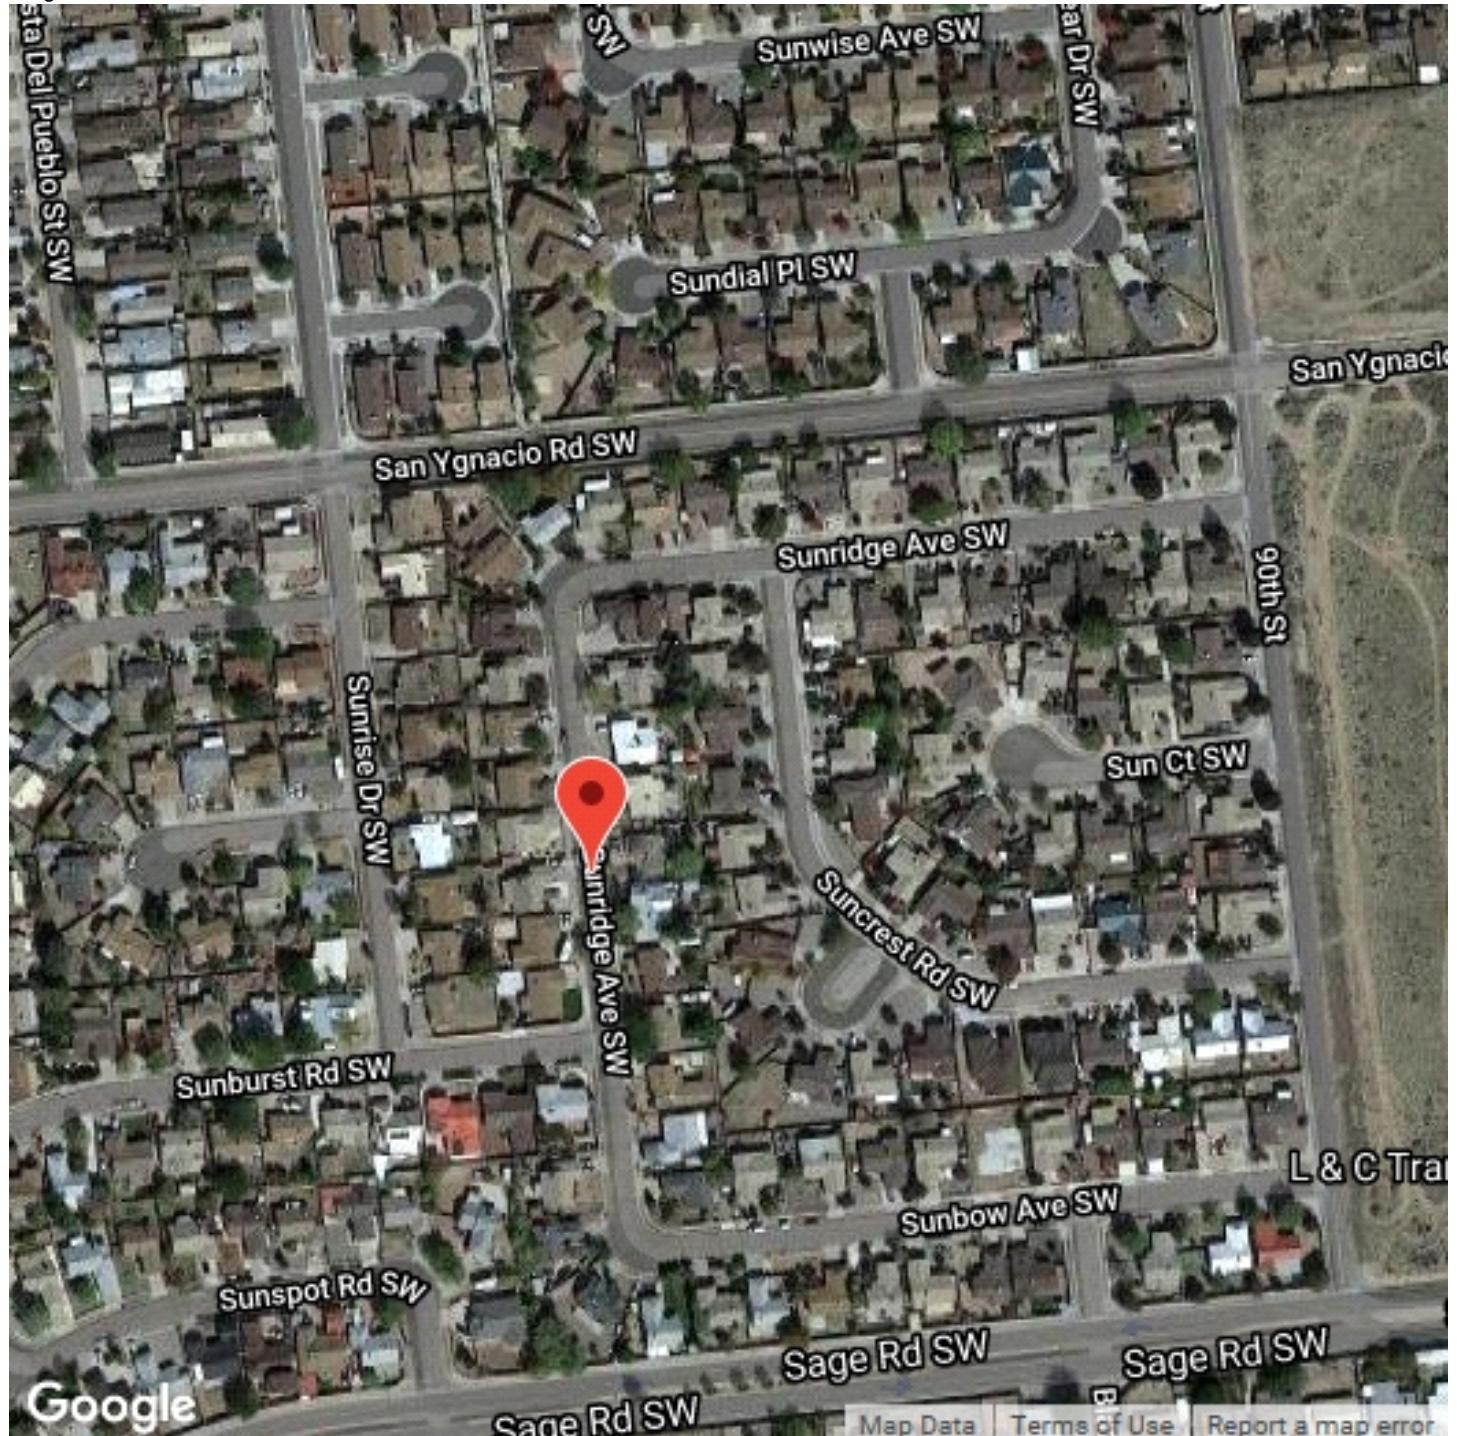

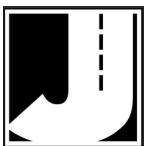

WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

Station ID:
Location 1:
Location 2:
Latitude: 35.059680
Longitude: -106.734837

File Name: Sunridge Counter #2
data file 09 27 2020
Date Printed: 10/2/2020
Start Date: 9/23/2020
End Date: 9/24/2020
GPS Accuracy: 0 ft
Location Verified: No

9/23/2020	East, A to B	West, B to A	Total
Time			
12:00 AM	0	1	1
1:00	0	0	0
2:00	0	0	0
3:00	0	0	0
4:00	0	0	0
5:00	1	3	4
6:00	1	7	8
7:00	3	5	8
8:00	4	5	9
9:00	5	1	6
10:00	5	10	15
11:00	5	6	11
12:00 PM	5	7	12
1:00	11	2	13
2:00	6	7	13
3:00	15	8	23
4:00	21	5	26
5:00	11	8	19
6:00	11	12	23
7:00	7	7	14
8:00	7	4	11
9:00	4	1	5
10:00	0	1	1
11:00	2	0	2
Total	124	100	224
Percent	55.4%	44.6%	
AM Peak	9:00	10:00	10:00
Volume	5	10	15
PM Peak	4:00	6:00	4:00
Volume	21	12	26



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Sunridge Counter #2
data file 09 27 2020
Date Printed: 10/2/2020
Start Date: 9/23/2020
End Date: 9/24/2020
GPS Accuracy: 0 ft
Location Verified: No

Station ID:
Location 1:
Location 2:
Latitude: 35.059680
Longitude: -106.734837

9/24/2020	East, A to B	West, B to A	Total
Time			
12:00 AM	1	0	1
1:00	3	1	4
2:00	1	1	2
3:00	0	0	0
4:00	0	0	0
5:00	1	2	3
6:00	0	9	9
7:00	1	7	8
8:00	6	9	15
9:00	9	11	20
10:00	2	9	11
11:00	6	7	13
12:00 PM	2	4	6
1:00	5	6	11
2:00	8	13	21
3:00	11	6	17
4:00	20	0	20
5:00	21	0	21
6:00	19	0	19
7:00	15	5	20
8:00	8	4	12
9:00	5	1	6
10:00	1	0	1
11:00	3	2	5
Total	148	97	245
Percent	60.4%	39.6%	
AM Peak	9:00	9:00	9:00
Volume	9	11	20
PM Peak	5:00	2:00	2:00
Volume	21	13	21
Grand Total	272	197	469
Percent ADT	58.0%	42.0%	
		ADT: 234	AADT: 234




WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

Station ID:
Location 1:
Location 2:
Latitude: 35.059680
Longitude: -106.734837

File Name: Sunridge Counter #2
data file 09 27 2020
Date Printed: 10/2/2020
Start Date: 9/23/2020
End Date: 9/24/2020
GPS Accuracy: 0 ft
Location Verified: No

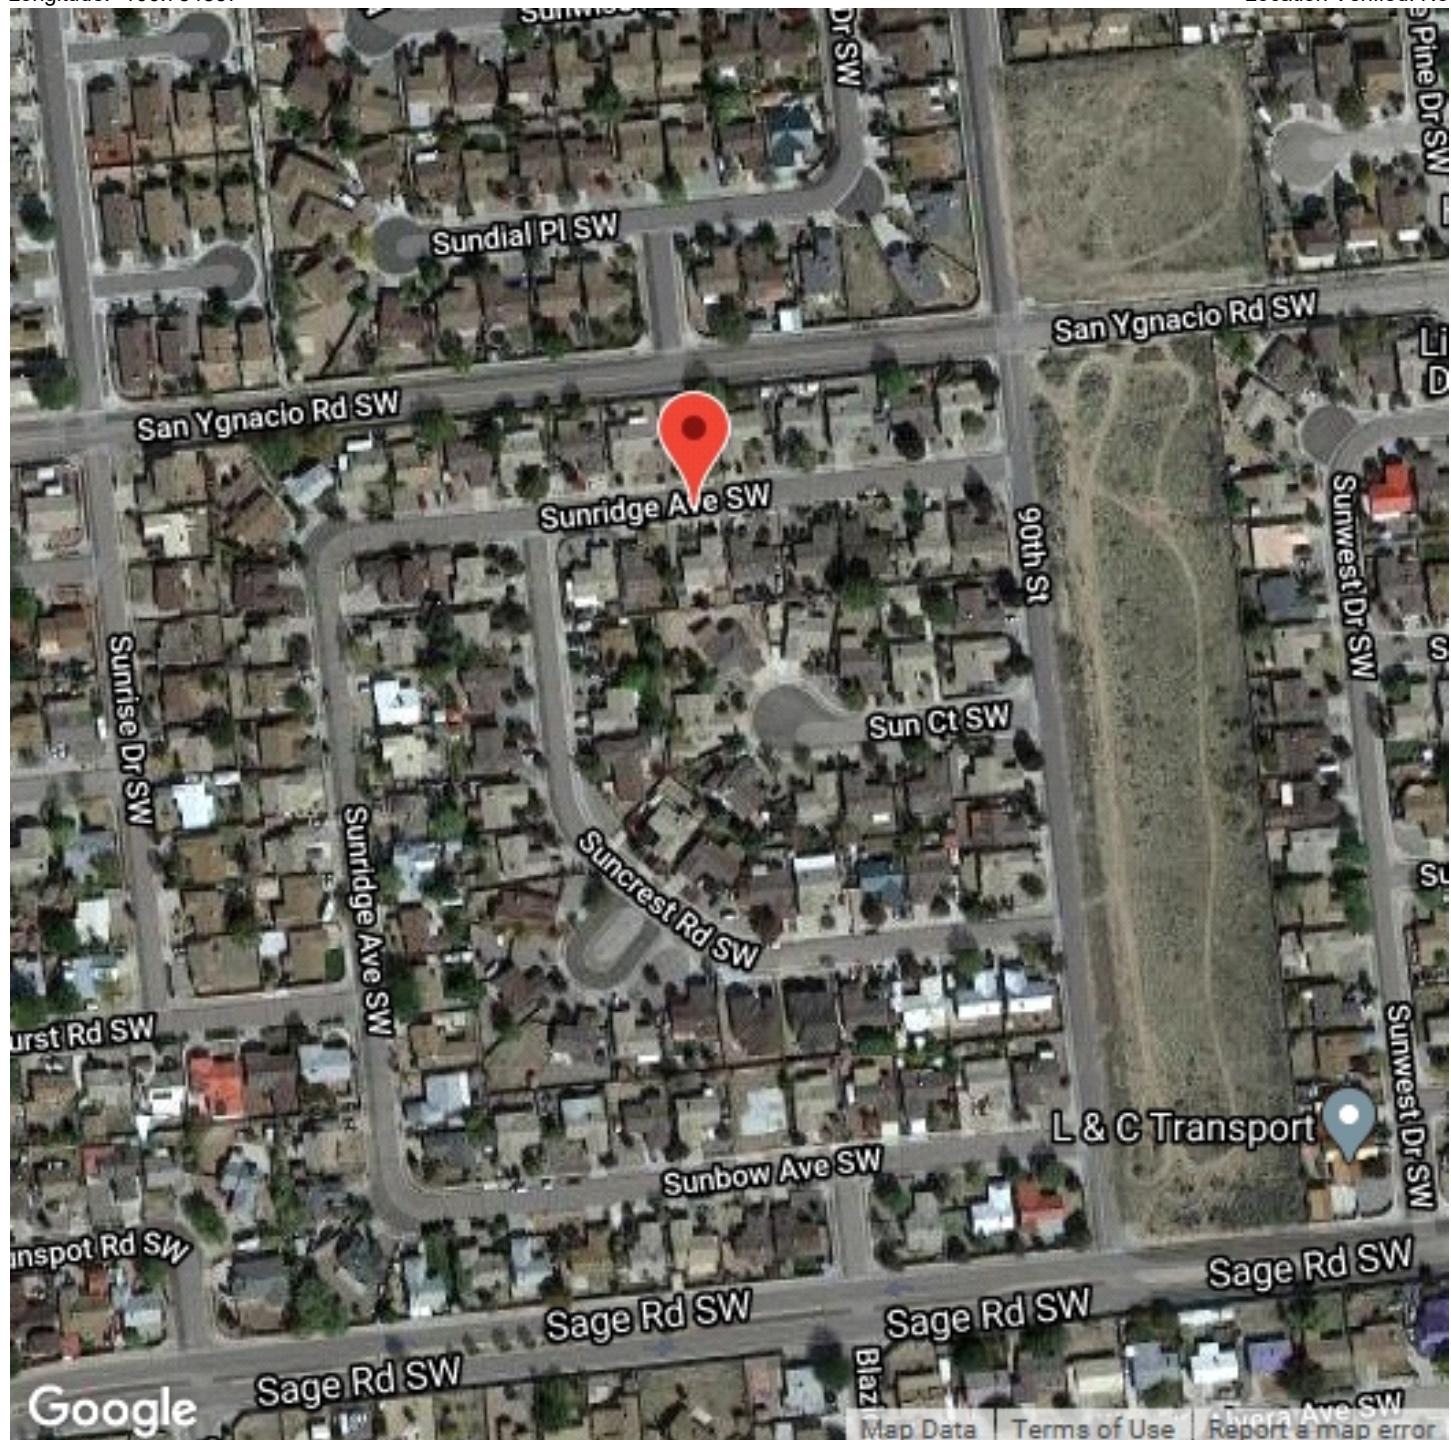



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Sunridge Counter #2
data file 09 27 2020
Date Printed: 10/2/2020
Start Date: 9/23/2020
End Date: 9/24/2020
GPS Accuracy: 0 ft
Location Verified: No

Latitude: 35.059680
Longitude: -106.734837
Direction: East, A to B

9/23/2020	0 - 15	> 15 - 20 MPH	> 20 - 25 MPH	> 25 - 30 MPH	> 30 - 35 MPH	> 35 - 40 MPH	> 40 - 45 MPH	> 45 - 50 MPH	> 50 - 55 MPH	> 55 - 60 MPH	> 60 - 65 MPH	> 65 - 70 MPH	> 70 MPH	Total
Time	Time	Time	Time	Time	Time	Time	Time	Time	Time	Time	Time	Time	Time	Time
12:00 AM	0	0	0	0	0	0	0	0	0	0	0	0	0	0
1:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
2:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
3:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
4:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
5:00	0	0	0	1	0	0	0	0	0	0	0	0	0	1
6:00	0	0	1	0	0	0	0	0	0	0	0	0	0	1
7:00	1	0	1	1	0	0	0	0	0	0	0	0	0	3
8:00	0	1	1	2	0	0	0	0	0	0	0	0	0	4
9:00	0	1	1	0	2	1	0	0	0	0	0	0	0	5
10:00	0	1	1	1	2	0	0	0	0	0	0	0	0	5
11:00	0	2	1	1	1	0	0	0	0	0	0	0	0	5
12:00 PM	1	1	2	0	1	0	0	0	0	0	0	0	0	5
1:00	3	0	4	4	0	0	0	0	0	0	0	0	0	11
2:00	1	1	1	3	0	0	0	0	0	0	0	0	0	6
3:00	2	5	3	3	2	0	0	0	0	0	0	0	0	15
4:00	5	2	5	6	2	1	0	0	0	0	0	0	0	21
5:00	2	3	0	5	1	0	0	0	0	0	0	0	0	11
6:00	0	4	4	2	1	0	0	0	0	0	0	0	0	11
7:00	2	1	4	0	0	0	0	0	0	0	0	0	0	7
8:00	1	3	2	1	0	0	0	0	0	0	0	0	0	7
9:00	0	1	1	1	0	1	0	0	0	0	0	0	0	4
10:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
11:00	0	0	0	0	1	0	1	0	0	0	0	0	0	2
Total	18	26	32	31	13	3	1	0	0	0	0	0	0	124



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Sunridge Counter #2
data file 09 27 2020
Date Printed: 10/2/2020
Start Date: 9/23/2020
End Date: 9/24/2020
GPS Accuracy: 0 ft
Location Verified: No

Latitude: 35.059680
Longitude: -106.734837
Direction: East, A to B

9/24/2020	0 - 15	> 15 - 20	> 20 - 25	> 25 - 30	> 30 - 35	> 35 - 40	> 40 - 45	> 45 - 50	> 50 - 55	> 55 - 60	> 60 - 65	> 65 - 70	> 70 - 75	Total
Time	MPH	20 MPH	25 MPH	30 MPH	35 MPH	40 MPH	45 MPH	50 MPH	55 MPH	60 MPH	65 MPH	70 MPH	75 MPH	
12:00 AM	0	0	1	0	0	0	0	0	0	0	0	0	0	1
1:00	1	0	1	1	0	0	0	0	0	0	0	0	0	3
2:00	0	0	1	0	0	0	0	0	0	0	0	0	0	1
3:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
4:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
5:00	0	0	0	1	0	0	0	0	0	0	0	0	0	1
6:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
7:00	0	0	1	0	0	0	0	0	0	0	0	0	0	1
8:00	2	0	3	1	0	0	0	0	0	0	0	0	0	6
9:00	3	1	2	1	2	0	0	0	0	0	0	0	0	9
10:00	1	0	0	1	0	0	0	0	0	0	0	0	0	2
11:00	0	3	1	2	0	0	0	0	0	0	0	0	0	6
12:00 PM	0	0	2	0	0	0	0	0	0	0	0	0	0	2
1:00	1	2	2	0	0	0	0	0	0	0	0	0	0	5
2:00	4	2	2	0	0	0	0	0	0	0	0	0	0	8
3:00	9	0	1	1	0	0	0	0	0	0	0	0	0	11
4:00	20	0	0	0	0	0	0	0	0	0	0	0	0	20
5:00	21	0	0	0	0	0	0	0	0	0	0	0	0	21
6:00	19	0	0	0	0	0	0	0	0	0	0	0	0	19
7:00	3	6	4	2	0	0	0	0	0	0	0	0	0	15
8:00	1	2	4	0	0	0	0	1	0	0	0	0	0	8
9:00	2	2	1	0	0	0	0	0	0	0	0	0	0	5
10:00	0	0	0	1	0	0	0	0	0	0	0	0	0	1
11:00	2	0	0	0	1	0	0	0	0	0	0	0	0	3
Total	89	18	26	11	3	0	0	1	0	0	0	0	0	148
Grand Total	107	44	58	42	16	3	1	1	0	0	0	0	0	272

Stats	Percentile	15th	50th	85th	95th
Speed	0	18.5	27.5	31.1	
Mean Speed (Average)	24.0				
10 MPH Pace Speed	16-25				
Number in Pace	102				
Percent in Pace	62.0%				
Number > 25 MPH	63				
Percent > 25 MPH	38.2%				



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Sunridge Counter #2
data file 09 27 2020
Date Printed: 10/2/2020
Start Date: 9/23/2020
End Date: 9/24/2020
GPS Accuracy: 0 ft
Location Verified: No

Latitude: 35.059680
Longitude: -106.734837
Direction: West, B to A

9/23/2020	0 - 15 MPH	> 15 - 20 MPH	> 20 - 25 MPH	> 25 - 30 MPH	> 30 - 35 MPH	> 35 - 40 MPH	> 40 - 45 MPH	> 45 - 50 MPH	> 50 - 55 MPH	> 55 - 60 MPH	> 60 - 65 MPH	> 65 - 70 MPH	> 70 MPH	Total
Time														
12:00 AM	0	0	0	0	1	0	0	0	0	0	0	0	0	1
1:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
2:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
3:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
4:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
5:00	0	0	0	2	1	0	0	0	0	0	0	0	0	3
6:00	0	2	2	2	1	0	0	0	0	0	0	0	0	7
7:00	0	0	3	0	2	0	0	0	0	0	0	0	0	5
8:00	0	1	0	2	1	1	0	0	0	0	0	0	0	5
9:00	0	0	0	1	0	0	0	0	0	0	0	0	0	1
10:00	0	1	1	6	2	0	0	0	0	0	0	0	0	10
11:00	1	1	2	2	0	0	0	0	0	0	0	0	0	6
12:00 PM	0	0	0	3	4	0	0	0	0	0	0	0	0	7
1:00	1	0	0	1	0	0	0	0	0	0	0	0	0	2
2:00	2	2	0	3	0	0	0	0	0	0	0	0	0	7
3:00	0	0	1	2	4	1	0	0	0	0	0	0	0	8
4:00	0	0	2	2	1	0	0	0	0	0	0	0	0	5
5:00	0	1	0	3	4	0	0	0	0	0	0	0	0	8
6:00	0	3	5	2	2	0	0	0	0	0	0	0	0	12
7:00	0	2	1	2	1	1	0	0	0	0	0	0	0	7
8:00	0	0	1	1	1	0	1	0	0	0	0	0	0	4
9:00	0	0	0	1	0	0	0	0	0	0	0	0	0	1
10:00	1	0	0	0	0	0	0	0	0	0	0	0	0	1
11:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
Total	5	13	18	35	25	3	1	0	0	0	0	0	0	100



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Sunridge Counter #2
data file 09 27 2020
Date Printed: 10/2/2020
Start Date: 9/23/2020
End Date: 9/24/2020
GPS Accuracy: 0 ft
Location Verified: No

Latitude: 35.059680
Longitude: -106.734837
Direction: West, B to A

9/24/2020	0 - 15 MPH	> 15 - 20 MPH	> 20 - 25 MPH	> 25 - 30 MPH	> 30 - 35 MPH	> 35 - 40 MPH	> 40 - 45 MPH	> 45 - 50 MPH	> 50 - 55 MPH	> 55 - 60 MPH	> 60 - 65 MPH	> 65 - 70 MPH	> 70 MPH	Total
12:00 AM	0	0	0	0	0	0	0	0	0	0	0	0	0	0
1:00	1	0	0	0	0	0	0	0	0	0	0	0	0	1
2:00	0	0	0	0	1	0	0	0	0	0	0	0	0	1
3:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
4:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
5:00	0	0	1	0	1	0	0	0	0	0	0	0	0	2
6:00	0	1	5	2	1	0	0	0	0	0	0	0	0	9
7:00	0	0	0	4	3	0	0	0	0	0	0	0	0	7
8:00	0	0	1	3	0	3	2	0	0	0	0	0	0	9
9:00	3	3	1	3	1	0	0	0	0	0	0	0	0	11
10:00	0	0	2	3	3	1	0	0	0	0	0	0	0	9
11:00	3	1	1	1	1	0	0	0	0	0	0	0	0	7
12:00 PM	1	1	1	1	0	0	0	0	0	0	0	0	0	4
1:00	0	0	3	1	2	0	0	0	0	0	0	0	0	6
2:00	4	2	4	3	0	0	0	0	0	0	0	0	0	13
3:00	2	0	1	2	1	0	0	0	0	0	0	0	0	6
4:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
5:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
6:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
7:00	1	0	0	3	0	0	0	1	0	0	0	0	0	5
8:00	0	0	0	2	1	1	0	0	0	0	0	0	0	4
9:00	0	0	0	0	0	1	0	0	0	0	0	0	0	1
10:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0
11:00	0	0	2	0	0	0	0	0	0	0	0	0	0	2
Total	15	8	22	28	15	6	2	1	0	0	0	0	0	97
Grand Total	20	21	40	63	40	9	3	1	0	0	0	0	0	197
Stats	Percentile Speed	15th	50th	85th	95th									
	Mean Speed (Average)	27.2	18	26.1	32.6	35.2								
	10 MPH Pace Speed	25-34												
	Number in Pace	103												
	Percent in Pace	58.0%												
	Number > 25 MPH	116												
	Percent > 25 MPH	65.5%												




WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

Latitude: 35.059680
Longitude: -106.734837

File Name: Sunridge Counter #2
data file 09 27 2020
Date Printed: 10/2/2020
Start Date: 9/23/2020
End Date: 9/24/2020
GPS Accuracy: 0 ft
Location Verified: No

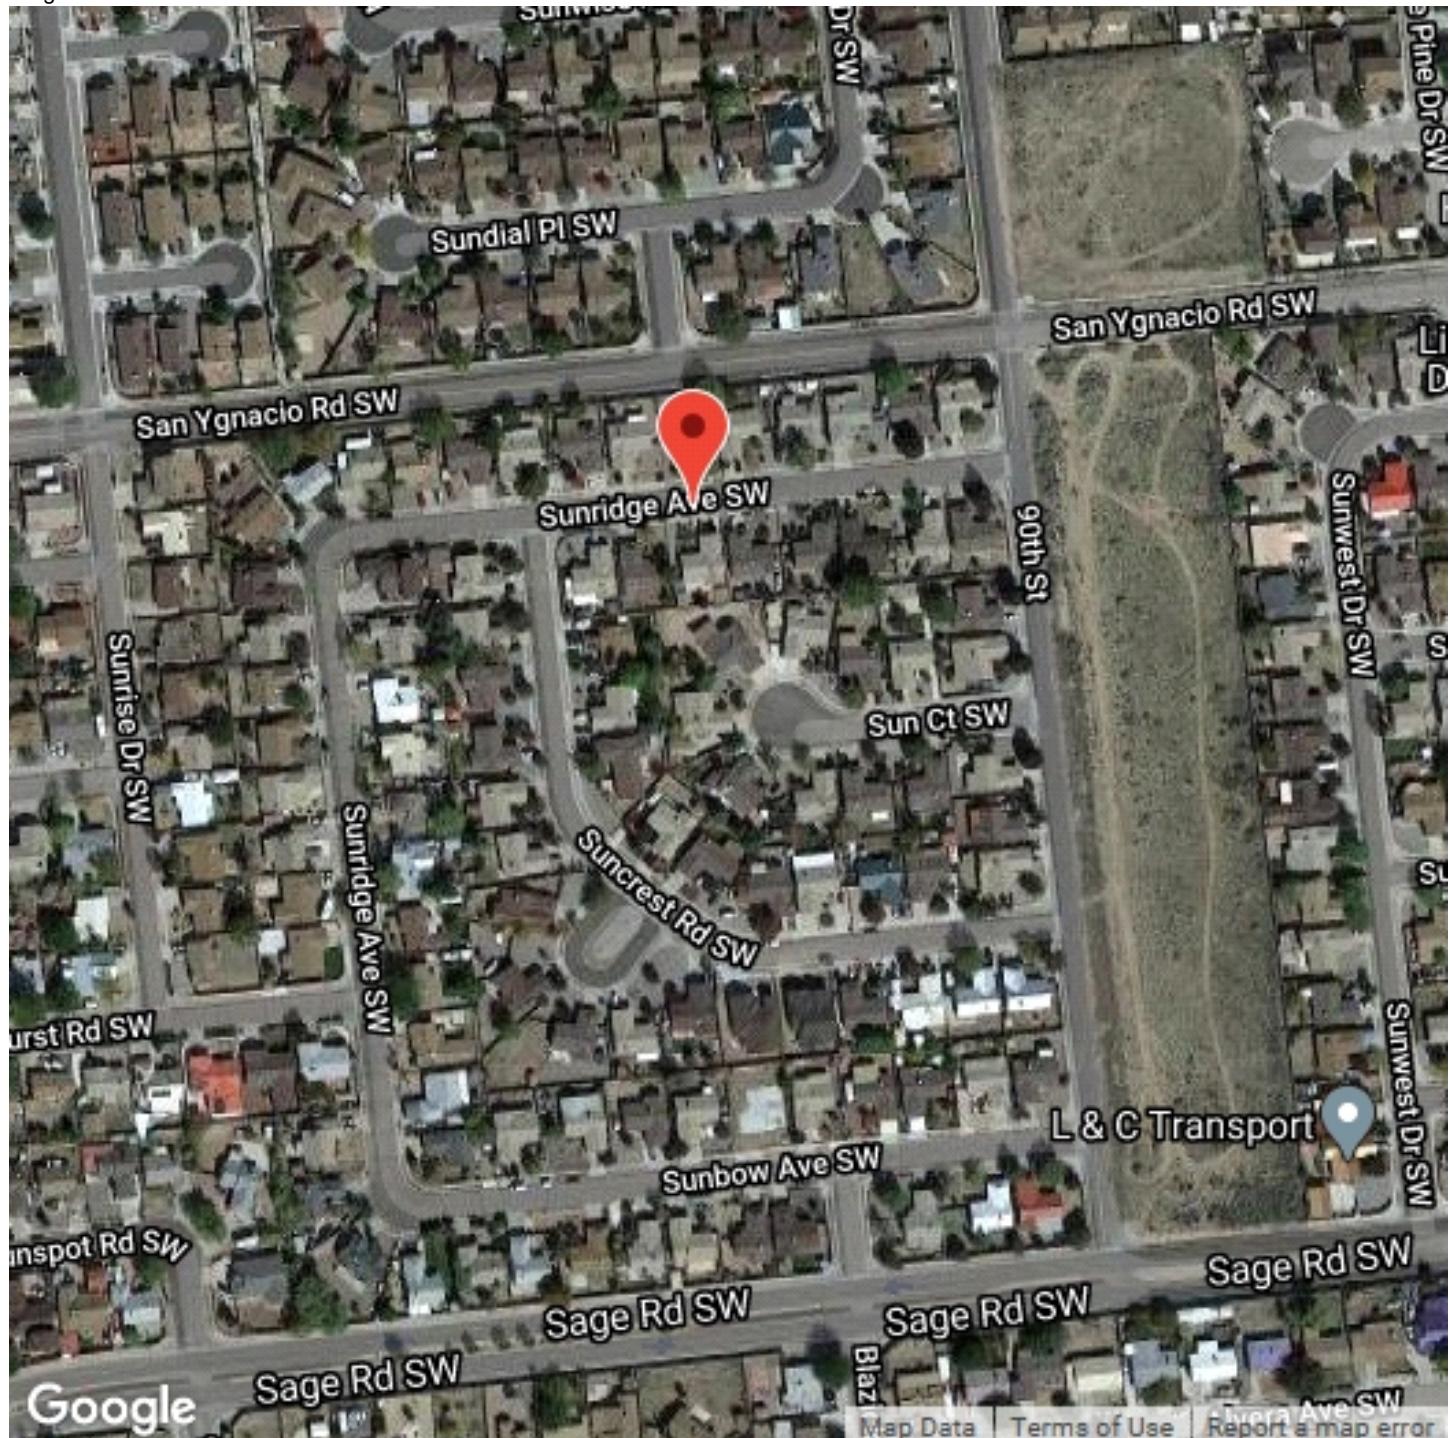



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

Speed Enforcement Evaluator



Analysis Dates

Start: 9/23/2020

End: 9/23/2020

Total Percentage of Enforceable Violations

Posted Speed Limit 25 MPH
Enforcement Tolerance 5 MPH

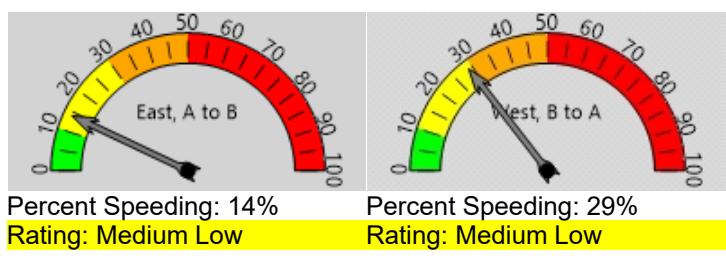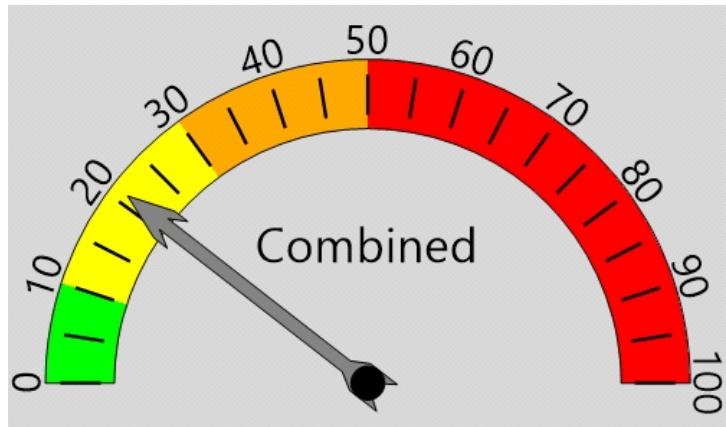

Vehicle Totals - Combined

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
23	39	50	66	38	6	2	0	0	0	0	0	0

85th Percentile: 32

Vehicle Totals - East, A to B

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
18	26	32	31	13	3	1	0	0	0	0	0	0

85th Percentile: 31.1

Vehicle Totals - West, B to A

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
5	13	18	35	25	3	1	0	0	0	0	0	0

85th Percentile: 32.6



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

Speed Enforcement Evaluator



Analysis Dates

Start: 9/24/2020

End: 9/24/2020

Total Percentage of Enforceable Violations

Posted Speed Limit 25 MPH
Enforcement Tolerance 5 MPH

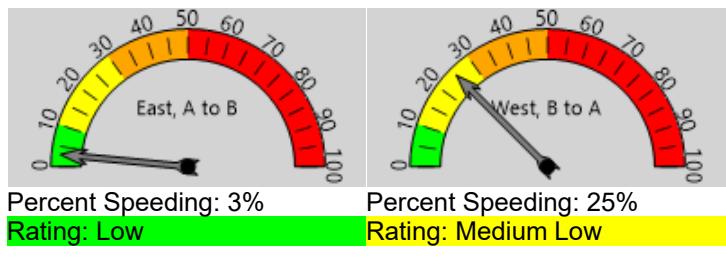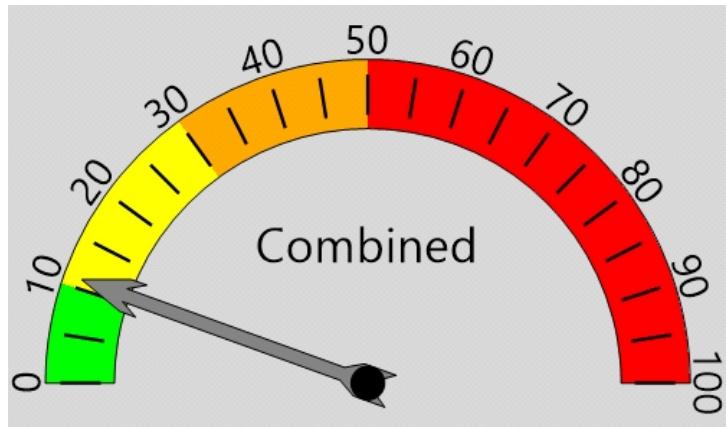

Vehicle Totals - Combined

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
104	26	48	39	18	6	2	2	0	0	0	0	0

85th Percentile: 32

Vehicle Totals - East, A to B

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
89	18	26	11	3	0	0	1	0	0	0	0	0

85th Percentile: 31.1

Vehicle Totals - West, B to A

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
15	8	22	28	15	6	2	1	0	0	0	0	0

85th Percentile: 33.8



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

Speed Enforcement Evaluator



Analysis Dates

Start: 9/23/2020

End: 9/23/2020

Total Percentage of Enforceable Violations

Posted Speed Limit 25 MPH
Enforcement Tolerance 7 MPH

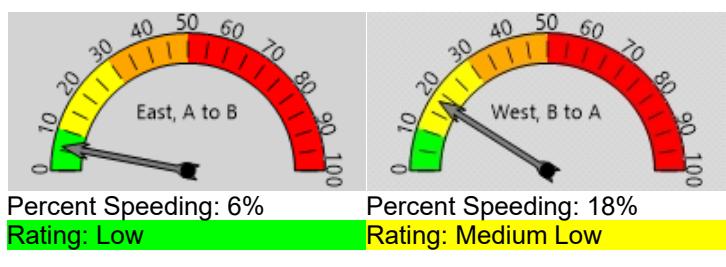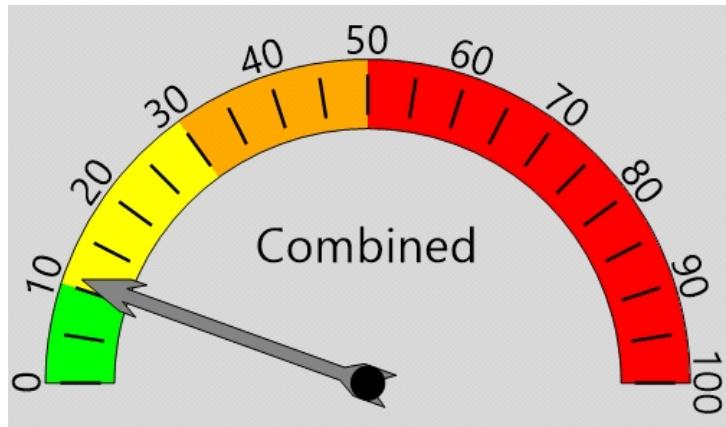

Vehicle Totals - Combined

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
23	39	50	66	38	6	2	0	0	0	0	0	0

85th Percentile: 32

Vehicle Totals - East, A to B

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
18	26	32	31	13	3	1	0	0	0	0	0	0

85th Percentile: 31.1

Vehicle Totals - West, B to A

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
5	13	18	35	25	3	1	0	0	0	0	0	0

85th Percentile: 32.6



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

Speed Enforcement Evaluator



Analysis Dates

Start: 9/24/2020

End: 9/24/2020

Total Percentage of Enforceable Violations

Posted Speed Limit 25 MPH
Enforcement Tolerance 7 MPH

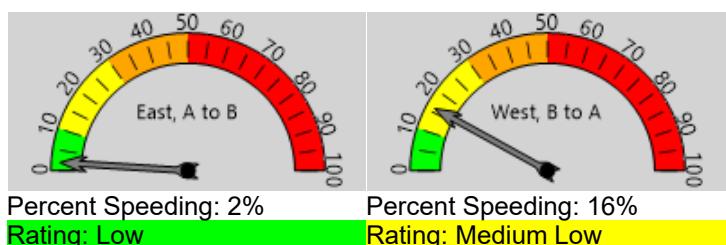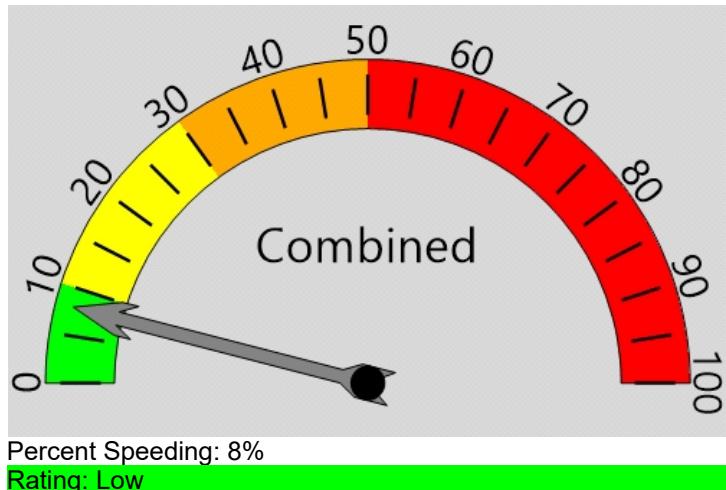

Vehicle Totals - Combined

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
104	26	48	39	18	6	2	2	0	0	0	0	0

85th Percentile: 32

Vehicle Totals - East, A to B


<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
89	18	26	11	3	0	0	1	0	0	0	0	0

85th Percentile: 31.1

Vehicle Totals - West, B to A

<= 15	<= 20	<= 25	<= 30	<= 35	<= 40	<= 45	<= 50	<= 55	<= 60	<= 65	<= 70	> 70
15	8	22	28	15	6	2	1	0	0	0	0	0

85th Percentile: 33.8

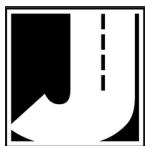

WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Sunridge Counter #2
data file 09 27 2020
Date Printed: 10/2/2020
Start Date: 9/23/2020
End Date: 9/24/2020
GPS Accuracy: 0 ft
Location Verified: No

Latitude: 35.059680
Longitude: -106.734837
Direction: East, A to B

9/23/2020 Time	Motor Cycles	Cars & Trailers	2 Axle Long	Buses	2 Axle 6 Tire	3 Axle Single	4 Axle Single	<5 Axl Double	5 Axle Double	>6 Axl Double	<6 Axl Multi	6 Axle Multi	>6 Axl Multi	No Class	Total
12:00 AM	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
1:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
2:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
3:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
4:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
5:00	0	0	1	0	0	0	0	0	0	0	0	0	0	0	1
6:00	0	1	0	0	0	0	0	0	0	0	0	0	0	0	1
7:00	0	0	2	0	0	0	0	0	0	0	0	0	0	0	3
8:00	0	1	3	0	0	0	0	0	0	0	0	0	0	0	4
9:00	0	0	5	0	0	0	0	0	0	0	0	0	0	0	5
10:00	0	2	2	0	1	0	0	0	0	0	0	0	0	0	5
11:00	0	2	2	0	1	0	0	0	0	0	0	0	0	0	5
12:00 PM	0	1	3	0	0	0	0	0	0	0	0	0	0	1	5
1:00	0	4	2	0	2	0	0	0	0	0	0	0	0	0	11
2:00	0	1	4	0	0	0	0	0	0	0	0	0	0	0	6
3:00	1	3	8	0	1	0	0	0	0	0	0	0	0	0	15
4:00	0	9	8	0	3	0	0	0	0	0	0	0	0	0	21
5:00	0	2	7	0	1	0	0	0	0	0	0	0	0	0	11
6:00	0	8	3	0	0	0	0	0	0	0	0	0	0	0	11
7:00	0	3	1	0	3	0	0	0	0	0	0	0	0	0	7
8:00	0	4	3	0	0	0	0	0	0	0	0	0	0	0	7
9:00	0	3	1	0	0	0	0	0	0	0	0	0	0	0	4
10:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
11:00	0	1	0	0	1	0	0	0	0	0	0	0	0	0	2
Total	1	45	55	0	13	0	0	0	0	0	0	0	0	10	124
Percent	0.8%	36.3%	44.4%	0.0%	10.5%	0.0%	0.0%	0.0%	0.0%	0.0%	0.0%	0.0%	0.0%	8.1%	
AM Peak		10:00	9:00		10:00									7:00	9:00
	*	2	5	*	1	*	*	*	*	*	*	*	*	1	5
PM Peak	3:00	4:00	3:00		4:00									1:00	4:00
	1	9	8	*	3	*	*	*	*	*	*	*	*	3	21



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Sunridge Counter #2
data file 09 27 2020
Date Printed: 10/2/2020
Start Date: 9/23/2020
End Date: 9/24/2020
GPS Accuracy: 0 ft
Location Verified: No

Latitude: 35.059680

Longitude: -106.734837

Direction: East, A to B

9/24/2020 Time	Motor Cycles	Cars & Trailers	2 Axle Long	Buses	2 Axle 6 Tire	3 Axle Single	4 Axle Single	<5 Axl Double	5 Axle Double	>6 Axl Double	<6 Axl Multi	6 Axle Multi	>6 Axl Multi	No Class	Total
12:00 AM	0	0	1	0	0	0	0	0	0	0	0	0	0	0	1
1:00	0	2	0	0	0	1	0	0	0	0	0	0	0	0	3
2:00	0	1	0	0	0	0	0	0	0	0	0	0	0	0	1
3:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
4:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
5:00	0	0	1	0	0	0	0	0	0	0	0	0	0	0	1
6:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
7:00	0	1	0	0	0	0	0	0	0	0	0	0	0	0	1
8:00	0	2	1	0	0	1	0	0	0	0	0	0	0	0	6
9:00	0	3	3	0	1	1	0	0	0	0	0	0	0	0	9
10:00	0	2	0	0	0	0	0	0	0	0	0	0	0	0	2
11:00	0	5	1	0	0	0	0	0	0	0	0	0	0	0	6
12:00 PM	0	1	1	0	0	0	0	0	0	0	0	0	0	0	2
1:00	0	3	0	0	1	0	0	0	0	0	0	0	0	0	5
2:00	0	3	2	0	0	0	0	0	0	0	0	0	0	0	8
3:00	0	2	1	0	0	1	0	0	0	0	0	0	0	0	11
4:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	20
5:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	21
6:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	19
7:00	0	8	4	0	1	0	0	0	0	0	0	0	0	0	15
8:00	0	5	3	0	0	0	0	0	0	0	0	0	0	0	8
9:00	0	3	2	0	0	0	0	0	0	0	0	0	0	0	5
10:00	0	1	0	0	0	0	0	0	0	0	0	0	0	0	1
11:00	0	0	2	0	0	0	0	0	0	0	0	0	0	0	3
Total	0	42	22	0	3	4	0	0	0	0	0	0	0	77	148
Percent	0.0%	28.4%	14.9%	0.0%	2.0%	2.7%	0.0%	0.0%	0.0%	0.0%	0.0%	0.0%	0.0%	52.0%	
AM Peak		11:00	9:00		9:00	1:00								8:00	9:00
	*	5	3	*	1	1	*	*	*	*	*	*	*	2	9
PM Peak		7:00	7:00		1:00	3:00								5:00	5:00
	*	8	4	*	1	1	*	*	*	*	*	*	*	21	21
Grand Total	1	87	77	0	16	4	0	0	0	0	0	0	0	87	272
Percent	0.4%	32.0%	28.3%	0.0%	5.9%	1.5%	0.0%	0.0%	0.0%	0.0%	0.0%	0.0%	0.0%	32.0%	



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Sunridge Counter #2
data file 09 27 2020
Date Printed: 10/2/2020
Start Date: 9/23/2020
End Date: 9/24/2020
GPS Accuracy: 0 ft
Location Verified: No

Latitude: 35.059680
Longitude: -106.734837
Direction: West, B to A

9/23/2020 Time	Motor Cycles	Cars & Trailers	2 Axle Long	Buses	2 Axle 6 Tire	3 Axle Single	4 Axle Single	<5 Axl Double	5 Axle Double	>6 Axl Double	<6 Axl Multi	6 Axle Multi	>6 Axl Multi	No Class	Total
12:00 AM	0	0	1	0	0	0	0	0	0	0	0	0	0	0	1
1:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
2:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
3:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
4:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
5:00	0	0	3	0	0	0	0	0	0	0	0	0	0	0	3
6:00	1	1	4	0	1	0	0	0	0	0	0	0	0	0	7
7:00	0	0	4	0	1	0	0	0	0	0	0	0	0	0	5
8:00	0	3	1	0	1	0	0	0	0	0	0	0	0	0	5
9:00	0	0	1	0	0	0	0	0	0	0	0	0	0	0	1
10:00	0	2	5	0	3	0	0	0	0	0	0	0	0	0	10
11:00	0	2	3	0	1	0	0	0	0	0	0	0	0	0	6
12:00 PM	0	1	5	0	1	0	0	0	0	0	0	0	0	0	7
1:00	0	1	0	0	0	0	0	0	0	0	0	0	0	0	2
2:00	0	0	5	0	1	0	0	0	0	0	0	0	0	0	7
3:00	0	0	8	0	0	0	0	0	0	0	0	0	0	0	8
4:00	0	1	3	0	1	0	0	0	0	0	0	0	0	0	5
5:00	0	2	5	0	1	0	0	0	0	0	0	0	0	0	8
6:00	0	1	11	0	0	0	0	0	0	0	0	0	0	0	12
7:00	0	2	5	0	0	0	0	0	0	0	0	0	0	0	7
8:00	0	0	4	0	0	0	0	0	0	0	0	0	0	0	4
9:00	0	0	0	0	0	0	0	1	0	0	0	0	0	0	1
10:00	1	0	0	0	0	0	0	0	0	0	0	0	0	0	1
11:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
Total	2	16	68	0	11	0	0	1	0	0	0	0	0	2	100
Percent	2.0%	16.0%	68.0%	0.0%	11.0%	0.0%	0.0%	1.0%	0.0%	0.0%	0.0%	0.0%	0.0%	2.0%	
AM Peak	6:00	8:00	10:00		10:00										10:00
	1	3	5	*	3	*	*	*	*	*	*	*	*	*	10
PM Peak	10:00	5:00	6:00		12:00			9:00						1:00	6:00
	1	2	11	*	1	*	*	1	*	*	*	*	*	*	12



WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

File Name: Sunridge Counter #2
data file 09 27 2020
Date Printed: 10/2/2020
Start Date: 9/23/2020
End Date: 9/24/2020
GPS Accuracy: 0 ft
Location Verified: No

Latitude: 35.059680
Longitude: -106.734837
Direction: West, B to A

9/24/2020 Time	Motor Cycles	Cars & Trailers	2 Axle Long	Buses	2 Axle 6 Tire	3 Axle Single	4 Axle Single	<5 Axl Double	5 Axle Double	>6 Axl Double	<6 Axl Multi	6 Axle Multi	>6 Axl Multi	No Class	Total
12:00 AM	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
1:00	0	0	1	0	0	0	0	0	0	0	0	0	0	0	1
2:00	0	0	1	0	0	0	0	0	0	0	0	0	0	0	1
3:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
4:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
5:00	0	0	2	0	0	0	0	0	0	0	0	0	0	0	2
6:00	0	3	5	0	1	0	0	0	0	0	0	0	0	0	9
7:00	0	0	5	0	1	0	0	1	0	0	0	0	0	0	7
8:00	0	1	5	0	3	0	0	0	0	0	0	0	0	0	9
9:00	1	2	6	0	2	0	0	0	0	0	0	0	0	0	11
10:00	0	2	6	0	1	0	0	0	0	0	0	0	0	0	9
11:00	0	1	3	0	1	0	0	1	0	0	0	0	0	1	7
12:00 PM	0	1	2	0	1	0	0	0	0	0	0	0	0	0	4
1:00	0	2	4	0	0	0	0	0	0	0	0	0	0	0	6
2:00	0	1	7	1	0	1	0	0	0	0	0	0	0	3	13
3:00	0	0	2	0	3	0	0	0	0	0	0	0	0	1	6
4:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
5:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
6:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
7:00	1	0	3	0	1	0	0	0	0	0	0	0	0	0	5
8:00	0	0	3	0	1	0	0	0	0	0	0	0	0	0	4
9:00	0	0	1	0	0	0	0	0	0	0	0	0	0	0	1
10:00	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
11:00	0	0	0	0	2	0	0	0	0	0	0	0	0	0	2
Total	2	13	56	1	17	1	0	2	0	0	0	0	0	5	97
Percent	2.1%	13.4%	57.7%	1.0%	17.5%	1.0%	0.0%	2.1%	0.0%	0.0%	0.0%	0.0%	0.0%	5.2%	
AM Peak	9:00	6:00	9:00		8:00			7:00						11:00	9:00
	1	3	6	*	3	*	*	1	*	*	*	*	*	1	11
PM Peak	7:00	1:00	2:00	2:00	3:00	2:00								2:00	2:00
	1	2	7	1	3	1	*	*	*	*	*	*	*	3	13
Grand Total	4	29	124	1	28	1	0	3	0	0	0	0	0	7	197
Percent	2.0%	14.7%	62.9%	0.5%	14.2%	0.5%	0.0%	1.5%	0.0%	0.0%	0.0%	0.0%	0.0%	3.6%	




WILSON & COMPANY

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109

Latitude: 35.059680
Longitude: -106.734837

File Name: Sunridge Counter #2
data file 09 27 2020
Date Printed: 10/2/2020
Start Date: 9/23/2020
End Date: 9/24/2020
GPS Accuracy: 0 ft
Location Verified: No

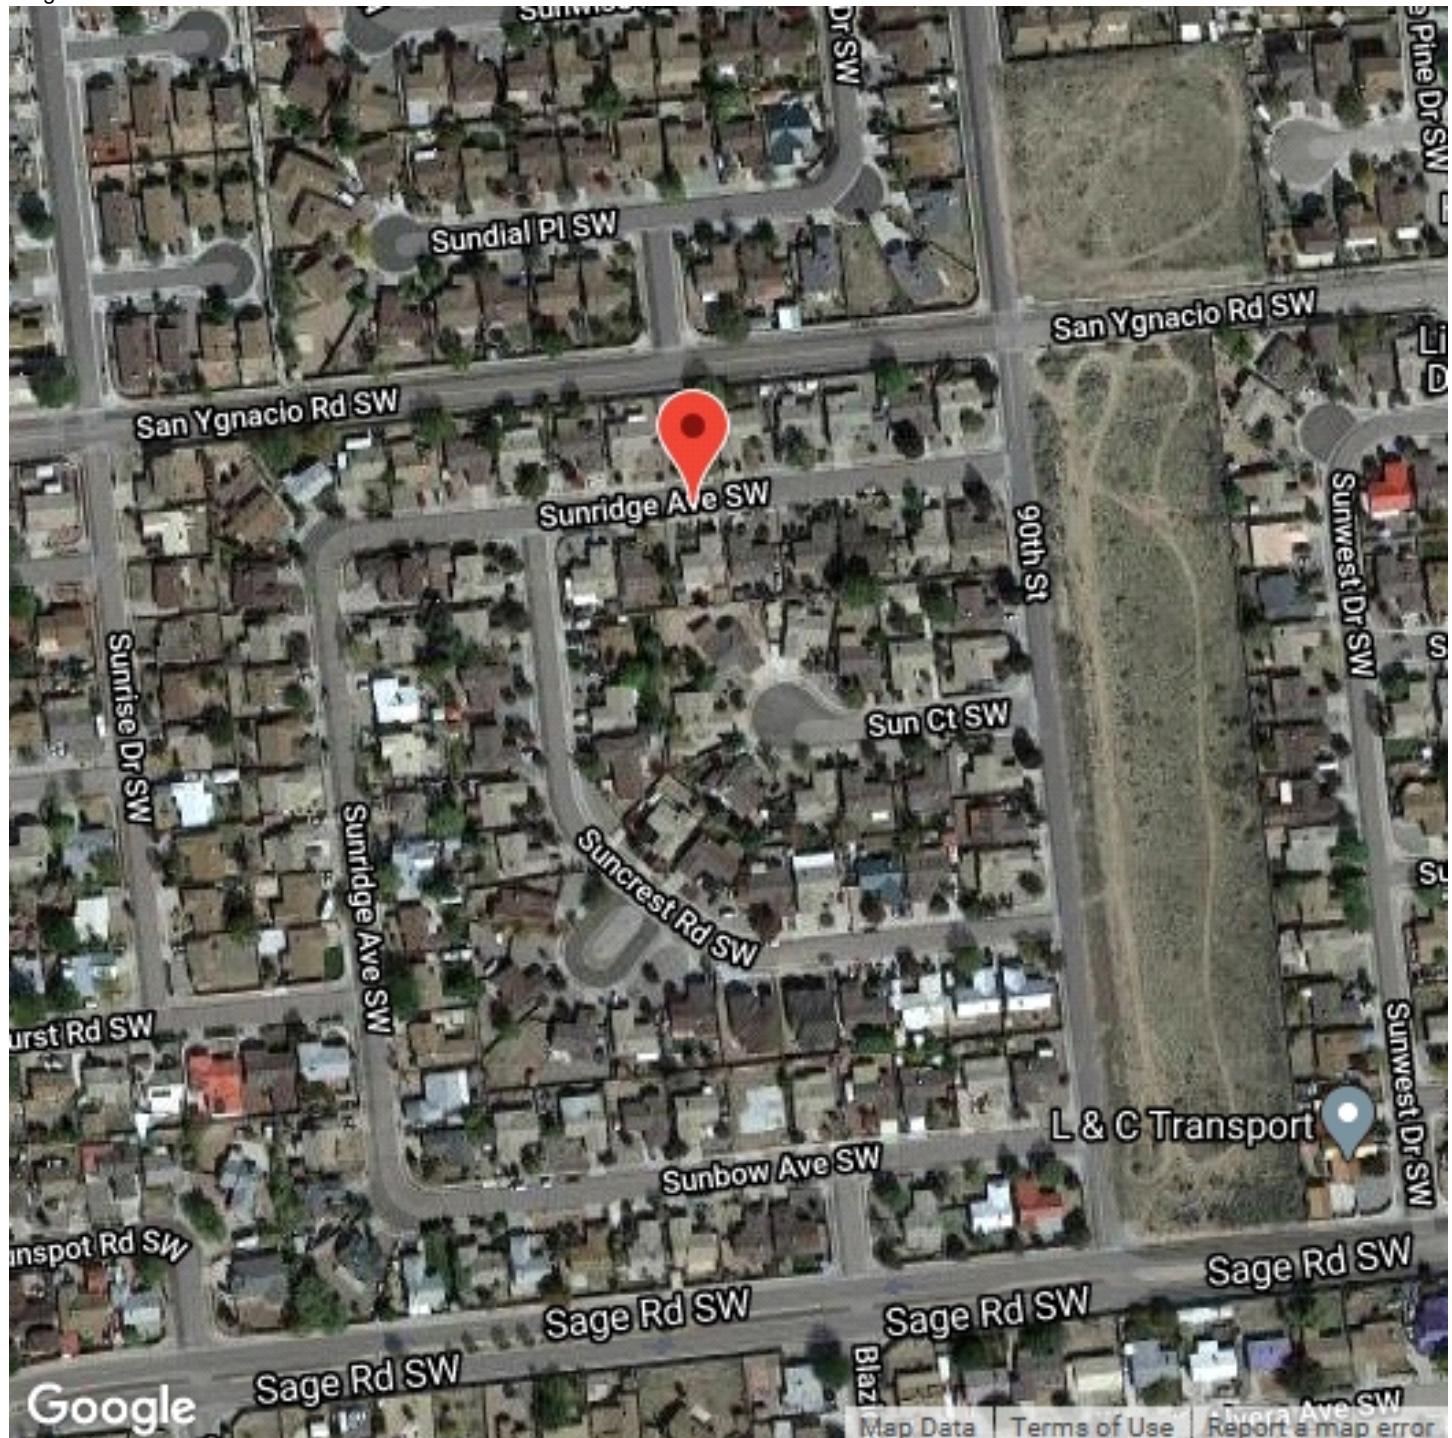

Appendix B – Crash Data



WILSON
& COMPANY
ENGINEERS & ARCHITECTS

4401 Masthead Street NE, Suite 150
Albuquerque, NM 87109
phone: 505-348-4000
fax: 505-348-4055

www.wilsonco.com